

FAGOR AUTOMATION

M- Model
(Soft V15.3x)

CNC 8035

Ref. 1106

PROGRAMMING MANUAL



FAGOR





All rights reserved. No part of this documentation may be transmitted, transcribed, stored in a backup device or translated into another language without Fagor Automation's consent. Unauthorized copying or distributing of this software is prohibited.

The information described in this manual may be changed due to technical modifications. Fagor Automation reserves the right to make any changes to the contents of this manual without prior notice.

All the trade marks appearing in the manual belong to the corresponding owners. The use of these marks by third parties for their own purpose could violate the rights of the owners.

It is possible that CNC can execute more functions than those described in its associated documentation; however, Fagor Automation does not guarantee the validity of those applications. Therefore, except under the express permission from Fagor Automation, any CNC application that is not described in the documentation must be considered as "impossible". In any case, Fagor Automation shall not be held responsible for any personal injuries or physical damage caused or suffered by the CNC if it is used in any way other than as explained in the related documentation.

The content of this manual and its validity for the product described here has been verified. Even so, involuntary errors are possible, thus no absolute match is guaranteed. Anyway, the contents of the manual is periodically checked making and including the necessary corrections in a future edition. We appreciate your suggestions for improvement.

The examples described in this manual are for learning purposes. Before using them in industrial applications, they must be properly adapted making sure that the safety regulations are fully met.

This product uses the following source code, subject to the terms of the GPL license. The applications *busybox* V0.60.2; *dosfstools* V2.9; *linux-ftpd* V0.17; *ppp* V2.4.0; *uteln* V0.1.1. The library *grx* V2.4.4. The linux kernel V2.4.4. The linux boot *ppcboot* V1.1.3. If you would like to have a CD copy of this source code sent to you, send 10 Euros to Fagor Automation for shipping and handling.

INDEX

	About the product.....	9
	Declaration of conformity.....	11
	Version history (M).....	13
	Safety conditions.....	19
	Warranty terms.....	23
	Material returning terms.....	25
	Additional remarks.....	27
	Fagor documentation.....	29
CHAPTER 1	GENERAL CONCEPTS	
	<hr/>	
	1.1 Part programs.....	32
	1.2 DNC connection.....	34
	1.3 Communication protocol via DNC or peripheral device.....	35
CHAPTER 2	CREATING A PROGRAM	
	<hr/>	
	2.1 Program structure at the CNC.....	38
	2.1.1 Block header.....	39
	2.1.2 Program block.....	40
	2.1.3 End of block.....	41
CHAPTER 3	AXES AND COORDINATE SYSTEMS	
	<hr/>	
	3.1 Axis nomenclature.....	44
	3.2 Plane selection (G16, G17, G18, G19).....	45
	3.3 Part dimensioning. Millimeters (G71) or inches (G70).....	47
	3.4 Absolute/incremental programming (G90, G91).....	48
	3.5 Coordinate programming.....	49
	3.5.1 Cartesian coordinates.....	50
	3.5.2 Polar coordinates.....	51
	3.5.3 Cylindrical coordinates.....	53
	3.5.4 Angle and one Cartesian coordinate.....	54
	3.6 Rotary axes.....	55
	3.7 Work zones.....	56
	3.7.1 Definition of the work zones.....	57
	3.7.2 Using the work zones.....	58
CHAPTER 4	REFERENCE SYSTEMS	
	<hr/>	
	4.1 Reference points.....	59
	4.2 Machine reference (Home) search (G74).....	60
	4.3 Programming with respect to machine zero (G53).....	61
	4.4 Coordinate preset and zero offsets.....	62
	4.4.1 Coordinate preset and S value limitation (G92).....	63
	4.4.2 Zero offsets (G54..G59 and G159).....	64
	4.5 Polar origin preset (G93).....	66
CHAPTER 5	ISO CODE PROGRAMMING	
	<hr/>	
	5.1 Preparatory functions.....	68
	5.2 Feedrate F.....	70
	5.2.1 Feedrate in mm/min or inches/min (G94).....	71
	5.2.2 Feedrate in mm/rev. or inches/rev (G95).....	72
	5.2.3 Constant surface speed (G96).....	73
	5.2.4 Constant tool center speed (G97).....	74
	5.3 Spindle speed (S).....	75
	5.4 Tool number (T) and tool offset (D).....	76



CNC 8035

-M- MODEL
(SOFT V15.3x)

5.5	Auxiliary function (M).....	77
5.5.1	M00. Program stop.....	78
5.5.2	M01. Conditional program stop.....	79
5.5.3	M02. End of program.....	80
5.5.4	M30. End of program with return to the first block.....	81
5.5.5	M03 Clockwise spindle rotation.....	82
5.5.6	M04. Counterclockwise spindle rotation.....	83
5.5.7	M05. Spindle stop.....	84
5.5.8	M06. Tool change code.....	85
5.5.9	M19. Spindle orientation.....	86
5.5.10	M41, M42, M43, M44. Spindle gear change.....	87

CHAPTER 6

PATH CONTROL

6.1	Rapid traverse (G00).....	90
6.2	Linear interpolation (G01).....	91
6.3	Circular interpolation (G02, G03).....	92
6.4	Circular interpolation with absolute arc center coordinates (G06).....	97
6.5	Arc tangent to previous path (G08).....	98
6.6	Arc defined by three points (G09).....	99
6.7	Helical interpolation.....	100
6.8	Tangential entry at the beginning of a machining operation (G37).....	101
6.9	Tangential exit at the end of a machining operator (G38).....	103
6.10	Automatic radius blend (G36).....	104
6.11	Chamfer (G39).....	105
6.12	Threading (G33).....	106
6.13	Variable pitch threads (G34).....	108
6.14	Move to hardstop (G52).....	109
6.15	Feedrate "F" as an inverted function of time (G32).....	110

CHAPTER 7

ADDITIONAL PREPARATORY FUNCTIONS

7.1	Interruption of block preparation (G04).....	111
7.1.1	G04 K0: Block preparation interruption and coordinate update.....	113
7.2	Dwell (G04 K).....	114
7.3	Working with square (G07) and round (G05,G50) corners.....	115
7.3.1	G07 (square corner).....	115
7.3.2	G05 (round corner).....	116
7.3.3	Controlled round corner (G50).....	117
7.4	Look-ahead (G51).....	118
7.4.1	Advanced look-ahead algorithm (integrating Fagor filters).....	120
7.4.2	Look-ahead operation with Fagor filters active.....	121
7.4.3	Smoother machining feedrate.....	122
7.5	Mirror image (G10, G11, G12, G13, G14).....	123
7.6	Scaling factor (G72).....	125
7.6.1	Scaling factor applied to all axes.....	126
7.6.2	Scaling factor applied to one or more axes.....	128
7.7	Pattern rotation (G73).....	130

CHAPTER 8

TOOL COMPENSATION

8.1	Tool radius compensation (G40, G41, G42).....	134
8.1.1	Beginning of tool radius compensation.....	135
8.1.2	Sections of tool radius compensation.....	138
8.1.3	Cancellation of tool radius compensation.....	139
8.1.4	Change of type of tool radius compensation while machining.....	145
8.2	Tool length compensation (G43, G44, G15).....	146
8.3	Collision detection (G41 N, G42 N).....	148

CHAPTER 9

CANNED CYCLES

9.1	Canned cycle definition.....	150
9.2	Influence zone of a canned cycle.....	151
9.2.1	G79. Modification of the canned cycle parameters.....	152
9.3	Canned cycle cancellation.....	154
9.4	Some general points to consider.....	155
9.5	Machining canned cycles.....	156
9.6	G69. Drilling canned cycle with variable peck.....	158
9.6.1	Basic operation.....	161
9.7	G81. Drilling canned cycle.....	164
9.7.1	Basic operation.....	165
9.8	G82. Drilling canned cycle with dwell.....	167
9.8.1	Basic operation.....	168



CNC 8035

-M- MODEL
(SOFT V15.3x)

9.9	G83. Deep-hole drilling canned cycle with constant peck	170
9.9.1	Basic operation	172
9.10	G84. Tapping canned cycle	175
9.10.1	Basic operation	177
9.11	G85. Reaming canned cycle	180
9.11.1	Basic operation	181
9.12	G86. Boring cycle with withdrawal in G00	182
9.12.1	Basic operation	184
9.13	G87. Rectangular pocket canned cycle	185
9.13.1	Basic operation	189
9.14	G88. Circular pocket canned cycle	192
9.14.1	Basic operation	196
9.15	G89. Boring cycle with withdrawal at work feedrate (G01)	198
9.15.1	Basic operation	199
9.16	G210. Bore milling canned cycle	200
9.16.1	Basic operation	202
9.17	G211. Inside thread milling cycle	203
9.17.1	Basic operation	205
9.18	G212. Outside thread milling cycle	206
9.18.1	Basic operation	208

CHAPTER 10 MULTIPLE MACHINING

10.1	G60: Multiple machining in a straight line	210
10.1.1	Basic operation	212
10.2	G61: Multiple machining in a rectangular pattern	213
10.2.1	Basic operation	215
10.3	G62: Multiple machining in a grid pattern	216
10.3.1	Basic operation	218
10.4	G63: Multiple machining in a circular pattern	219
10.4.1	Basic operation	221
10.5	G64: Multiple machining in an arc	222
10.5.1	Basic operation	224
10.6	G65: Machining programmed with an arc-chord	225
10.6.1	Basic operation	226

CHAPTER 11 PROBING

11.1	Probing (G75, G76)	228
------	--------------------------	-----

CHAPTER 12 HIGH-LEVEL LANGUAGE PROGRAMMING

12.1	Lexical description	229
12.2	Variables	231
12.2.1	General purpose parameters or variables	233
12.2.2	Variables associated with tools	235
12.2.3	Variables associated with zero offsets	238
12.2.4	Variables associated with machine parameters	240
12.2.5	Variables associated with work zones	241
12.2.6	Variables associated with feedrates	243
12.2.7	Variables associated with coordinates	245
12.2.8	Variables associated with electronic handwheels	248
12.2.9	Variables associated with feedback	250
12.2.10	Variables associated with the main spindle	251
12.2.11	PLC related variables	254
12.2.12	Variables associated with local parameters	256
12.2.13	Operating-mode related variables	257
12.2.14	Other variables	259
12.3	Constants	264
12.4	Operators	265
12.5	Expressions	267
12.5.1	Arithmetic expressions	268
12.5.2	Relational expressions	269

CHAPTER 13 PROGRAM CONTROL INSTRUCTIONS

13.1	Assignment instructions	272
13.2	Display instructions	273
13.3	Enable-disable instructions	274
13.4	Flow control instructions	275
13.5	Subroutine instructions	277
13.6	Interruption-subroutine instructions	282
13.7	Program instructions	283
13.8	Screen customizing instructions	286



CNC 8035

-M- MODEL
(SOFT V15.3x)

CHAPTER 14

ANGULAR TRANSFORMATION OF AN INCLINE AXIS

14.1	Turning angular transformation on and off	295
14.2	Freezing the angular transformation.....	296

APPENDIX

A	ISO code programming	299
B	Program control instructions.....	301
C	Summary of internal CNC variables.	303
D	Key codes.....	307
E	Maintenance	309



CNC 8035

·M· MODEL
(SOFT V15.3x)

ABOUT THE PRODUCT

Basic characteristics.

RAM memory	256 Kb
PLC cycle time	3 ms / 1000 instructions
RS-232 serial line	Standard
DNC (via RS232)	Standard
5 V or 24 V probe inputs	2
Digital inputs and outputs.	40 I / 24 O
Feedback inputs for the axes and spindle	4 TTL/1Vpp inputs
Feedback inputs for handwheels	2 TTL inputs

Software options.

	Model					
	M-MON	M-MON-R	M-COL	M-COL-R	T-MON	T-COL
Number of axes	3	3	3	3	2	2
Hard disk	Opt	Opt	Opt	Opt	Opt	Opt
Electronic threading	Stand	Stand	Stand	Stand	Stand	Stand
Tool magazine management:	Stand	Stand	Stand	Stand	Stand	Stand
Machining canned cycles	Stand	Stand	Stand	Stand	Stand	Stand
Multiple machining	Stand	Stand	Stand	Stand	-----	-----
Rigid tapping	Stand	Stand	Stand	Stand	Stand	Stand
DNC	Stand	Stand	Stand	Stand	Stand	Stand
Tool radius compensation	Stand	Stand	Stand	Stand	Stand	Stand
Retracing	-----	Stand	-----	Stand	-----	-----
Color monitor	-----	-----	Stand	Stand	-----	Stand



Before start-up, verify that the machine that integrates this CNC meets the 89/392/ CEE Directive.

FAGOR

CNC 8035

DECLARATION OF CONFORMITY

The manufacturer:

Fagor Automation S. Coop.
Barrio de San Andrés Nº 19, C.P. 20500, Mondragón -Guipúzcoa- (SPAIN).

Declares:

Under their responsibility that the product:

8035 CNC

Consisting of the following modules and accessories:

8035-M, 8035-T

Note. Some additional characters may follow the references mentioned above. They all comply with the directives listed. However, check that that's the case by checking the label of the unit itself.

Referred to by this declaration with following directives:

Low voltage regulations.

EN 60204-1: 2006 Electrical equipment on machines — Part 1. General requirements.


Regulation on electromagnetic compatibility.

EN 61131-2: 2007 PLC — Part 2. Unit requirements and tests.

As instructed by the European Community Directives 2006/95/EEC on Low Voltage and 2004/108/EC on Electromagnetic Compatibility and its updates.

In Mondragón, July 27th, 2010.

Fagor Automation, S. Coop.

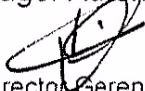
Director Gerente
Pedro Ruiz de Aguirre

FAGOR 

CNC 8035

VERSION HISTORY (M)

(mill model)

Here is a list of the features added in each software version and the manuals that describe them.

The version history uses the following abbreviations:

INST	Installation manual
PRG	Programming manual
OPT	Operating manual

Software V07.1x

July 2003

First version.

Software V09.0x

February 2004

List of features	Manual
Incline axis.	INST / PRG
Machine parameters. TOOLTYPE (P167): Stop block preparation when executing a new "T". TOOLTYPE (P167): Execute the stop signal when done with the "T" change. FEEDTYPE (P169): Select the behavior of the feedrate for F0. TYPCROSS (P135): On Gantry axes, cross compensation is also applied to the slave axis. RAPIDEN (P130): Rapid key controlled by PLC. General parameters that may be modified from OEM subroutine/program: CODISET. Axis parameters that may be modified from OEM subroutine/program: MAXFLWE1, MAXFLWE2.	INST
PLC marks. Name the logic inputs and outputs with the axis name BLOABOR: Ending the execution of a block using a PLC mark (main channel). BLOABORP: Ending the execution of a block using a PLC mark (PLC channel). ELIMIS: Park the spindle.	INST
While compiling the PLC program, the outputs are initialized to zero.	
Variables. SELPRO: Variable to select the active probe input. DIAM: Variable to select the programming mode, radius or diameter.	INST / PRG
G2/G3. There is no need to program the center coordinates if their value is zero.	PRG
M41-M44: These functions admit subroutines when the gear change is automatic.	PRG



CNC 8035

List of features	Manual
Calculation of central unit heat dissipation .	INST
New board "Axes2".	INST
Automatic keyboard type identification.	INST
Frequency filters for axes and spindles.	INST
Machine parameters. COMPmode (P175). New tool radius compensation methods. Axis parameters that may be modified from OEM subroutine/program: REFVALUE, REFDIR, FLIMIT. Spindle parameters that may be modified from OEM subroutine/program: REFVALUE, REFDIR, SLIMIT.	INST
Variables. DNCSTA: DNC communication status. TIMEG: Status of the timer count programmed with G4 HANDSE: Handwheel's axis selector button pressed. ANAI(n): Value of the analog inputs. APOS(X-C): Real coordinates of the tool base, referred to part zero. ATPOS(X-C): Theoretical coordinates of the tool base, referred to part zero.	INST / PRG
Retracing function. If RETRACAC=2 , the retrace function does not stop at the M functions. The RETRACAC parameter is initialized with [SHIFT][RESET]. The number of blocks being retraced has been increased to 75.	INST
When activating tool radius compensation in the first motion block even if there is no movement of the plane axes.	INST
Manual intervention with additive handwheel.	INST / OPT
G46. Maintain G46 when the home search does not involve any axis of the angular transformation.	INST / PRG
MEXEC. Execute a modal part-program.	PRG
Up to 319 G functions now available.	PRG
The simulations without axis movement ignore the G4.	OPT
Maintain the feedrate selected in simulation.	OPT

Software V9.12

February 2005

List of features	Manual
Look-ahead	INST / PRG

Software V09.13

April 2005

List of features	Manual
Hirth axis pitch may be set in degrees via parameters.	INST
Rollover positioning axis. Movement in G53 via the shortest way.	INST

Software V09.15

June 2005

List of features	Manual
CAN servo system.	INST



CNC 8035

List of features	Manual
The CNC supports Memkey Card + Compact Flash or KeyCF.	OPT
File explorer to show the contents of the storage devices.	INST / OPT
Loading the version from the Memkey card or from the hard disk.	OPT
New way to search home that may be selected through g.m.p. I0TYPE=3.	INST
Improved block search. Switching from simulation to execution.	INST / OPT
New repositioning mode that is activated by setting g.m.p. REPOSTY=1.	INST/PRG/OPT
Square-sine ramps on open-loop spindle.	INST
Numbering of the local inputs/outputs of the expansion modules using plc machine parameters.	INST
Default value of axis and spindle machine parameter ACFGAIN = YES.	INST
Setting axis parameters FFGAIN and FFGAIN2 with two decimals.	INST
Up to 400 (DEF) symbols now available at the PLC.	INST
New HTOR variable that indicates the tool radius being used by the CNC.	INST / PRG
Longitudinal axis definition with G16.	INST / PRG

List of features	Manual
Handwheel feedback taken to a free feedback connector.	INST
New variables: RIP, GGSE, GGSF, GGSG, GGSH, GGSJ, GGSK, GGSL, GGSM, PRGSP and PRBMOD	INST
G04 K0. Block preparation interruption and coordinate update.	PRG

List of features	Manual
Smooth stop when homing the axes, it may be selected with a.m.p. I0TYPE.	INST

List of features	Manual
Selecting the additive handwheel as handwheel associated with the axis.	INST

List of features	Manual
Copy and execute programs on Hard Disk (KeyCF)	OPT

List of features	Manual
Display of PLC or CNC messages in Russian and Chinese.	INST
New FAGOR filters.	INST
Leadscrew backlash compensation. Compensation peak cutting criterion.	INST
Home search on Gantry axes (managing two home switches).	INST
Automatic spindle homing with the first M3/M4.	OPT
Allow two "switched" axes to have different gear ratios.	INST
Look-Ahead. Angle below which, it machines in square corner mode.	PRG
Teach-in. Execution of the edited block.	OPT
Improvements to the oscilloscope and direct access from jog and execution modes.	OPT
Editing on hard disk (KeyCF)	OPT
Data safety backup. Backup - Restore.	OPT
New set of gains and accelerations.	INST
Withdraw or skip a drilling or mill type threading cycle.	INST / PRG
MSGFILE: Number of PLC messages and errors expanded to 255 and 128 respectively.	INST / OPT
Faster rigid tapping without sending M functions to the PLC.	INST

Software V13.02x

March 2007

List of features	Manual
Tool inspection. Resume the interrupted cycle.	OPT / PRG

Software V15.01

May 2007

List of features	Manual
Do not execute a program sent via DNC until pressing START.	INST
Select the set of gains and accelerations to be used in a home search.	INST
Prevent motion blocks from being executed in square corner mode.	INST / PRG
There are now more zero offsets.	PRG
G86. Boring with rapid withdrawal and spindle orientation.	PRG
The labels can now have 8 digits.	PRG
Maintain the longitudinal axis when changing the work plane.	INST / PRG
Editing on hard disk (KeyCF) on CNC's without memory expansion.	OPT

Software V15.11x

March 2008

List of features	Manual
Spindle home search on the next revolution after detecting that the home switch has been pressed.	INST
Defining a helical interpolation without programming the final coordinate of the axes of the plane.	PRG
Starting the CNC up while FAGOR filters are active.	INST
Larger numeric format to define the arc center in a G2/G3.	PRG
Monitoring the offset between the spindle and the longitudinal axis during rigid tapping.	INST / OPT
Hysteresis in the reversal movement compensation command.	INST
G210. Bore milling cycle.	PRG
G211/G212. Thread milling cycles.	PRG
Manual part centering without a probe.	OPT
New default value for a.m.p. INPOSW2 (P51).	INST
Setting the CNC in Turkish.	INST



CNC 8035

List of features	Manual
Improved Look-Ahead function: <ul style="list-style-type: none"> Advanced look-ahead algorithm (integrating FAGOR filters). Look-ahead operation with FAGOR filters active Smoother machining speed. 	INST / PRG

List of features	Manual
Saving the last 10 MDI instructions..	OPT
Turn the "retrace with Look-Ahead" function on.	INST
Monitoring of the difference between the first and second feedback.	INST
Improved safety with absolute feedback.	INST
Improved tool changer.	INST
Gear ratio management on axes and spindle.	INST
Threading without spindle orientation.	PRG
PLC monitoring in ladder diagram language.	OPT
Profile editor: Polar and incremental coordinates.	OPT

List of features	Manual
DISBLO variable: total distance programmed in blocks with look-ahead	INST

List of features	Manual
Incompatibilities in tool change.	INST



Version history (M)



CNC 8035

SAFETY CONDITIONS

Read the following safety measures in order to prevent harming people or damage to this product and those products connected to it.

This unit may only be repaired by authorized personnel at Fagor Automation.

Fagor Automation shall not be held responsible of any physical damage or defective unit resulting from not complying with these basic safety regulations.

Precautions against personal damage

- ❑ Interconnection of modules
Use the connection cables provided with the unit.
- ❑ Use proper Mains AC power cables
To avoid risks, use only the Mains AC cables recommended for this unit.
- ❑ Avoid electrical overloads
In order to avoid electrical discharges and fire hazards, do not apply electrical voltage outside the range selected on the rear panel of the central unit.
- ❑ Ground connection.
In order to avoid electrical discharges, connect the ground terminals of all the modules to the main ground terminal. Before connecting the inputs and outputs of this unit, make sure that all the grounding connections are properly made.
- ❑ Before powering the unit up, make sure that it is connected to ground
In order to avoid electrical discharges, make sure that all the grounding connections are properly made.
- ❑ Do not work in humid environments
In order to avoid electrical discharges, always work under 90% of relative humidity (non-condensing) and 45 °C (113° F).
- ❑ Do not work in explosive environments
In order to avoid risks or damages, do no work in explosive environments.

Precautions against product damage

- ❑ Working environment
This unit is ready to be used in industrial environments complying with the directives and regulations effective in the European Community.
Fagor Automation shall not be held responsible for any damage suffered or caused when installed in other environments (residential or homes).



CNC 8035

❑ Install this unit in the proper place

It is recommended, whenever possible, to install the CNC away from coolants, chemical product, blows, etc. that could damage it.

This unit complies with the European directives on electromagnetic compatibility. Nevertheless, it is recommended to keep it away from sources of electromagnetic disturbance such as:

- Powerful loads connected to the same AC power line as this equipment.
- Nearby portable transmitters (Radio-telephones, Ham radio transmitters).
- Nearby radio/TV transmitters.
- Nearby arc welding machines.
- Nearby High Voltage power lines.
- Etc.

❑ Enclosures

The manufacturer is responsible of assuring that the enclosure involving the equipment meets all the currently effective directives of the European Community.

❑ Avoid disturbances coming from the machine tool

The machine-tool must have all the interference generating elements (relay coils, contactors, motors, etc.) uncoupled.

- DC relay coils. Diode type 1N4000.
- AC relay coils. RC connected as close to the coils as possible with approximate values of $R=220 \Omega / 1 \text{ W}$ and $C=0,2 \mu\text{F} / 600 \text{ V}$.
- AC motors. RC connected between phases, with values of $R=300 \Omega / 6 \text{ W}$ and $C=0,47 \mu\text{F} / 600 \text{ V}$.

❑ Use the proper power supply

Use an external regulated 24 Vdc power supply for the inputs and outputs.

❑ Grounding of the power supply

The zero volt point of the external power supply must be connected to the main ground point of the machine.

❑ Analog inputs and outputs connection

It is recommended to connect them using shielded cables and connecting their shields (mesh) to the corresponding pin.

❑ Ambient conditions

The working temperature must be between $+5 \text{ }^\circ\text{C}$ and $+40 \text{ }^\circ\text{C}$ (41°F and 104°F)

The storage temperature must be between $-25 \text{ }^\circ\text{C}$ and $+70 \text{ }^\circ\text{C}$. ($-13 \text{ }^\circ\text{F}$ and $158 \text{ }^\circ\text{F}$)

❑ Central unit enclosure (8055i CNC)

Make sure that the needed gap is kept between the central unit and each wall of the enclosure. Use a DC fan to improve enclosure ventilation.


❑ Power switch

This power switch must be mounted in such a way that it is easily accessed and at a distance between 0.7 meters (27.5 inches) and 1.7 meters (5.5ft) off the floor.

Protections of the unit itself

□ Central unit

It has a 4 A 250V external fast fuse (F).

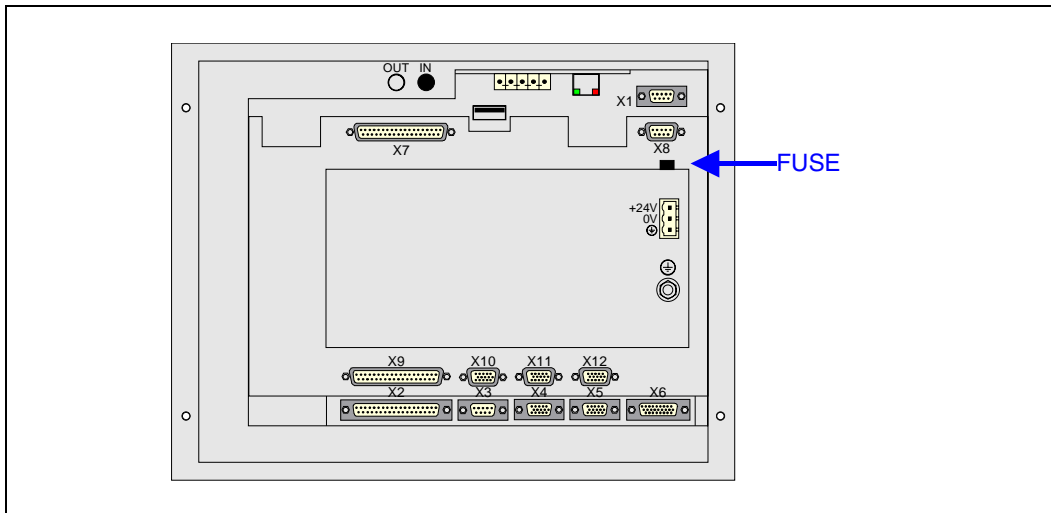

□ Inputs-Outputs

All the digital inputs and outputs have galvanic isolation via optocouplers between the CNC circuitry and the outside.

Precautions during repair



Do not open this unit. Only personnel authorized by Fagor Automation may open this unit.

Do not handle the connectors with the unit connected to mains. Before manipulating the connectors (inputs/outputs, feedback, etc.) make sure that the unit is not connected to AC power.

Safety symbols

□ Symbols which may appear on the manual.



Danger or prohibition symbol.

It indicates actions or operations that may hurt people or damage products.



Warning symbol.

It indicates situations that may be caused by certain operations and the actions to be taken to prevent them.



Obligation symbol.

It indicates actions and operations that must be carried out.



Information symbol.

It indicates notes, warnings and advises.



Safety conditions



CNC 8035

WARRANTY TERMS

Initial warranty

All products manufactured or marketed by FAGOR carry a 12-month warranty for the end user which could be controlled by the our service network by means of the warranty control system established by FAGOR for this purpose.

In order to prevent the possibility of having the time period from the time a product leaves our warehouse until the end user actually receives it run against this 12-month warranty, FAGOR has set up a warranty control system based on having the manufacturer or agent inform FAGOR of the destination, identification and on-machine installation date, by filling out the document accompanying each FAGOR product in the warranty envelope. This system, besides assuring a full year of warranty to the end user, enables our service network to know about FAGOR equipment coming from other countries into their area of responsibility.

The warranty starting date will be the one appearing as the installation date on the above mentioned document. FAGOR offers the manufacturer or agent 12 months to sell and install the product. This means that the warranty starting date may be up to one year after the product has left our warehouse so long as the warranty control sheet has been sent back to us. This translates into the extension of warranty period to two years since the product left our warehouse. If this sheet has not been sent to us, the warranty period ends 15 months from when the product left our warehouse.

This warranty covers all costs of material and labour involved in repairs at FAGOR carried out to correct malfunctions in the equipment. FAGOR undertakes to repair or replace their products within the period from the moment manufacture begins until 8 years after the date on which it disappears from the catalogue.

FAGOR has exclusive competence in deciding whether the repair enters within the term defined as the warranty period.

Excluding clauses

Repairs will be carried out on our premises. Therefore, all expenses incurred as a result of trips made by technical personnel to carry out equipment repairs, despite these being within the above-mentioned period of warranty, are not covered by the warranty.

Said warranty will be applied whenever the equipment has been installed in accordance with instructions, has not be mistreated, has not been damaged by accident or by negligence and has not been tampered with by personnel not authorised by FAGOR. If, once servicing or repairs have been made, the cause of the malfunction cannot be attributed to said elements, the customer is obliged to cover the expenses incurred, in accordance with the tariffs in force.

Other warranties, implicit or explicit, are not covered and FAGOR AUTOMATION cannot be held responsible for other damages which may occur.

Warranty on repairs

In a similar way to the initial warranty, FAGOR offers a warranty on standard repairs according to the following conditions:

PERIOD	12 months.
CONCEPT	Covers parts and labor for repairs (or replacements) at the network's own facilities.
EXCLUDING CLAUSES	The same as those applied regarding the chapter on initial warranty. If the repair is carried out within the warranty period, the warranty extension has no effect.



CNC 8035

When the customer does not choose the standard repair and just the faulty material has been replaced, the warranty will cover just the replaced parts or components within 12 months.

For sold parts the warranty is 12 months length.

Maintenance contracts

The SERVICE CONTRACT is available for the distributor or manufacturer who buys and installs our CNC systems.

Warranty terms



CNC 8035

MATERIAL RETURNING TERMS

When sending the central nit or the remote modules, pack them in its original package and packaging material. If the original packaging material is not available, pack it as follows:

1. Get a cardboard box whose three inside dimensions are at least 15 cm (6 inches) larger than those of the unit. The cardboard being used to make the box must have a resistance of 170 kg. (375 pounds).
2. Attach a label indicating the owner of the unit, person to contact, type of unit and serial number.
3. In case of failure, also indicate the symptom and a short description.
4. Wrap the unit in a polyethylene roll or similar material to protect it.
5. When sending the central unit, protect especially the screen.
6. Pad the unit inside the cardboard box with polyurethane foam on all sides.
7. Seal the cardboard box with packing tape or industrial staples.



CNC 8035



Material returning terms



CNC 8035

ADDITIONAL REMARKS

Mount the CNC away from coolants, chemical products, blows, etc. which could damage it. Before turning the unit on, verify that the ground connections have been properly made.

In case of a malfunction or failure, disconnect it and call the technical service. Do not get into the inside of the unit.



CNC 8035



Additional remarks



CNC 8035

FAGOR DOCUMENTATION

OEM manual

It is directed to the machine builder or person in charge of installing and starting-up the CNC.

USER-M manual

Directed to the end user.

It describes how to operate and program in M mode.

USER-T manual

Directed to the end user.

It describes how to operate and program in T mode.

USER-TC manual

Directed to the end user.

It describes how to operate and program in ISO mode and Fagor conversational mode.



CNC 8035



Fagor documentation



CNC 8035

The CNC can be programmed both at the machine (from the front panel) or from external peripheral devices (tape reader/cassette recorder, computer, etc). Memory available to the user for carrying out the part programs is 1 Mbyte.

The part programs and the values in the tables which the CNC has can be entered from the front panel, from a pc (DNC) or from a peripheral.

Entering programs and tables from the front panel.

Once the editing mode or desired table has been selected, the CNC allows you to enter data from the keyboard.

Entering programs and tables from a Computer (DNC) or Peripheral Device.

The CNC allows data to be exchanged with a computer or peripheral device, using the RS232C serial line.

If this is controlled from the CNC, it is necessary to preset the corresponding table or part program directory (utilities) you want to communicate with.

Depending on the type of communication required, the serial port machine parameter "PROTOCOL" should be set.

"PROTOCOL" = 0 if the communication is with a peripheral device.

"PROTOCOL" = 1 if the communication is via DNC.

1.1 Part programs

The operating manual describes the different operating modes. Refer to that manual for further information.

Editing a part-program

To create a part-program, access the –Edit– mode.

The new part-program edited is stored in the CNC's RAM memory. It is possible to save a copy of the part-programs in a PC connected through the serial line.

To transmit a program to a PC through the serial, proceed as follows:

1. Execute the application "*Fagor50.exe*" or "*WinDNC.exe*" at the PC.
2. Activate DNC communications at the CNC.
3. Select the work directory at the CNC. It is selected from the –Utilities– mode, option Directory \Serial L \Change directory

In –Edit– mode, it is possible to modify part-programs residing in the CNC's RAM memory. To modify a program stored in a PC, it must be previously copied into RAM memory.

Executing and editing a part-program

Part-programs stored anywhere may be executed or simulated. Simulation is carried out in the –Simulation– mode, whereas the execution is done in the –Automatic– mode

When executing or simulating a part-program, bear in mind the following points:

- Only subroutines stored in the CNC's RAM memory can be executed. Therefore, to execute a subroutine stored in a PC, it must be first copied into the CNC's RAM memory.
- The GOTO and RPT instructions cannot be used in programs that are executed from a PC connected through the serial lines.
- From a program in execution, it is possible to execute another program located in RAM memory or in a PC using the EXEC instruction.

The user customizing programs must be in RAM memory so the CNC can execute them.

–Utilities– operating mode.

The –Utilities– mode, lets display the part-program directory of all the devices, make copies, delete, rename and even set the protections for any of them.

1.

GENERAL CONCEPTS
Part programs



CNC 8035

·M· MODEL
(SOFT V15.3x)

Operations that may be carried out with part-programs.

	RAM	DNC
See the program directory of ...	Yes	Yes
See the subroutine directory of ...	Yes	No
Create the work directory from ...	No	No
Change the work directory from ...	No	Yes
Edit a program from ...	Yes	No
Modify a program from ...	Yes	No
Delete a program from ...	Yes	Yes
Copy from/to RAM memory to/from ...	Yes	Yes
Copy from/to DNC to/from ...	Yes	Yes
Rename a program from ...	Yes	No
Change the comment of a program from ...	Yes	No
Change the protections of a program from ...	Yes	No
Execute a part-program from ...	Yes	Yes
Execute a user program from ...	Yes	No
Execute a PLC program from ...	Yes	No
Execute programs with GOTO or RPT instructions from ...	Yes	No
Execute subroutines residing in ...	Yes	No
Execute programs with the EXEC instruction, in RAM from ...	Yes	Yes
Execute programs with the EXEC instruction, in DNC from ...	Yes	No
Open programs with the OPEN instruction, in RAM from ...	Yes	Yes
Open programs with the OPEN instruction, in DNC from ...	Yes	No

(*) If it is not in RAM memory, it generates the executable code in RAM and it executes it.



GENERAL CONCEPTS
Part programs



CNC 8035

·M· MODEL
(SOFT V15.3x)

1.2 DNC connection

The CNC offers as optional feature the possibility of working in DNC (Distributed Numerical Control), enabling communication between the CNC and a computer to carry out the following functions:

- Directory and delete commands.
- Transfer of programs and tables between the CNC and a computer.
- Remote control of the machine.
- The ability to supervise the status of advanced DNC systems.

1.

GENERAL CONCEPTS
DNC connection



CNC 8035

·M· MODEL
(SOFT V15.3x)

1.3 Communication protocol via DNC or peripheral device

This type of communication enables program-and-table transfer commands, plus the organization of CNC directories such as the computer directory, for copying/deleting programs, etc. to be done either from the CNC or the computer.

When you want to transfer files, it is necessary to follow this protocol:

- The “%” symbol will be used to start the file, followed by the program comment (optional), of up to 20 characters.

Then, and separated by a comma “;”, comes the protection of each file, read, write, etc. These protections are optional and need not be programmed.

To end the file header, RT (RETURN) or LF (LINE FEED) characters should be sent separated by a comma (“;”).

Example: %Fagor Automation, MX, RT

- Following the header, the file blocks should be programmed. These will all be programmed according to the programming rules indicated in this manual. After each block, to separate it from the others, the RT (RETURN) or LF (LINE FEED) characters should be used.

Example: N20 G90 G01 X100 Y200 F2000 LF
 (RPT N10, N20) N3 LF

If communication is made with a peripheral device, you will need to send the ‘end of file’ command. This command is selected via the machine parameter for the serial port: “EOFCHR”, and can be one of the following characters :

ESC	ESCAPE
EOT	END OF TRANSMISSION
SUB	SUBSTITUTE
EXT	END OF TRANSMISSION

1.

GENERAL CONCEPTS

Communication protocol via DNC or peripheral device


FAGOR

CNC 8035

 ·M· MODEL
 (SOFT V15.3x)

1.

GENERAL CONCEPTS

Communication protocol via DNC or peripheral device



CNC 8035

·M· MODEL
(SOFT V15.3x)

A CNC program consists of a series of blocks or instructions. These blocks or instructions are made of words composed of capital letters and numerical format.

The CNC's numerical format consists of :

- The signs . (decimal points), + (plus), - (minus).
- Digits 0 1 2 3 4 5 6 7 8 9.

Programming allows spaces between letters, numbers and symbols, in addition to ignoring the numerical format if it has zero value, or a symbol if it is positive.

The numeric format of a word may be replaced by an arithmetic parameter when programming. Later on, during execution, the CNC will replace the arithmetic parameter by its value. For example, if XP3 has been programmed, during execution the CNC will replace P3 by its numerical value, obtaining results such as X20, X20.567, X-0.003, etc.

2.1 Program structure at the CNC

All the blocks which make up the program have the following structure:

Block header + program block + end of block

2.

CREATING A PROGRAM

Program structure at the CNC



CNC 8035

·M· MODEL
(SOFT V15.3x)

2.1.1 Block header

The block header is optional, and may consist of one or more block skip conditions and by the block number or label. Both must be programmed in this order.

Block skip condition. *"/", "/1", "/2", "/3".*

These three block skip conditions, given that "/" and "/1" are the same, they are governed by the marks BLKSKIP1, BLKSKIP2 and BLKSKIP3 of the PLC. If any of these marks is active, the CNC will not execute the block or blocks in which it has been programmed; the execution takes place in the following block.

Up to 3 skip conditions can be programmed in one block; they will be evaluated one by one, respecting the order in which they have been programmed.

The control reads 20 blocks ahead of the one being executed in order to calculate in advance the path to be run. The condition for block skip will be analyzed at the time when the block is read i.e. 20 blocks before execution.

If the block skip needs to be analyzed at the time of execution, it is necessary to interrupt the block preparation, by programming G4 in the previous block.

Label or block number. *N(0-99999999).*

This is used to identify the block, and is only used when block references or jumps are made. They are represented by the letter N followed by up to 8 digits (0-99999999).

No particular order is required and the numbers need not be sequential. If two or more blocks with the same label number are present in the same program, the CNC will always give priority to the first number.

Although it is not necessary to program it, by using a softkey the CNC allows the automatic programming of labels. The programmer can select the initial number and the step between labels.

Restrictions:

- Displaying the number of the active block in the top window of the screen:
 - When executing a program in ISO mode, when the label number is higher than 9999, it displays N**** .
 - On the "DISPLAY / SUBROUTINES" window, when displaying an RPT that has a label higher than 9999, it displays it with ****.
- Canned cycles G66, G67 and G68 (irregular pockets with islands) can only be edited using 4-digit labels.

2.

CREATING A PROGRAM

Program structure at the CNC

2.1.2 Program block

This is written with commands in ISO and high level languages. To prepare a program, blocks written in both languages will be used, although each one should be edited with commands in just one language.

ISO language.

This language is specially designed to control axis movement, as it gives information and movement conditions, in addition to data on feedrate. It offers the following types of functions.

- Preparatory functions for movement, used to determine geometry and working conditions, such as linear and circular interpolations, threading, etc.
- Control functions for axis feedrate and spindle speeds.
- Tool control functions.
- Complementary functions, with technological instructions.

High level language.

This enables access to general purpose variables and to system tables and variables.

It gives the user a number of control sentences which are similar to the terminology used in other languages, such as IF, GOTO, CALL, etc. It also allows the use of any type of expression (arithmetic, referential, or logical).

It also has instructions for the construction of loops, plus subroutines with local variables. A local variable is one that is only recognized by the subroutine in which it has been defined.

It is also possible to create libraries, grouping subroutines with useful and tested functions, which can be accessed from any program.

2.

CREATING A PROGRAM
Program structure at the CNC



CNC 8035

·M· MODEL
(SOFT V15.3x)

2.1.3 End of block

The end of block is optional and may consist of the indication of number of repetitions of the block and of the block comment. Both must be programmed in this order.

Number of block repetitions. N(0-9999)

This indicates the number of times the block will be executed. The number of repetitions is represented by the letter N followed by up to 4 digits (0-9999). The active machining operation does not take place if N0 is programmed; only the movement programmed within the block takes place.

Movement blocks can only be repeated which, at the time of their execution, are under the influence of a modal subroutine. In these cases, the CNC executes the programmed move and the active machining operation (canned cycle or modal subroutine) the indicated number of times.

Block comment

The CNC allows you to incorporate any kind of information into all blocks in the form of a comment. The comment is programmed at the end of the block, and should begin with the character “;” (semicolon).

If a block begins with “;” all its contents will be considered as a comment, and it will not be executed.

Empty blocks are not permitted. They should contain at least one comment.

2.

CREATING A PROGRAM
Program structure at the CNC

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

2.

CREATING A PROGRAM

Program structure at the CNC



CNC 8035

·M· MODEL
(SOFT V15.3x)

AXES AND COORDINATE SYSTEMS

3

Given that the purpose of the CNC is to control the movement and positioning of axes, it is necessary to determine the position of the point to be reached through its coordinates.

The CNC allows you to use absolute, relative or incremental coordinates throughout the same program.




CNC 8035

·M· MODEL
(SOFT V15.3x)

3.1 Axis nomenclature


The axes are named according to DIN 66217.

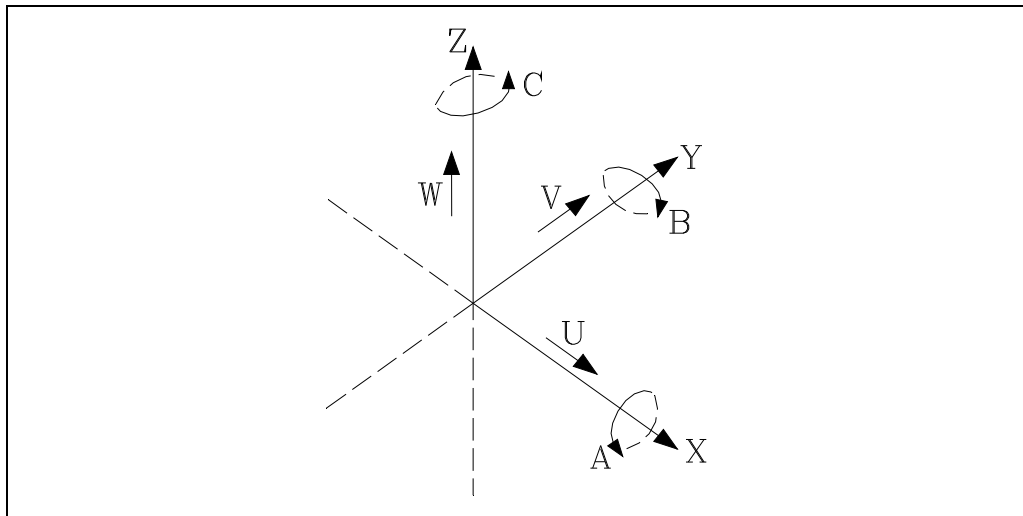

Characteristics of the system of axes:

- X and Y main movements on the main work plane of the machine.
- Z parallel to the main axis of the machine, perpendicular to the main XY plane.
- U, V, W auxiliary axes parallel to X, Y, Z respectively.
- A, B, C Rotary axes on each axis X, Y, Z.

The drawing below shows an example of the nomenclature of the axes on a milling-profiling machine with a tilted table.

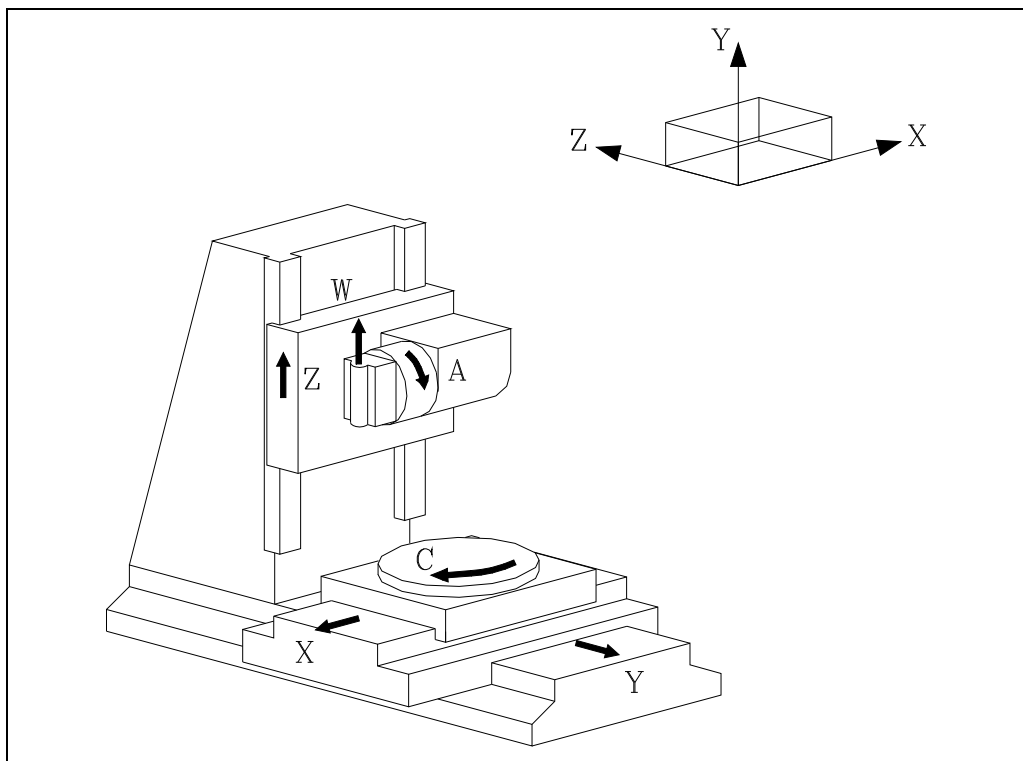

3.

AXES AND COORDINATE SYSTEMS
Axis nomenclature



CNC 8035

-M- MODEL
(SOFT V15.3x)

3.2 Plane selection (G16, G17, G18, G19)


Plane selection should be made when the following are carried out :

- Circular interpolations.
- Controlled corner rounding.
- Tangential entry and exit.
- Chamfer.
- Coordinate programming in Polar coordinates.
- Machining canned cycles.
- Pattern rotation.
- Tool radius Compensation.
- Tool length compensation.

The "G" functions which enable selection of work planes are as follows :

G16 axis1 axis2 axis3. Enables selection of the desired work plane, plus the direction of G02 G03 (circular interpolation), axis1 being programmed as the abscissa axis and axis2 as the ordinate axis.

The axis3 is the longitudinal axis along which tool length compensation is applied.

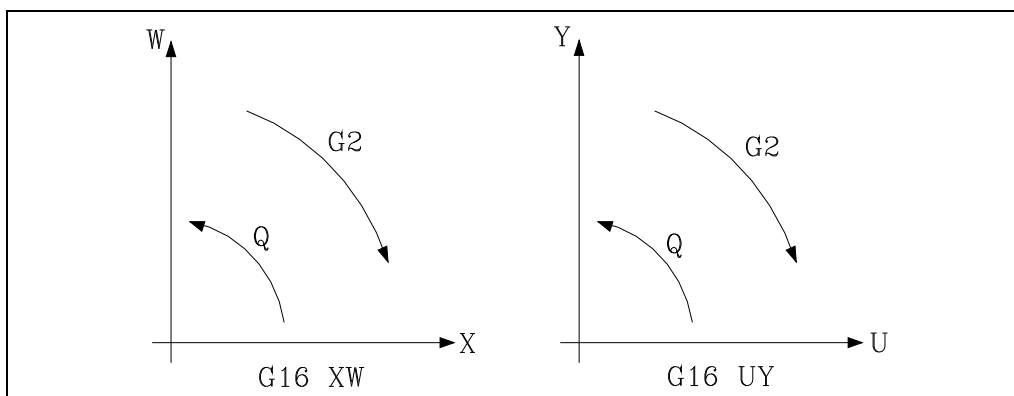

- G17. Selects the XY plane and the longitudinal Z axis.
- G18. Selects the ZX plane and the longitudinal Y axis.
- G19. Selects the YZ plane and the longitudinal X axis.

3.


AXES AND COORDINATE SYSTEMS
Plane selection (G16, G17, G18, G19)



CNC 8035

·M· MODEL
(SOFT V15.3x)

The G16, G17, G18 and G19 functions are modal and incompatible among themselves. The G16 function should be programmed on its own within a block.

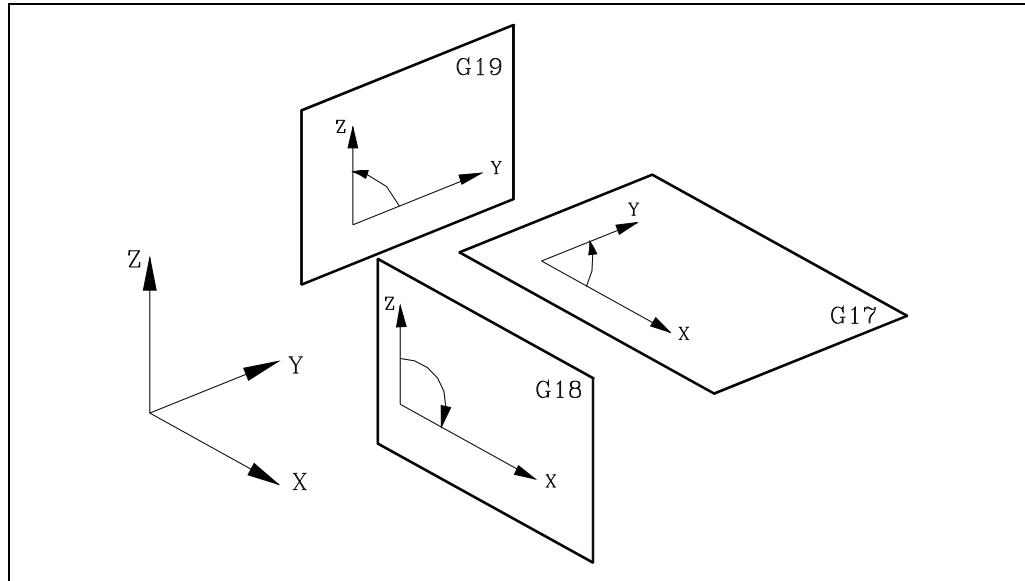

The G17, G18, and G19 functions define two of the three main axes (X, Y, Z) as belonging to the work plane, and the other as the perpendicular axis to the same.

When radius compensation is done on the work plane, and length compensation on the perpendicular axis, the CNC does not allow functions G17, G18, and G19 if any one of the X, Y, or Z axes is not selected as being controlled by the CNC.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC will assume that the plane defined by the general machine parameter as "IPLANE" is the work plane.

3.

AXES AND COORDINATE SYSTEMS Plane selection (G16, G17, G18, G19)



CNC 8035

·M· MODEL
(SOFT V15.3x)

3.3 Part dimensioning. Millimeters (G71) or inches (G70)

The CNC allows you to enter units of measurement with the programming, either in millimeters or inches.

It has a general machine parameter "INCHES" to define the unit of measurement of the CNC.

However, these units of measurement can be changed at any time in the program. Two functions are supplied for this purpose :

- G70. Programming in inches.
- G71. Programming in millimeters.

Depending on whether G70 or G71 has been programmed, the CNC assumes the corresponding set of units for all the blocks programmed from that moment on.

The G70 and G71 functions are modal and are incompatible.

The CNC allows you to program figures from 0.00001 to 99999.9999 with or without sign, working in millimeters (G71), called format +/-5.4, or either from 0.00001 to 3937.00787 with or without sign if the programming is done in inches (G70), called format +/-4.5.

However, and to simplify the instructions, we can say that the CNC admits +/- 5.5 format, thereby admitting +/- 5.4 in millimeters and +/- 4.5 in inches.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC will assume that the system of units of measurement is the one defined by the general machine parameter "INCHES".

3.

AXES AND COORDINATE SYSTEMS
Part dimensioning. Millimeters (G71) or inches (G70)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

3.4 Absolute/incremental programming (G90, G91)

The CNC allows the programming of the coordinates of one point either with absolute G90 or incremental G91 values.


When working with absolute coordinates (G90), the point coordinates refer to a point of origin of established coordinates, often the part zero (datum).

When working in incremental coordinates (G91), the numerical value programmed corresponds to the movement information for the distance to be traveled from the point where the tool is situated at that time. The sign in front shows the direction of movement.

The G90 and G91 functions are modal and are incompatible.

3.

AXES AND COORDINATE SYSTEMS
 Absolute/incremental programming (G90, G91)

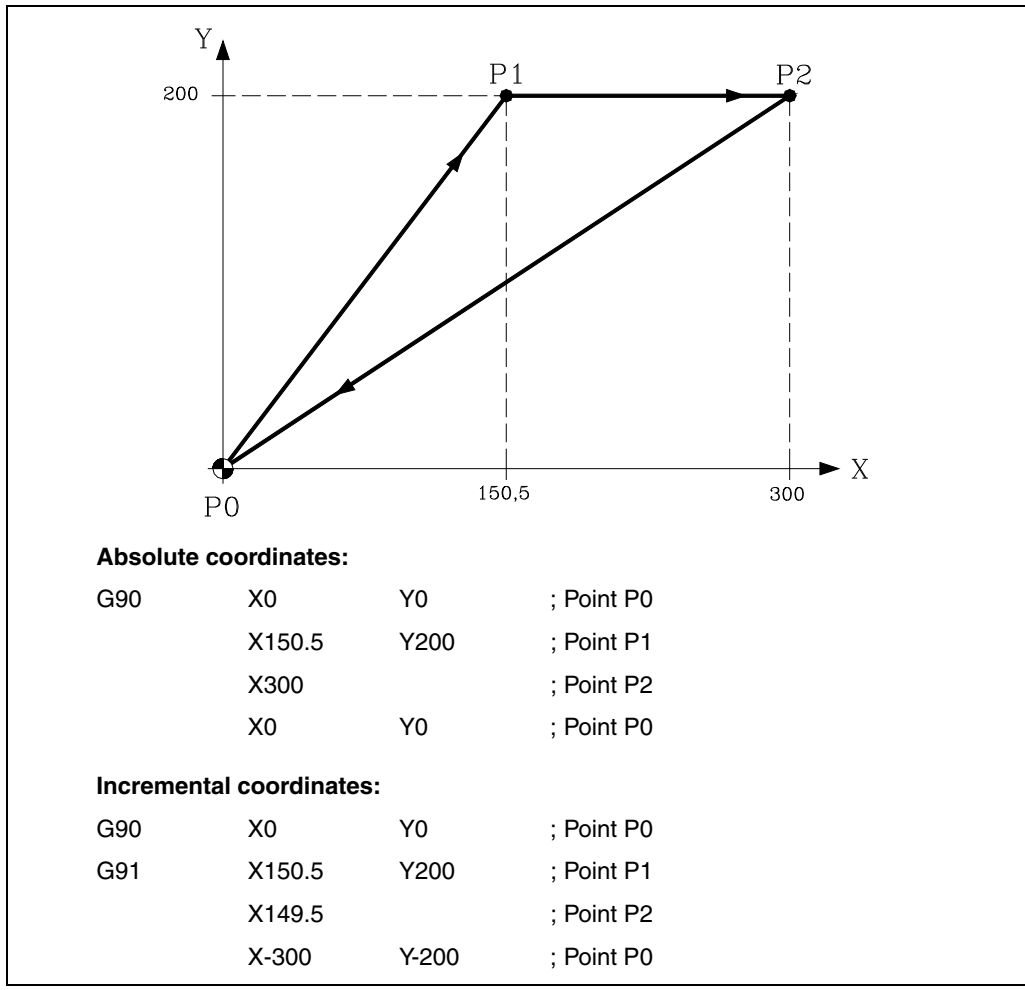

On power-up, after executing M02, M30 or after an EMERGENCY or RESET, the CNC will assume G90 or G91 according to the definition by the general machine parameter "ISYSTEM".



CNC 8035

-M- MODEL
(SOFT V15.3x)

3.5 Coordinate programming

The CNC allows the selection of up to 7 of the 9 possible axes X, Y, Z, U, V, W, A, B, C.

Each of these may be linear, linear to position only, normal rotary, rotary to position only or rotary with hirth toothing (positioning in complete degrees), according to the specification in the machine parameter of each "AXISTYPE" axis.

With the aim of always selecting the most suitable coordinate programming system, the CNC has the following types :

- Cartesian coordinates
- Polar coordinates
- Cylindrical coordinates
- Angle and one Cartesian coordinate

3.**AXES AND COORDINATE SYSTEMS**
Coordinate programming**FAGOR** **CNC 8035**-M- MODEL
(SOFT V15.3x)

3.5.1 Cartesian coordinates

The Cartesian Coordinate System is defined by two axes on the plane, and by three or more axes in space.

The origin of all these, which in the case of the axes X Y Z coincides with the point of intersection, is called Cartesian Origin or Zero Point of the Coordinate System.


The position of the different points of the machine is expressed in terms of the coordinates of the axes, with two, three, four, or five coordinates.

The coordinates of the axes are programmed via the letter of the axis (X, Y, Z, U, V, W, A, B, C, always in this order) followed by the coordinate value.

The values of the coordinates are absolute or incremental, depending on whether it is working in G90 or G91, and its programming format is ± 5.5 .

3.

AXES AND COORDINATE SYSTEMS
Coordinate programming

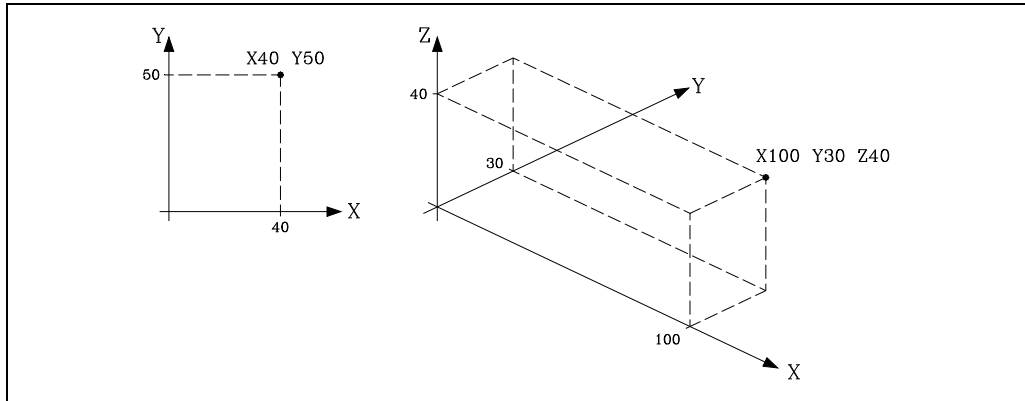

CNC 8035


·M· MODEL
(SOFT V15.3x)

3.5.2 Polar coordinates

In the event of the presence of circular elements or angular dimensions, the coordinates of the different points on the plane (2 axes at the same time), it may be easier to express them in polar coordinates.

The reference point is called Polar Origin, and this will be the origin of the Polar Coordinate System.

A point on this system would be defined by :

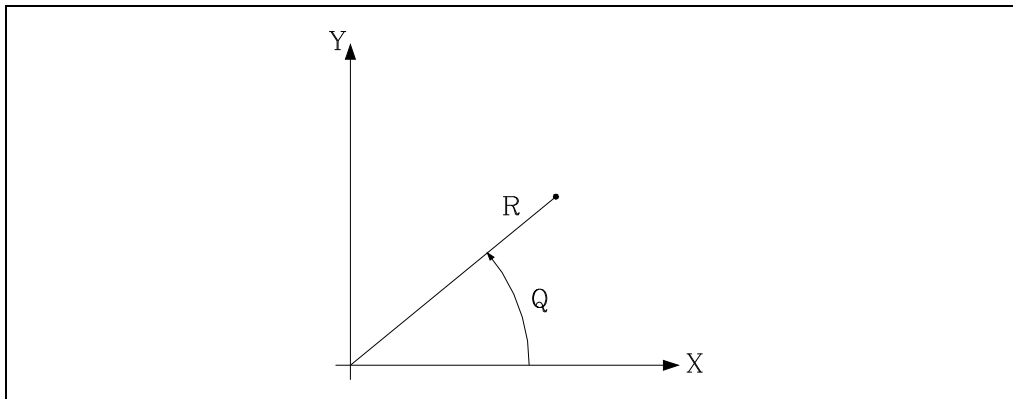

- The RADIUS (R), the distance between the polar origin and the point.
- The ANGLE (Q), formed by the abscissa axis and the line which joins the polar origin with the point. (In degrees).

The values R and Q are absolute or incremental depending on whether you are working with G90 or G91, and their programming format will be R5.5 Q±5.5. The radius value must always be positive.


The values R and Q are incremental and their programming format will be R±5.5 Q±5.5.

The R values may be negative when programming in incremental coordinates; but the resulting value assigned to the radius must always be positive.

When programming a "Q" value greater than 360°, the module will be assumed after dividing it by 360. Thus, Q420 is the same as Q60 and Q-420 is the same as Q-60.

3.

Programming example assuming that the Polar Origin is located at the Coordinate Origin.

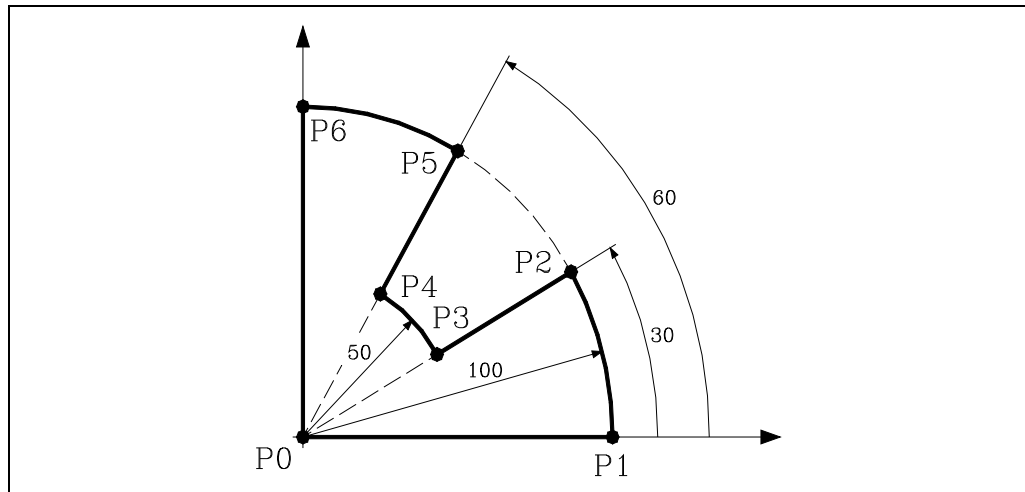

Absolute coordinates:

G90	X0	Y0	; Point P0
G01	R100	Q0	; Point P1, in a straight line (G01)
G03		Q30	; Point P2, in an arc (G03)
G01	R50	Q30	; Point P3, in a straight line (G01)
G03		Q60	; Point P4, in an arc (G03)
G01	R100	Q60	; Point P5, in a straight line (G01)
G03		Q90	; Point P6, in arc (G03)
G01	R0	Q90	; Point P0, in a straight line (G01)

Incremental coordinates:

G90	X0	Y0	; Point P0
G91 G01	R100	Q0	; Point P1, in a straight line (G01)
G03		Q30	; Point P2, in an arc (G03)
G01	R-50	Q0	; Point P3, in a straight line (G01)
G03		Q30	; Point P4, in an arc (G03)
G01	R50	Q0	; Point P5, in a straight line (G01)
G03		Q30	; Point P6, in arc (G03)
G01	R-100	Q0	; Point P0, in a straight line (G01)

The polar origin, apart from being able to be preset using function G93 (described later) can be modified in the following cases :

- On power-up, after executing M02, M30 EMERGENCY or RESET, the CNC will assume, as the polar origin, the coordinate origin of the work plane defined by the general machine parameter "IPLANE".
- Every time the work plane is changed (G16,G17,G18 or G19), the CNC assumes the coordinate origin of the new work plane selected as the polar origin.
- When executing a circular interpolation (G02 or G03), and if the general machine parameter "PORGMOVE" has a value of 1, the center of the arc will become the new polar origin.

3.
AXES AND COORDINATE SYSTEMS
 Coordinate programming




CNC 8035

-M- MODEL
 (SOFT V15.3x)

3.5.3 Cylindrical coordinates

To define a point in space, the system of cylindrical coordinates can be used as well as the Cartesian coordinate system.

A point on this system would be defined by :

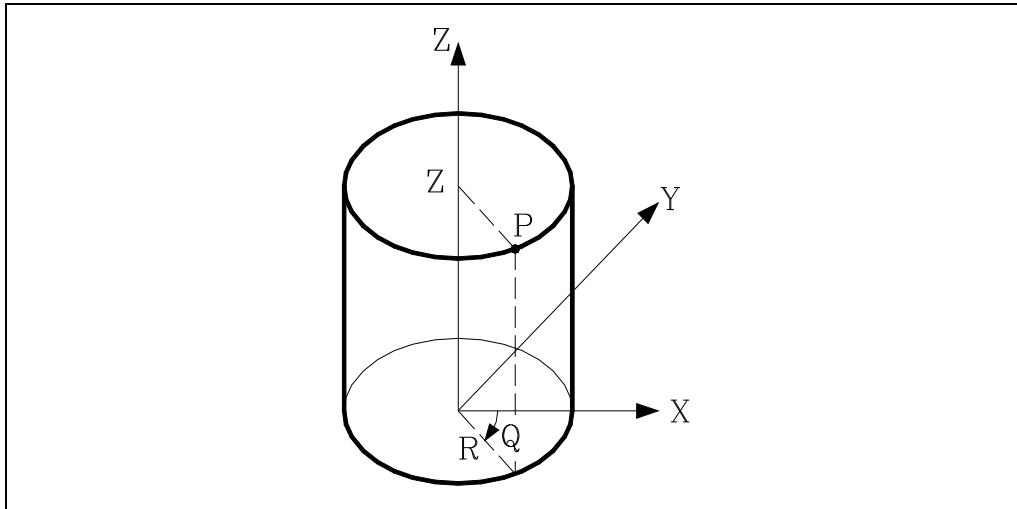

The projection of this point on the main plane, which should be defined in polar coordinates (R Q).

Rest of axes in Cartesian coordinates.

Examples:

R30 Q10 Z100

R20 Q45 Z10 V30 A20

3.

AXES AND COORDINATE SYSTEMS
Coordinate programming




CNC 8035

·M· MODEL
(SOFT V15.3x)

3.5.4 Angle and one Cartesian coordinate

A point on the main plane can be defined via one of its cartesian coordinates, and the exit angle of the previous path.

Example of programming assuming that the main plane is XY:

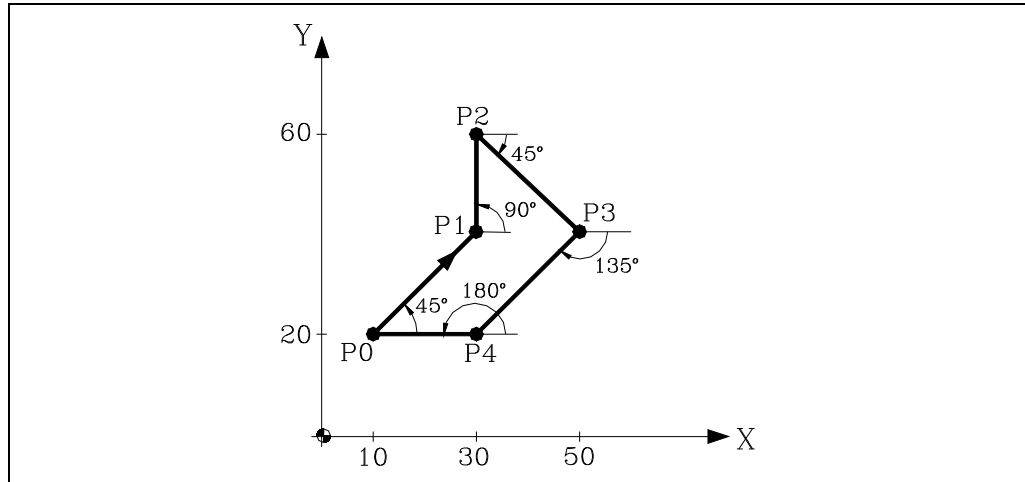

X10	Y20	; Point P0, starting point
Q45	X30	; Point P1
Q90	Y60	; Point P2
Q-45	X50	; Point P3
Q-135	Y20	; Point P4
Q180	X10	; Point P0

If you wish to represent a point in space, the remaining coordinates can be programmed in Cartesian coordinates.

3.
AXES AND COORDINATE SYSTEMS
 Coordinate programming



CNC 8035

·M· MODEL
(SOFT V15.3x)

3.6 Rotary axes

The types of rotary axes available are:

- Normal rotary axis.
- Positioning-only rotary axis.
- Rotary HIRTH axis.

Each one of them can be divided into:

- Rollover When it is displayed between 0° and 360°.
- Non Rollover When it may be displayed between -99999° and 99999°.

They are all programmed in degrees. Therefore, their readings are not affected by the inch/mm conversion.

Normal rotary axes

They can interpolate with linear axes.

Movement: In G00 and G01.

Rollover axis programming:

- G90 The sign indicates the turning direction and the target position (between 0 and 359.9999).
- G91 The sign indicates the turning direction. If the programmed movement exceeds 360°, the axis will rotate more than one turn before positioning at the desired point.

Non-rollover axis programming.

In G90 and G91 like a linear axis.

Positioning-only rotary axis

They cannot be interpolated with linear axes.

Movement: Always in G00 and they do not admit tool radius compensation (G41, G42).

Rollover axis programming:

- G90 Always positive and in the shortest direction. End coordinate between 0 and 359.9999.
- G91 The sign indicates the turning direction. If the programmed movement exceeds 360°, the axis will rotate more than one turn before positioning at the desired point.

Non-rollover axis programming.

In G90 and G91 like a linear axis.

Rotary Hirth axis

They work like the positioning-only axis except that they do not admit decimal position values (coordinates).

More than one hirth axis can be used, but they can only be moved one at a time.

3.

AXES AND COORDINATE SYSTEMS
Rotary axes



CNC 8035

·M· MODEL
(SOFT V15.3x)

3.7 Work zones

The CNC provides four work zones or areas, and also limits the tool movement in each of these.

3.

AXES AND COORDINATE SYSTEMS
Work zones



CNC 8035

·M· MODEL
(SOFT V15.3x)

3.7.1 Definition of the work zones

Within each work zone, the CNC allows you to limit the movement of the tool on each axis, with upper and lower limits being defined in each axis.

G20: Defines the lower limits in the desired zone.

G21: Defines the upper limits in the desired zone.

The format to program these functions is:

```
G20 K X...C±5.5
```


```
G21 K X...C±5.5
```

Where:

K Indicates the work zone you wish to define (1, 2, 3 or 4).

X...C Indicates the coordinates (upper or lower) with which you wish to limit the axes. These coordinates will be programmed with reference to machine zero (home).


It is not necessary to program all the axes, so only defined axes will be limited.

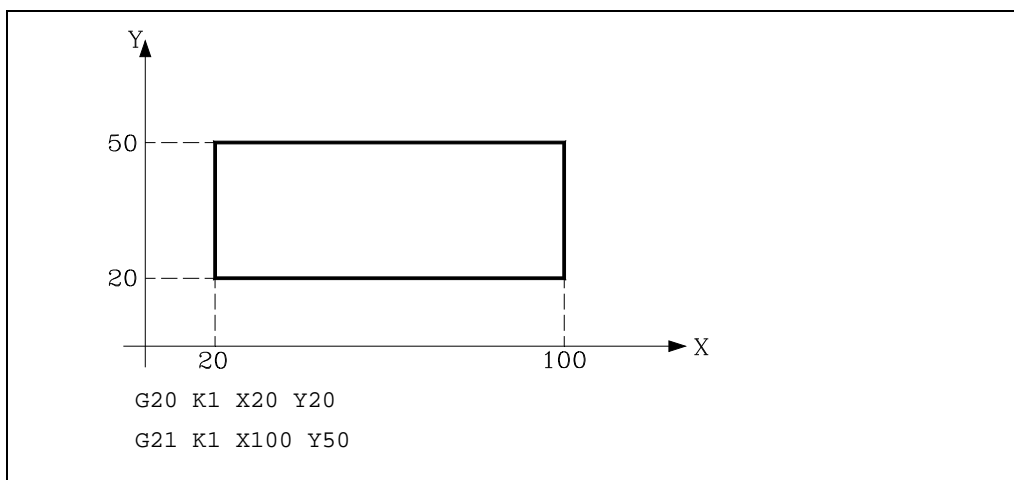

3.

3.7.2 Using the work zones

Within each work zone, the CNC allows you to restrict the movement of the tool, either prohibiting its exit from the programmed zone (no exit zone) or its entry into the programmed zone (no entry zone).

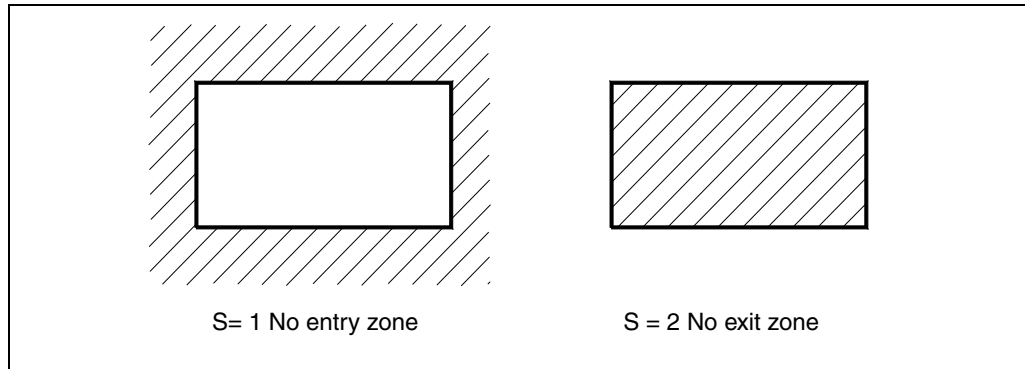

The CNC will take the dimensions of the tool into account at all times (tool offset table) to avoid it exceeding the programmed limits.

The presetting of work zones is done via Function G22, the programming format being:

```
G22 K S
```

Where:

K Indicates the work zone you wish to define (1, 2, 3 or 4).

S Indicates the enabling/disabling of the work zone.

S=0 disabled.

S=1 enabled as a no-entry zone.

S=2 enabled as a no-exit zone.

On power-up, the CNC will disable all work zones. However, upper and lower limits for these zones will not undergo any variation, and they can be re-enabled through the G22 function.

3.

AXES AND COORDINATE SYSTEMS
Work zones




CNC 8035

·M· MODEL
(SOFT V15.3x)

4.1 Reference points

A CNC machine needs the following origin and reference points defined :

- Machine Reference Zero or home. This is set by the manufacturer as the origin of the coordinate system of the machine.
- Part zero or point of origin of the part. This is the origin point that is set for programming the measurements of the part. It can be freely selected by the programmer, and its machine reference zero can be set by the zero offset.
- Machine Reference point. This is a point on the machine established by the manufacturer around which the synchronization of the system is done. The control positions the axis on this point, instead of moving it as far as the Machine Reference Zero, taking, at this point, the reference coordinates which are defined via the axis machine parameter "REFVALUE".

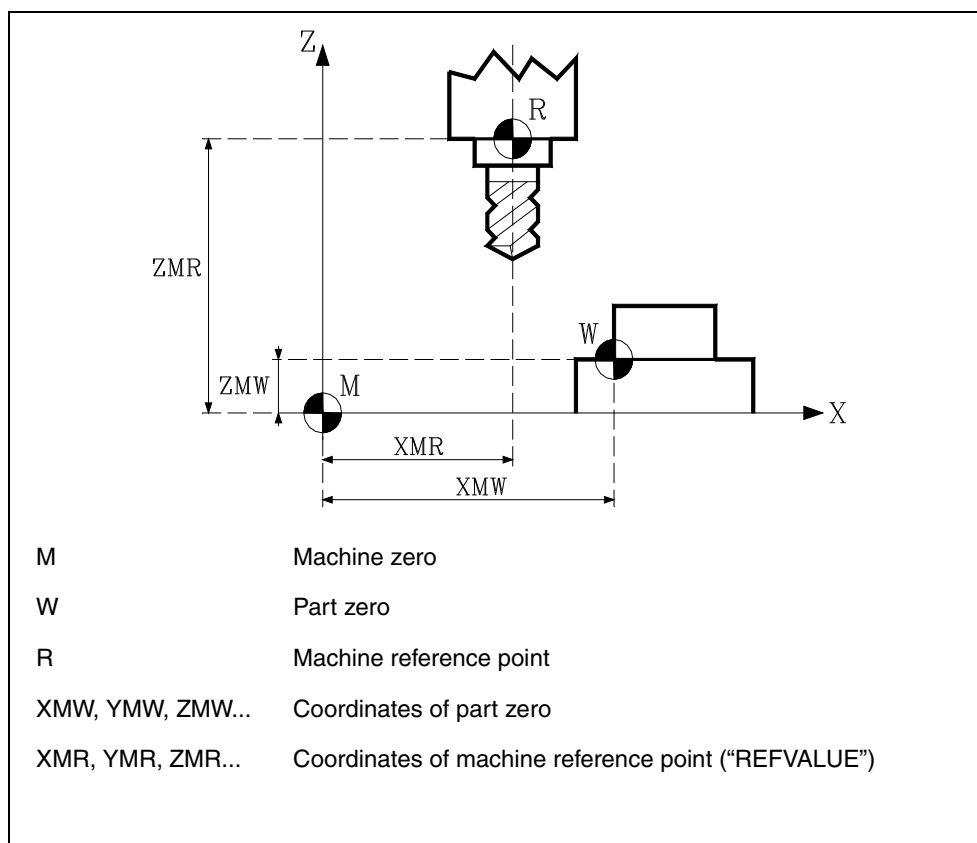

4.2 Machine reference (Home) search (G74)

The CNC allows you to program the machine reference search in two ways :

- Machine reference (home) search of one or more axes in a particular order.

G74 is programmed followed by the axes in which you want to carry out the reference search. For example: G74 X Z.

The CNC begins the movement of all the selected axes which have a machine reference switch (machine axis parameter “DECINPUT”) and in the direction indicated by the axis machine parameter “REFDIREC”.

This movement is carried out at the feedrate indicated by the axis machine parameter “REFEED1” for each axis until the home switch is hit.

Next, the home search (marker pulse or home) will be carried out in the programmed order.

This second movement will be carried out one axis at a time, at the feedrate indicated in the axis machine parameter “REFEED2” until the machine reference point is reached (i.e. the marker pulse is found).

- Home search using the associated subroutine.

The G74 function will be programmed alone in the block, and the CNC will automatically execute the subroutine whose number appears in the general machine parameter “REFPSUB”. In this subroutine it is possible to program the machine reference searches required, and also in the required order.

In a block in which G74 has been programmed, no other preparatory function may appear.

If the machine reference search is done in JOG mode, the part zero selected is lost. The coordinates of the reference point indicated in the machine axis parameter “REFVALUE” is displayed. In all other cases, the active part zero will be maintained and the CNC will display the position values with respect to that part zero.

If the G74 command is executed in MDI, the display of coordinates depends on the mode in which it is executed : Jog, Execution, or Simulation.

4.

REFERENCE SYSTEMS

Machine reference (Home) search (G74)



CNC 8035

·M· MODEL
(SOFT V15.3x)

4.3 Programming with respect to machine zero (G53)


Function G53 can be added to any block that has path control functions.

It is only used when the programming of block coordinates relating to machine zero is required. These coordinates should be expressed in millimeters or inches, depending on how the general machine parameter "INCHES" is defined.

By programming G53 alone (without motion information) the current active zero offset is canceled regardless of whether it was originated by a G54-G59 or a G92 preset. This origin preset is described next.

Function G53 is not modal, so it should be programmed every time you wish to indicate the coordinates referred to machine zero.

This function temporarily cancels radius and tool length compensation.

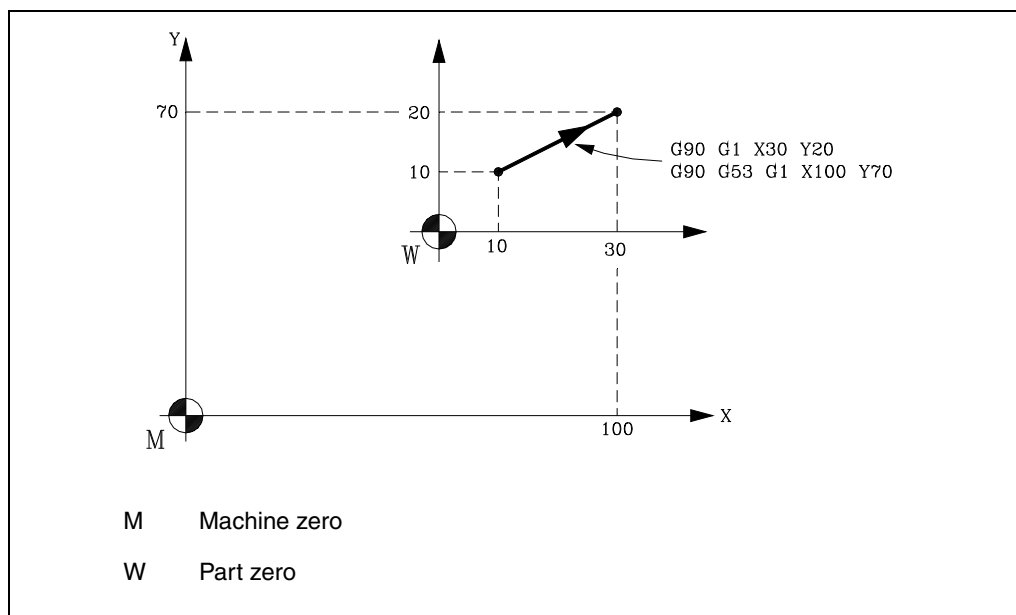

4.

REFERENCE SYSTEMS
 Programming with respect to machine zero (G53)



CNC 8035

·M· MODEL
 (SOFT V15.3x)


4.4 Coordinate preset and zero offsets

The CNC allows you to carry out zero offsets with the aim of using coordinates related to the plane of the part, without having to modify the coordinates of the different points of the part at the time of programming.

The zero offset is defined as the distance between the part zero (point of origin of the part) and the machine zero (point of origin of the machine).

4.

REFERENCE SYSTEMS
Coordinate preset and zero offsets

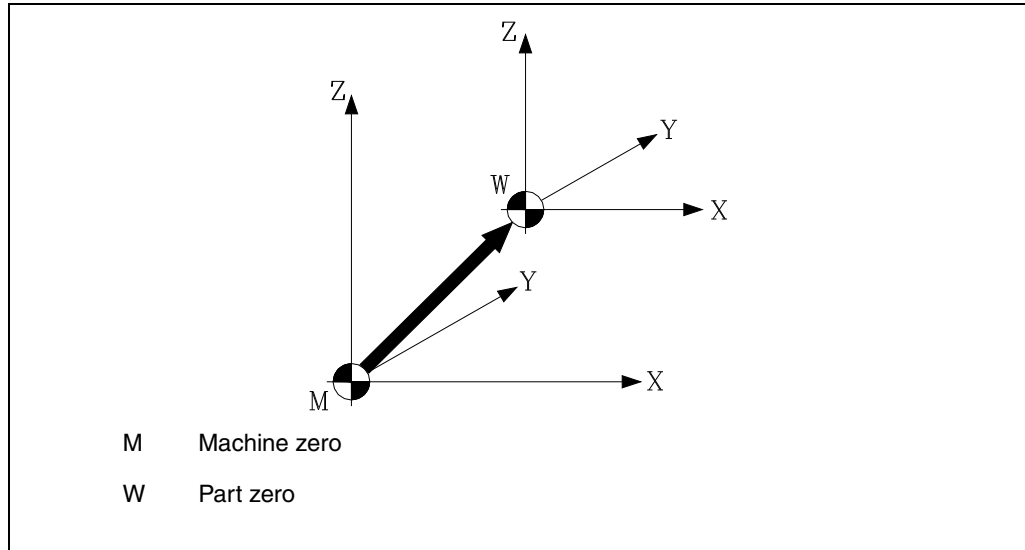


This zero offset can be carried out in one of two ways :

- Via Function G92 (coordinate preset). The CNC accepts the coordinates of the programmed axes after G92 as new axis values.
- Via the use of zero offsets (G54 ... G59, G159N1 ... G159N20); the CNC accepts as a new part zero the point located relative to machine zero at the distance indicated by the selected table(s).

Both functions are modal and incompatible, so if one is selected the other is disabled.

There is, moreover, another zero offset which is governed by the PLC. This offset is always added to the zero offset selected and is used (among other things) to correct deviations produced as a result of expansion, etc.

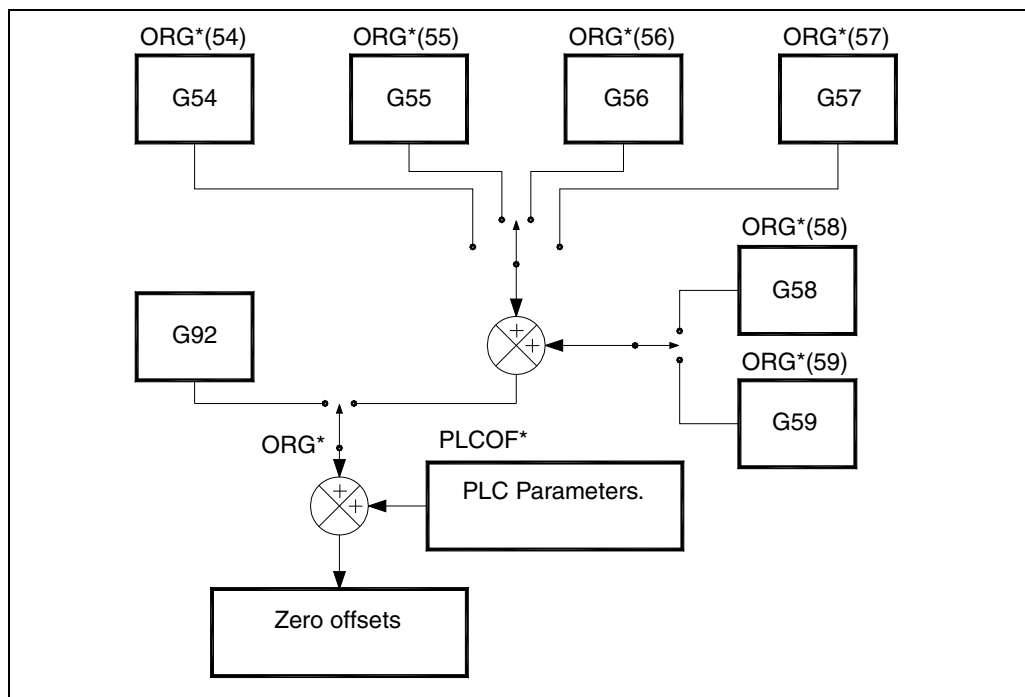

CNC 8035

·M· MODEL
(SOFT V15.3x)

4.4.1 Coordinate preset and S value limitation (G92)

Via Function G92 one can select any value in the axes of the CNC, in addition to limiting the spindle speed.

- Coordinate preset.

When carrying out a zero offset via Function G92, the CNC assumes the coordinates of the axes programmed after G92 as new axis values.

No other function can be programmed in the block where G92 is defined, the programming format being :

```
G92 X...C ±5.5
```

```

; Positioning in P0
G90 X50 Y40
; Preset P0 as part zero
G92 X0 Y0
; Programming according to part coordinates
G91 X30
X20 Y20
X-20 Y20
X -30
Y -40
    
```

- Spindle speed limitation

When executing a "G92 S5.4" type block, the CNC limits the spindle speed from that instant on to the value set by S5.4.

If later on, a block is to be executed at a greater "S", the CNC will execute that block at the maximum "S" set with function G92S.

Neither is it possible to exceed this maximum value from the keyboard on the front panel.

4.

REFERENCE SYSTEMS
Coordinate preset and zero offsets



CNC 8035

·M· MODEL
(SOFT V15.3x)

4.4.2 Zero offsets (G54..G59 and G159)

The CNC has a table of zero offsets, in which several zero offsets can be selected. The aim is to generate certain part zeros independently of the part zero active at the time.

Access to the table can be obtained from the front panel of the CNC (as explained in the Operating Manual), or via the program using high-level language commands.

There are two kinds of zero offsets :

- Absolute zero offsets (G54 ... G57, G159N1 ... G159N20), which must be referred to machine zero.
- Incremental zero offsets (G58,G59).

Functions G54, G55, G56, G57, G58 & G59 must be programmed alone in the block, and work in the following way:

When one of the G54, G55, G56, G57 functions is executed, the CNC applies the zero offset programmed with respect to machine zero, canceling the possible active zero offsets.

If one of the incremental offsets G58 or G59 is executed, the CNC adds its values to the absolute zero offset active at the time. Previously canceling the additive offset which might be active.

You can see (in the following example) the zero offsets which are applied when the program is executed.


G54	Applies zero offsets G54	==> G54
G58	Applies zero offsets G58	==> G54+G58
G59	Cancels G58 and adds G59	==> G54+G59
G55	Cancels whatever and applies G55	==> G55

Once a Zero Offset has been selected, it will remain active until another one is selected or until a home search is carried out (G74) in JOG mode. This zero offset will remain active even after powering the CNC off and back on.

This kind of zero offsets established by program is very useful for repeated machining operations at different machine positions.

Example: The zero offset table is initialized with the following values:

G54:	X200	Y100
G55:	X160	Y 60
G56:	X170	Y110
G58:	X-40	Y-40
G59:	X-30	Y10

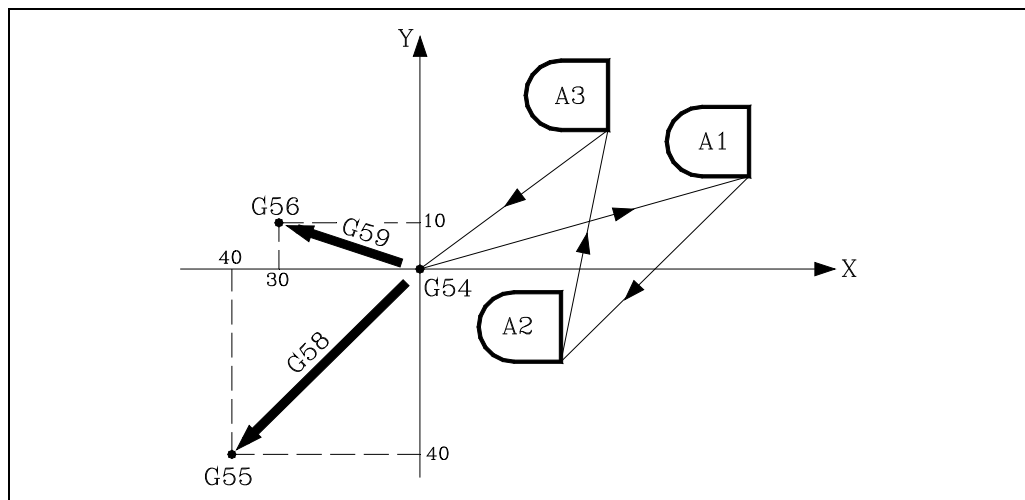

4.

REFERENCE SYSTEMS
Coordinate preset and zero offsets



CNC 8035

·M· MODEL
(SOFT V15.3x)

Using absolute zero offsets:

- G54 ; Applies G54 offset
- Profile execution ; Executes profile A1
- G55 ; Applies G55 offset
- Profile execution ; Executes profile A2
- G56 ; Applies G56 offset
- Profile execution ; Executes profile A3

Using incremental zero offsets:

- G54 ; Applies G54 offset
- Profile execution ; Executes profile A1
- G58 ; Applies offsets G54+G58
- Profile execution ; Executes profile A2
- G59 ; Applies offsets G54+G59
- Profile execution ; Executes profile A3

Function G159

To apply any zero offset defined in the table.

The first six zero offsets are the same as programming G54 through G59, except that the values of G58 and G59 are absolute. This is because function G159 cancels functions G54 through G57 and, consequently, there is no active zero offset to add the G58 or G59 to.

Function G159 is programmed as follows:

G159 Nn where n is a number from 1 to 20 that indicates the number of the zero offset being applied.

Function G159 is modal, it is programmed alone in the block and is incompatible with functions G53, G54, G55, G56, G57, G58, G59 and G92.

On power-up, the CNC assumes the zero offset that was active when the CNC was turned off. On the other hand, the zero offset is neither affected by functions M02 and M30 nor by RESET.

This function is displayed in the history like G159Nn where the n is the active zero offset.

Examples:

- G159 N1 It applies the first zero offset. It is the same as programming G54.
- G159 N6 It applies the sixth zero offset. It is the same as programming G59, but it is applied in absolute.
- G159 N20 It applies the 20th zero offset.

4.

REFERENCE SYSTEMS

Coordinate preset and zero offsets



CNC 8035

·M· MODEL
(SOFT V15.3x)


4.5 Polar origin preset (G93)

Function G93 allows you to preset any point from the work plane as a new origin of polar coordinates.

This function must be programmed alone in the block, its programming format being :

```
G93 I±5.5 J±5.5
```

Parameters I & J respectively define the abscissa and ordinate axes, of the new origin of polar coordinates referred to part zero.

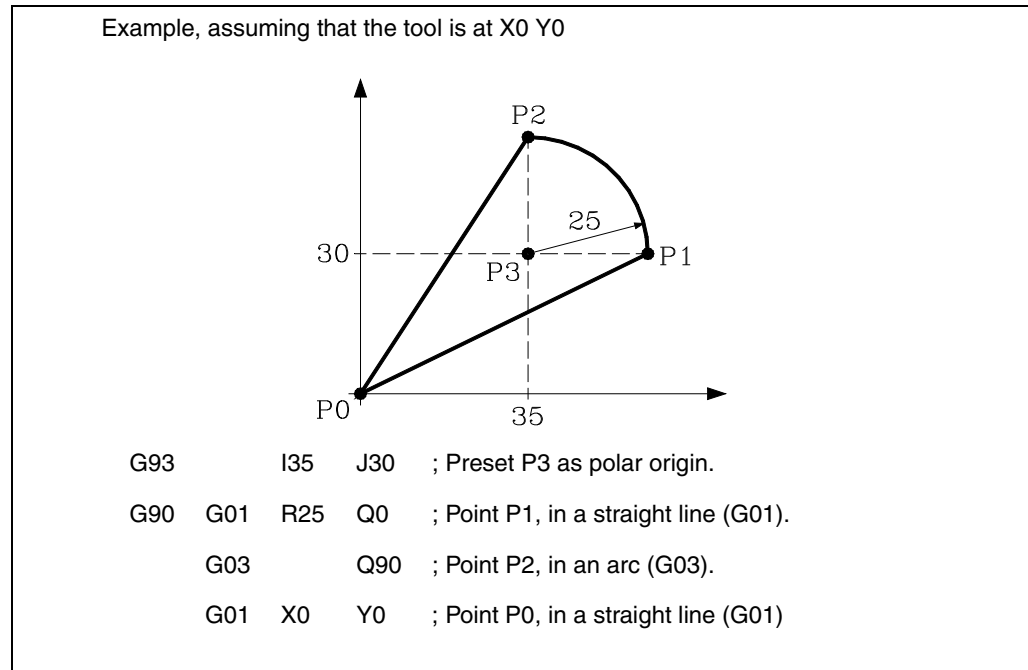

If G93 is only programmed in a block, the point where the machine is at that moment becomes the polar origin.

On power-up; or after executing M02, M30; or after an EMERGENCY or RESET; the CNC assumes the currently active part zero as polar origin.

When selecting a new work plane (G16, G17, G18, G19), the CNC assumes as polar origin the part zero of that plane.



The CNC does not modify the polar origin when defining a new part zero; but it modifies the values of the variables: "PORGF" y "PORGS".

If, while selecting the general machine parameter "PORGMOVE" a circular interpolation is programmed (G02 or G03), the CNC assumes the center of the arc as the new polar origin.

A block programmed in ISO language can consist of:

- Preparatory (G) functions
- Axis coordinates (X...C)
- Feedrate (F)
- Spindle speed (S)
- Tool number (T)
- Tool offset number (D)
- Auxiliary functions (M)

This order should be maintained within each block, although it is not necessary for every block to contain the information.

The CNC allows you to program figures from 0.00001 to 99999.9999 with or without sign, working in millimeters (G71), called format +/-5.4, or either from 0.00001 to 3937.00787 with or without sign if the programming is done in inches (G70), called format +/-4.5.

However, and to simplify the instructions, we can say that the CNC admits +/- 5.5 format, thereby admitting +/- 5.4 in millimeters and +/- 4.5 in inches.

Any function with parameters can also be programmed in a block, apart from the number of the label or block. Thus, when the block is executed the CNC substitutes the arithmetic parameter for its value at that time.

5.1 Preparatory functions

Preparatory functions are programmed using the letter G followed by up to 3 digits (G0 - G319).

They are always programmed at the beginning of the body of the block and are useful in determining the geometry and working condition of the CNC.

Table of G functions used in the CNC.

Function	M	D	V	Meaning	Section
G00	*	?	*	Rapid traverse	6.1
G01	*	?	*	Linear interpolation	6.2
G02	*		*	Clockwise circular (helical) interpolation	6.3 / 6.7
G03	*		*	Counterclockwise circular (helical) interpolation	6.3 / 6.7
G04				Dwell/interruption of block preparation	7.1 / 7.2
G05	*	?	*	Round corner	7.3.2
G06			*	Circle center in absolute coordinates	6.4
G07	*	?		Square corner	7.3.1
G08			*	Arc tangent to previous path.	6.5
G09			*	Arc defined by three points	6.6
G10	*	*		Mirror image cancellation	7.5
G11	*		*	Mirror image on X axis	7.5
G12	*		*	Mirror image on Y axis	7.5
G13	*		*	Mirror image on Z axis	7.5
G14	*		*	Mirror image in the programmed directions	7.5
G15	*		*	Longitudinal axis selection	8.2
G16	*		*	Main plane selection by two addresses and longitudinal axis	3.2
G17	*	?	*	Main plane X-Y and longitudinal Z	3.2
G18	*	?	*	Main plane Z-X and longitudinal Y	3.2
G19	*		*	Main plane Y-Z and longitudinal X	3.2
G20				Definition of lower work zone limits	3.7.1
G21				Definition of upper work zone limits.	3.7.1
G22			*	Enable/disable work zones.	3.7.2
G32	*		*	Feedrate "F" as an inverted function of time.	6.15
G33	*		*	Electronic threading	6.12
G34				Variable-pitch threading	6.13
G36			*	Controlled corner rounding	6.10
G37			*	Tangential entry	6.8
G38			*	Tangential exit	6.9
G39			*	Chamfer	6.11
G40	*	*		Cancellation of tool radius compensation	8.1
G41	*		*	Left-hand tool radius compensation	8.1
G41 N	*		*	Collision detection	8.3
G42	*		*	Right-hand tool radius compensation	8.1
G42 N	*		*	Collision detection	8.3
G43	*	?	*	Tool length compensation	8.2
G44	*	?		Cancellation of tool length compensation	8.2
G50	*		*	Controlled corner rounding	7.3.3
G51	*		*	Look-Ahead	7.4
G52			*	Movement until making contact	6.14
G53			*	Programming with respect to machine zero	4.3
G54	*		*	Absolute zero offset 1	4.4.2
G55	*		*	Absolute zero offset 2	4.4.2
G56	*		*	Absolute zero offset 3	4.4.2
G57	*		*	Absolute zero offset 4	4.4.2
G58	*		*	Additive zero offset 1	4.4.2
G59	*		*	Additive zero offset 2	4.4.2
G60			*	Multiple machining in a straight line	10.1
G61			*	Multiple machining in a rectangular pattern	10.2
G62			*	Grid pattern canned cycle	10.3
G63			*	Multiple machining in a circular pattern	10.4
G64			*	Multiple machining in an arc	10.5

5.

ISO CODE PROGRAMMING
Preparatory functions



CNC 8035

-M- MODEL
(SOFT V15.3x)

Function	M	D	V	Meaning	Section
G65			*	Machining programmed with an arc-chord	10.6
G69	*		*	Drilling canned cycle with variable peck	9.6
G70	*	?	*	Programming in inches	3.3
G71	*	?		Programming in millimeters	3.3
G72	*		*	General and specific scaling factor	7.6
G73	*		*	Pattern rotation	7.7
G74			*	Home search	4.2
G75			*	Probing move until touching	11.1
G76			*	Probing move while touching	11.1
G79				Canned cycle parameter modification	9.2.1
G80	*	*		Canned cycle cancellation	9.3
G81	*		*	Drilling canned cycle	9.7
G82	*		*	Drilling canned cycle with dwell	9.8
G83	*		*	Deep-hole drilling canned cycle with constant peck	9.9
G84	*		*	Tapping canned cycle	9.10
G85	*		*	Reaming canned cycle	9.11
G86	*		*	Boring canned cycle with withdrawal in G00	9.12
G87	*		*	Rectangular pocket canned cycle.	9.13
G88	*		*	Circular pocket canned cycle	9.14
G89	*		*	Boring canned cycle with withdrawal in G01	9.15
G90	*	?		Absolute programming:	3.4
G91	*	?	*	Incremental programming	3.4
G92				Coordinate preset / spindle speed limit	4.4.1
G93				Polar origin preset	4.5
G94	*	?		Feedrate in millimeters (inches) per minute	5.2.1
G95	*	?	*	Feedrate in millimeters (inches) per revolution.	5.2.2
G96	*		*	Constant cutting point speed	5.2.3
G97	*	*		Constant tool center speed	5.2.4
G98	*	*		Withdrawal to the starting plane at the end of the canned cycle	9.5
G99	*		*	Withdrawal to the reference plane at the end of the canned cycle	9.5
G159	*			Absolute zero offsets	4.4
G210	*		*	Bore milling canned cycle	9.16
G211	*		*	Inside thread milling canned cycle.	9.17
G212	*		*	Outside thread milling canned cycle.	9.18

M means modal, i.e. the G function, once programmed, remains active while another incompatible G function is not programmed or until an M02, M30, EMERGENCY or RESET is executed or the CNC is turned off and back on.

D means BY DEFAULT, i.e. they will be assumed by the CNC when it is powered on, after executing M02, M30 or after EMERGENCY or RESET.

In those cases indicated by ? , it should be understood that the DEFAULT of these G functions depends on the setting of the general machine parameters of the CNC.

V means that the G code is displayed next to the current machining conditions in the execution and simulation modes.

5.

ISO CODE PROGRAMMING
Preparatory functions



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.2 Feedrate F

The machining feedrate can be selected from the program. It remains active until another feedrate is programmed. It is represented by the letter F and Depending on whether it is working in G94 or G95, it is programmed in mm/minute (inches/minute) or in mm/revolution (inches/revolution).

Its programming format is 5.5; in other words, 5.4 when programmed in mm and 4.5 when programmed in inches.

The maximum operating feedrate of the machine, limited on each axis by the axis machine parameter "MAXFEED", may be programmed via code F0, or by giving F the corresponding value.

The programmed feedrate F is effective working in linear (G01) or circular (G02, G03) interpolation. If function F is not programmed, the CNC assumes the feedrate to be F0. When working in rapid travel (G00), the machine will move at the rapid feedrate indicated by the axis machine parameter "G00FEED", apart from the F programmed.

The programmed feedrate F may be varied between 0% and 255% via the PLC, or by DNC, or between 0% and 120% via the switch located on the Operator Panel of the CNC.

The CNC, however, is equipped with the general machine parameter "MAXFOVR" to limit maximum feedrate variation.

If you are working in rapid travel (G00), rapid feedrate will be fixed at 100%, alternatively it can be varied between 0% and 100%, depending on how the machine parameter "RAPIDOVR" is set.

When functions G33 (electronic threading), G34 (variable-pitch threading) or G84 (tapping canned cycle) are executed the feedrate cannot be modified; it works at 100% of programmed F.

5.

ISO CODE PROGRAMMING Feedrate F



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.2.1 Feedrate in mm/min or inches/min (G94)

From the moment the code G94 is programmed, the control takes that the feedrates programmed through F5.5 are in mm/min or inches/mm.

If the moving axis is rotary, the CNC interprets that the programmed feedrate is in degrees/minute.

If an interpolation is made between a rotary and a linear axis, the programmed feedrate is taken in mm/min or inches/min, and the movement of the rotary axis (programmed in degrees) will be considered programmed in millimeters or inches.

The relationship between the feedrate of the axis component and the programmed feedrate “F” is the same as that between the movement of the axis and the resulting programmed movement.

$$\text{Feedrate component} = \frac{\text{Feedrate F} \times \text{Movement of axis}}{\text{Resulting programmed movement}}$$

Example:

On a machine which has linear X and Y axes and rotary C axis, all located at point X0 Y0 C0, the following movement is programmed :

```
G1 G90 X100 Y20 C270 F10000
```

You get:

$$F_x = \frac{F \cdot \Delta x}{\sqrt{(\Delta x)^2 + (\Delta y)^2 + (\Delta c)^2}} = \frac{10000 \times 100}{\sqrt{100^2 + 20^2 + 270^2}} = 3464,7946$$

$$F_y = \frac{F \cdot \Delta y}{\sqrt{(\Delta x)^2 + (\Delta y)^2 + (\Delta c)^2}} = \frac{10000 \times 20}{\sqrt{100^2 + 20^2 + 270^2}} = 692,9589$$

$$F_c = \frac{F \cdot \Delta c}{\sqrt{(\Delta x)^2 + (\Delta y)^2 + (\Delta c)^2}} = \frac{10000 \times 270}{\sqrt{100^2 + 20^2 + 270^2}} = 9354,9455$$

Function G94 is modal i.e. once programmed it stays active until G95 is programmed.

On power-up, after executing M02, M30 or following EMERGENCY or RESET, the CNC assumes function G94 or G95 according to how the general machine parameter "IFEED" is set.

5.

ISO CODE PROGRAMMING

Feedrate F

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

5.2.2 Feedrate in mm/rev.or inches/rev (G95)

From the moment when the code G95 is programmed, the control assumes that the feedrates programmed through F5.5 are in mm/rev or inches/mm.

This function does not affect the rapid moves (G00) which will be made in mm/min or inch/min. By the same token, it will not be applied to moves made in the JOG mode, during tool inspection, etc.

Function G95 is modal i.e. once programmed it stays active until G94 is programmed.

On power-up, after executing M02, M30 or following EMERGENCY or RESET, the CNC assumes function G94 or G95 according to how the general machine parameter "IFEED" is set.

5.

ISO CODE PROGRAMMING
Feedrate F



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.2.3 Constant surface speed (G96)

When G96 is programmed the CNC takes the F5.5 feedrate as corresponding to the cutting point of the tool on the part.

By using this function, the finished surface is uniform in curved sections.

In this manner (working in function G96) the speed of the center of the tool in the inside or outside curved sections will change in order to keep the cutting point constant.

Function G96 is modal i.e. once programmed it stays active until G97 is programmed.

On power-up, after executing M02, M30 or following EMERGENCY or RESET, the CNC assumes function G97.

5.**ISO CODE PROGRAMMING**

Feedrate F

FAGOR **CNC 8035**·M· MODEL
(SOFT V15.3x)

5.2.4 Constant tool center speed (G97)

When G97 is programmed the CNC takes the programmed F5.5 feedrate as corresponding to the feedrate of the center of the tool.

In this manner (working in function G97) the speed of the cutting point on the inside or outside curved sections is reduced, keeping the speed of the center of the tool constant.

Function G97 is modal i.e. once programmed it stays active until G96 is programmed.

On power-up, after executing M02, M30 or following EMERGENCY or RESET, the CNC assumes function G97.

5.

ISO CODE PROGRAMMING
Feedrate F



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.3 Spindle speed (S)

The turning speed of the spindle is programmed directly in rpm via code S5.4.

The maximum value is limited by spindle machine parameters "MAXGEAR1", MAXGEAR2, MAXGEAR 3 and MAXGEAR4", in each case depending on the spindle range selected.

It is also possible to limit this maximum value from the program by using function G92 S5.4.

The programmed turning speed S may be varied from the PLC, DNC, or by the SPINDLE keys "+" and "-" on the Operator Panel of the CNC.

This speed variation is made between the maximum and minimum values established by spindle machine parameters "MINSOVR" and "MAXSOVR".

The incremental pitch associated with the SPINDLE keys "+" and "-" on the CNC Operator Panel in order to vary the programmed S value is fixed by the spindle machine parameter "SOVRSTEP".

When functions G33 (electronic threading), G34 (variable-pitch threading) or G84 (tapping canned cycle) are executed the programmed speed cannot be modified; it works at 100% of programmed S.

5.**ISO CODE PROGRAMMING**

Spindle speed (S)


FAGOR **CNC 8035**·M· MODEL
(SOFT V15.3x)

5.4 Tool number (T) and tool offset (D)

With the "T" function, it is possible to select the tool and with the "D" function it is possible to select the offset associated with it. When defining both parameters, the programming order is T D. For example: T6 D17

5.

ISO CODE PROGRAMMING
Tool number (T) and tool offset (D)

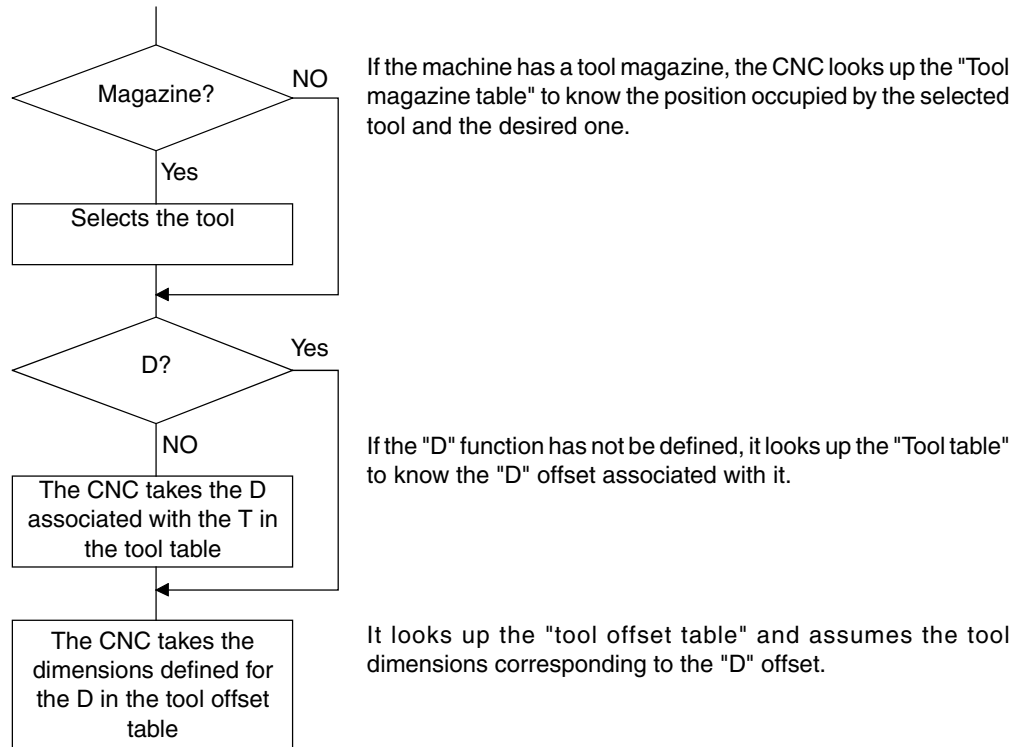

To access, check and define these tables, refer to the operating manual.

How to use the T and D functions

- The "T" and "D" functions may be programmed alone or together as shown in the following example:

T5 D18 Selects tool 5 and assumes the dimensions of tool offset 18

D22 Tool 5 stays selected and it assumes the dimensions of tool offset 22.

T3 Selects tool 3 and assumes the dimensions of the offset associated with that tool.

- When having a tool magazine where the same position is occupied by more than one tool, do the following:

Use the "T" function to refer to the magazine position and the "D" function to the dimensions of the tool located in that position.

Thus, for example, programming T5 D23 means selecting the turret position 5 and assuming the geometry and dimensions of tool offset 23.

Tool length and radius compensation.

The CNC looks up the "tool offset table" and assumes the tool dimensions corresponding to the active "D" offset.

Length compensation is applied at all times, whereas radius compensation must be selected by the operator by means of functions G40, G41, G42.

Length compensation is applied at all times, whereas tool length compensation must be selected by the operator by means of functions G43, G44.

If there is no tool selected or D0 is defined, neither tool length nor radius compensation is applied.

For further information, refer to chapter 8 "tool compensation" in this manual..



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5 Auxiliary function (M)

The miscellaneous functions are programmed by means of the M4 Code, it being possible to program up to 7 functions in the same block.

When more than one function has been programmed in one block, the CNC executes these correlatively to the order in which they have been programmed.

The CNC is provided with an M functions table with "NMISCFUN" (general machine parameter) components, specifying for each element:

- The number (0-9999) of the defined miscellaneous M function.
- The number of the subroutine which is required to associate to this miscellaneous function.
- An indicator which determines if the M function is executed before or after the movement block in which it is programmed.
- An indicator which determines if the execution of the M function interrupts block preparation or not.
- An indicator which determines if the M function is executed or not, after the execution of the associated subroutine.
- An indicator which determines if the CNC must wait for the signal AUX END or not (Executed M signal, coming from the PLC), to continue the execution of the program.

If, when executing the M miscellaneous function, this is not defined in the M functions table, the programmed function will be executed at the beginning of the block and the CNC will wait for the AUX END to continue the execution of the program.

Some of the miscellaneous functions are assigned an internal meaning in the CNC.

If, while executing the associated subroutine of an "M" miscellaneous function, there is a block containing the same "M", this will be executed but not the associated subroutine.



All the miscellaneous "M" functions which have an associated subroutine must be programmed alone in a block.

In the case of functions M41 through M44 with associated subroutine, the S that generates the gear change must be programmed alone in the block. Otherwise, the CNC will display error 1031.

5.

ISO CODE PROGRAMMING

Auxiliary function (M)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5.1 M00. Program stop

When the CNC reads code M00 in a block, it interrupts the program. To start up again, press CYCLE START.

We recommend that you set this function in the table of M functions, in such a way that it is executed at the end of the block in which it is programmed.

5.

ISO CODE PROGRAMMING
Auxiliary function (M)



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5.2 M01. Conditional program stop

This is identical to M00, except that the CNC only takes notice of it if the signal M01 STOP from the PLC is active (high logic level).

5.**ISO CODE PROGRAMMING**
Auxiliary function (M)**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

5.5.3 M02. End of program

This code indicates the end of program and carries out a "General Reset" function of the CNC (returning it to original state). It also carries out the M05 function.

We recommend that you set this function in the table of M functions, in such a way that it is executed at the end of the block in which it is programmed.

5.

ISO CODE PROGRAMMING
Auxiliary function (M)



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5.4 M30. End of program with return to the first block

Identical to M02 except that the CNC returns to the first block of the program.

5.**ISO CODE PROGRAMMING**

Auxiliary function (M)

FAGOR **CNC 8035**·M· MODEL
(SOFT V15.3x)

5.5.5 M03 Clockwise spindle rotation

This code represents clockwise spindle start. As explained in the corresponding section, the CNC automatically executes this code in the machining canned cycles.

It is recommended to set this function in the table of M functions, so that it is executed at the beginning of the block in which it is programmed.

5.

ISO CODE PROGRAMMING
Auxiliary function (M)



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5.6 M04. Counterclockwise spindle rotation

This code represents counterclockwise spindle start. We recommend that you set this function in the table of M functions, so that it is executed at the beginning of the block in which it is programmed.

5.**ISO CODE PROGRAMMING**
Auxiliary function (M)**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

5.5.7 M05. Spindle stop

We recommend that you set this function in the table of M functions, in such a way that it is executed at the end of the block in which it is programmed.

5.

ISO CODE PROGRAMMING
Auxiliary function (M)



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5.8 M06. Tool change code

If the general machine parameter "TOFFM06" (indicating that it is a machining center) is active, the CNC sends instructions to the tool changer and updates the table corresponding to the tool magazine.

It is recommended to set this function in the table of M functions, so that the subroutine corresponding to the tool changer installed in the machine is executed.

5.**ISO CODE PROGRAMMING**
Auxiliary function (M)**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

5.5.9 M19. Spindle orientation

With this CNC it is possible to work with the spindle in open loop (M3, M4) and with the spindle in closed loop (M19).

In order to work in closed loop, it is necessary to have a rotary encoder installed on the spindle of the machine.

To switch from open loop to closed loop, execute function M19 or M19 S±5.5. The CNC will act as follows:

- If the spindle has a home switch, the CNC modifies the spindle speed until it reaches the one set by spindle machine parameter "REFEED1".

It then searches for actual marker pulse (I_o) of the spindle encoder at the turning speed set by spindle machine parameter REFEED2.

And, finally, it positions the spindle at the programmed S±5.5 point.

- If the spindle does not have a home switch, it searches the encoder marker pulse at the turning speed set by spindle machine parameter REFEED2.

And, then, it positions the spindle at the programmed S±5.5 point.

If only M19 is executed, the spindle is oriented to position "S0" after having "found" the home switch.

To, now, orient the spindle to another position, program M19 S±5.5, the CNC will not perform the home search since it is already in closed loop and it will orient the spindle to the indicated position. (S±5.5).

The S±5.5 code indicates the spindle position, in degrees, from the spindle reference point (marker pulse).

The sign indicates the counting direction and the 5.5 value is always considered to be absolute coordinates regardless of the type of units currently selected.

Example:

S1000 M3

Spindle in open loop.

M19 S100

The spindle switches to closed loop. Home search and positioning (orientation) at 100°.

M19 S -30

The spindle orients to -30°, passing through 0°.

M19 S400

The spindle turns a whole revolution and positions at 40°.

5.

ISO CODE PROGRAMMING
Auxiliary function (M)



CNC 8035

·M· MODEL
(SOFT V15.3x)

5.5.10 M41, M42, M43, M44. Spindle gear change

The CNC offers 4 spindle speed ranges M41, M42, M43 and M44 with maximum speed limits set by the spindle machine parameters "MAXGEAR1", "MAXGEAR2", "MAXGEAR3" and "MAXGEAR4".

If machine parameter "AUTOGEAR" is set so the CNC executes the range change automatically, M41 thru M44 will be sent out automatically by the CNC without having to be programmed.

If this machine parameter is set for non-automatic gear change, M41 thru M44 will have to be programmed every time a gear change is required. Bear in mind that the maximum velocity command value assigned to machine parameter "MAXVOLT" corresponds to the maximum speed indicated for each one of the speed ranges (machine parameters "MAXGEAR1" thru "MAXGEAR4").

Regardless of whether the gear change is automatic or not, functions M41 through M44 may have an associated subroutine. If the function M41 through M44 is programmed and then an S corresponding to that gear, it does not generate the automatic gear change and it does not execute the associated subroutine.

5.**ISO CODE PROGRAMMING**
Auxiliary function (M)**FAGOR** **CNC 8035**-M- MODEL
(SOFT V15.3x)

5.

ISO CODE PROGRAMMING Auxiliary function (M)



CNC 8035

·M· MODEL
(SOFT V15.3x)

The CNC allows you to program movements on one axis only or several at the same time.

Only those axes which intervene in the required movement are programmed. The programming order of the axes is as follows :

X, Y, Z, U, V, W, A, B, C


6.1 Rapid traverse (G00)

The movements programmed after G00 are executed at the rapid feedrate indicated in the axis machine parameter "G00FEED".

Independently of the number of axis which move, the resulting path is always a straight line between the starting point and the final point.

6.

PATH CONTROL
Rapid traverse (G00)

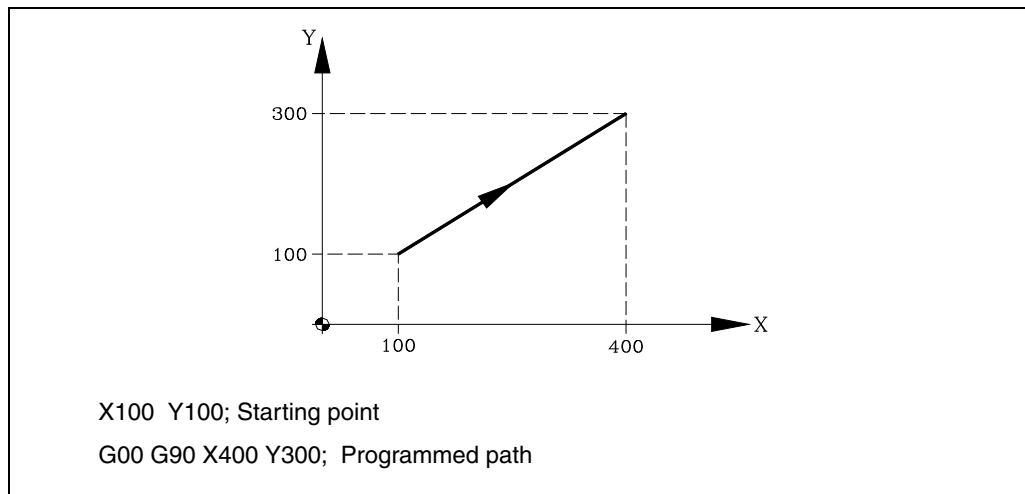

It is possible, via the general machine parameter "RAPIDOVR", to establish if the feedrate override % switch (when working in G00) operates from 0% to 100%, or whether it stays constant at 100%.

When G00 is programmed, the last "F" programmed is not cancelled i.e. when G01, G02 or G03 are programmed again "F" is recovered.

G00 is modal and incompatible with G01, G02, G03, G33 G34 and G75. Function G00 can be programmed as G or G0.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G00 or G01, depending on how general machine parameter "IMOVE" has been set.



CNC 8035


-M- MODEL
(SOFT V15.3x)

6.2 Linear interpolation (G01)

The movements programmed after G01 are executed according to a straight line and at the programmed feedrate "F".

When two or three axes move simultaneously the resulting path is a straight line between the starting point and the final point.

The machine moves according to this path to the programmed feedrate "F". The CNC calculates the feedrates of each axis so that the resulting path is the "F" value programmed.

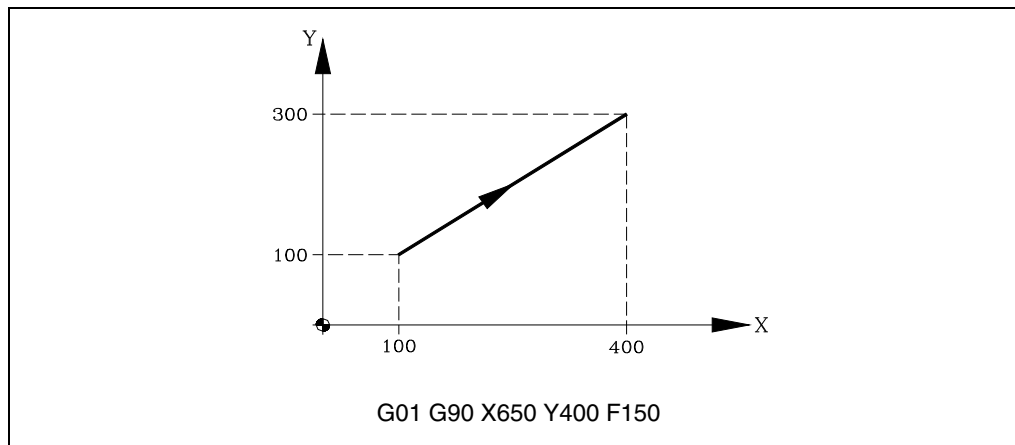

The programmed feedrate "F" may vary between 0% and 120% via the switch located on the Control Panel of the CNC, or by selecting between 0% and 255% from the PLC, or via the DNC or the program.

The CNC, however, is equipped with the general machine parameter "MAXFOVR" to limit maximum feedrate variation.

With this CNC, it is possible to program a positioning-only axis in a linear interpolation block. The CNC will calculate the feedrate for this positioning-only axis so it reaches the target coordinate at the same time as the interpolating axes.

Function G01 is modal and incompatible with G00, G02, G03, G33 and G34. Function G01 can be programmed as G1.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G00 or G01, depending on how general machine parameter "IMOVE" has been set.

6.

PATH CONTROL
Linear interpolation (G01)



CNC 8035

·M· MODEL
(SOFT V15.3x)

6.3 Circular interpolation (G02, G03)


There are two ways of carrying out circular interpolation:

G02: Clockwise circular interpolation

G03: Counterclockwise circular interpolation

Movements programmed after G02 and G03 are executed in the form of a circular path and at the programmed feedrate "F".

Clockwise (G02) and counterclockwise (G03) definitions are established according to the system of coordinates shown below:

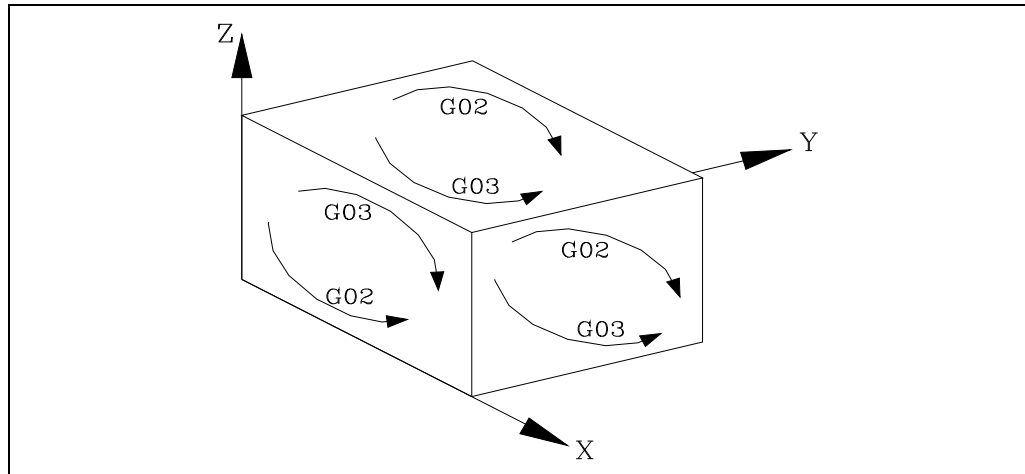


This system of coordinates refers to the movement of the tool on the part.

Circular interpolation can only be executed on a plane. The form of definition of circular interpolation is as follows :

Cartesian coordinates

The coordinates of the endpoint of the arc and the position of the center with respect to the starting point are defined according to the axes of the work plane.

The center coordinates are defined in radius by the letters I, J, or K, each one of these being associated to the axes as follows: When not defining the center coordinates, the CNC assumes that their value is zero.

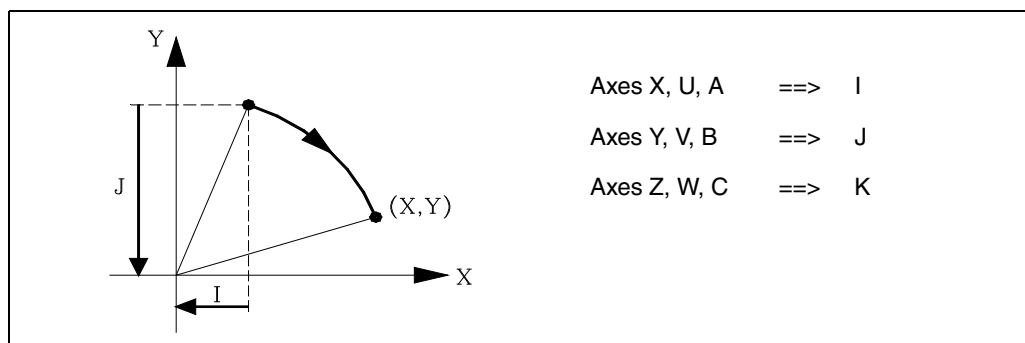

Programming format:

Plane XY: G02(G03) X±5.5 Y±5.5 I±6.5 J±6.5

Plane ZX: G02(G03) X±5.5 Z±5.5 I±6.5 K±6.5

Plane YZ: G02(G03) Y±5.5 Z±5.5 J±6.5 K±6.5

The programming order of the axes is always maintained regardless of the plane selected, as are the respective center coordinates.

Plane AY:	G02(G03)	Y±5.5	A±5.5	J±6.5	I±6.5
Plane XU:	G02(G03)	X±5.5	U±5.5	I±6.5	I±6.5

Polar coordinates

It is necessary to define the angle of the end point referred to the arc center to be programmed and the distance from the starting point to the center (optional), according to the axes of the work plane.

The center coordinates are defined by the letters I, J, or K, each one of these being associated to the axes as follows:

Axes X, U, A	==>	I
Axes Y, V, B	==>	J
Axes Z, W, C	==>	K

If the center of the arc is not defined, the CNC will assume that it coincides with the last one.

Programming format:

Plane XY:	G02(G03)	Q±5.5	I±6.5	J±6.5
Plane ZX:	G02(G03)	Q±5.5	I±6.5	K±6.5
Plane YZ:	G02(G03)	Q±5.5	J±6.5	K±6.5

Cartesian coordinates with radius programming

The coordinates of the endpoint of the arc and radius R are defined.

Programming format:

Plane XY:	G02(G03)	X±5.5	Y±5.5	R±6.5
Plane ZX:	G02(G03)	X±5.5	Z±5.5	R±6.5
Plane YZ:	G02(G03)	Y±5.5	Z±5.5	R±6.5

If a complete circle is programmed, with radius programming, the CNC will show the corresponding error, as infinite solutions exist.

If an arc is less than 180°, the radius is programmed with a plus sign, and a minus sign if it is more than 180°.

6.

PATH CONTROL
Circular interpolation (G02, G03)




CNC 8035

·M· MODEL
(SOFT V15.3x)

6.

PATH CONTROL
Circular interpolation (G02, G03)

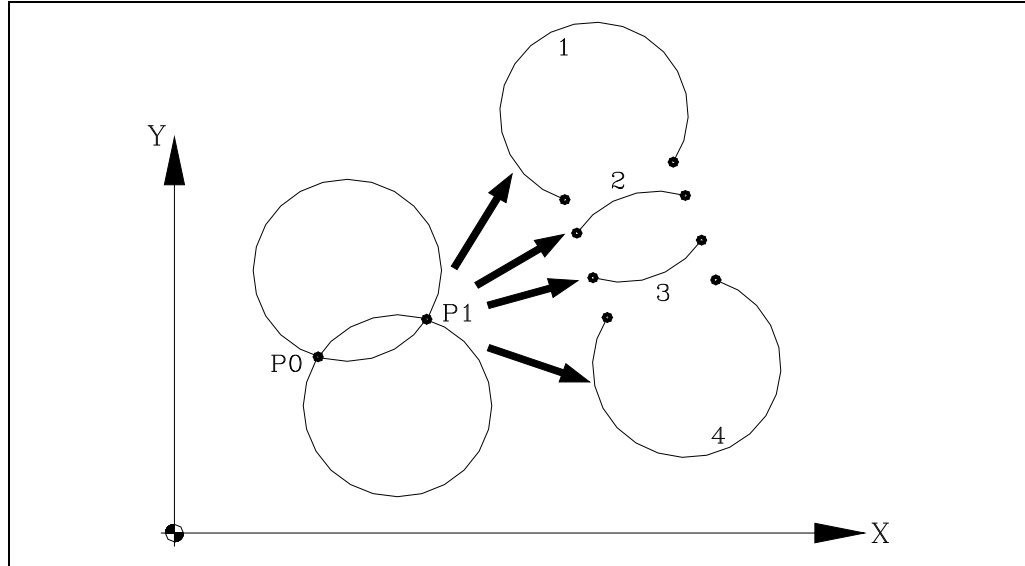

If P0 is the starting point and P1 the endpoint, there are 4 arcs which have the same value passing through both points.

Depending on the circular interpolation G02 or G03, and on the radius sign, the relevant arc is defined. Thus the programming format of the sample arcs is as follows:

- Arc 1 G02 X.. Y.. R- ..
- Arc 2 G02 X.. Y.. R+..
- Arc 3 G03 X.. Y.. R+..
- Arc 4 G03 X.. Y.. R- ..

Execution of the circular interpolation

The CNC calculates, depending on the programmed arc, the radii of the starting point and endpoint. Although both of them should be "exactly" the same, general parameter "CIRINERR" allows a certain calculation tolerance by establishing the maximum difference between these two radii. When exceeding this value, the CNC will issue the corresponding error message.

In all programming cases, the CNC checks that the coordinates of the center or radius do not exceed 214748.3647mm. Otherwise, the CNC will issue the corresponding error message.

The programmed feedrate "F" may vary between 0% and 120% via the switch located on the Control Panel of the CNC, or by selecting between 0% and 255% from the PLC, or via the DNC or the program.

The CNC, however, is equipped with the general machine parameter "MAXFOVR" to limit maximum feedrate variation.

If the general machine parameter "PORGMOVE" has been selected and a circular interpolation (G02 or G03) is programmed, the CNC assumes the center of the arc to be a new polar origin.

Functions G02 and G03 are modal and incompatible both among themselves and with G00, G01, G33 and G34. Functions G02 and G03 can be programmed as G2 and G3.

Also, function G74 (home search) and G75 (probing) cancel the G02 and G03 functions.


On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G00 or G01, depending on how general machine parameter "IMOVE" has been set.



CNC 8035

-M- MODEL
(SOFT V15.3x)

Programming examples

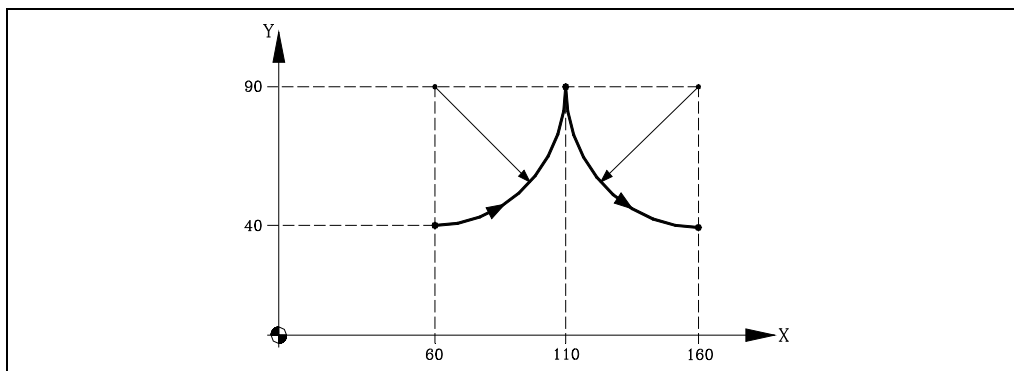

Various programming modes are analyzed below, point X60 Y40 being the starting point.

Cartesian coordinates:

```
G90 G17 G03 X110 Y90 I0 J50
X160 Y40 I50 J0
```

Polar coordinates:

```
G90 G17 G03 Q0 I0 J50
Q-90 I50 J0
```

or:

```
G93 I60 J90 ; defines polar center
G03 Q0
G93 I160 J90 ; defines new polar center
Q-90
```

Cartesian coordinates with radius programming:

```
G90 G17 G03 X110 Y90 R50
X160 Y40 R50
```

6.


PATH CONTROL
Circular interpolation (G02, G03)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

Programming of a (complete) circle in just one block:

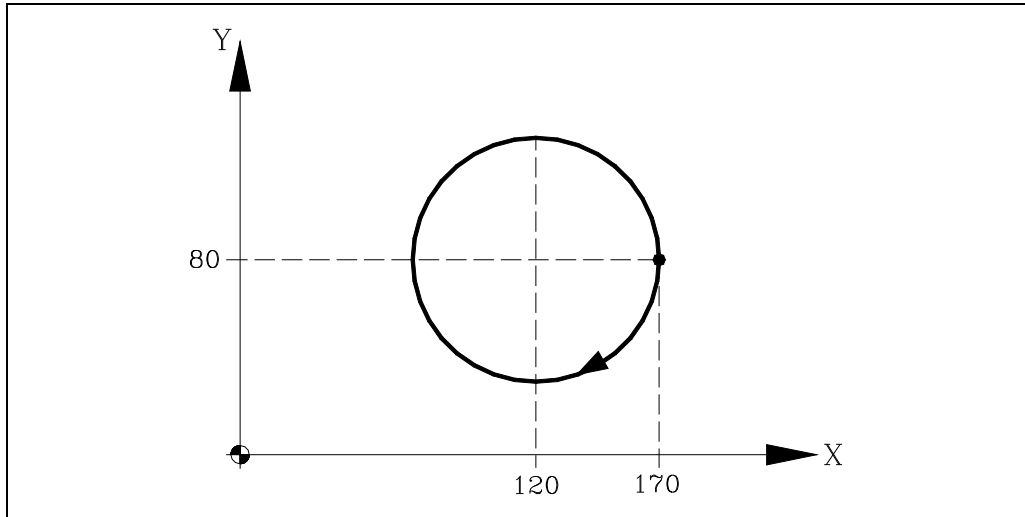

Various programming modes analyzed below, point X170 Y80 being the starting Point.

Cartesian coordinates:

```
G90 G17 G02 X170 Y80 I-50 J0
```

or:

```
G90 G17 G02 I-50 J0
```

Polar coordinates.

```
G90 G17 G02 Q36 0I-50 J0
```

or:

```
G93 I120 J80 ; defines polar center  
G02 Q360
```

Cartesian coordinates with radius programming:

A complete circle cannot be programmed as there is an infinite range of solutions.

6.

PATH CONTROL
Circular interpolation (G02, G03)




CNC 8035

·M· MODEL
(SOFT V15.3x)

6.4 Circular interpolation with absolute arc center coordinates (G06)

By adding function G06 to a circular interpolation block you can program the coordinates of the center of the arc (I,J, or K) in absolute coordinates i.e. with respect to the zero origin and not to the beginning of the arc.

Function G06 is not modal, so it should be programmed any time the coordinates of the center of the arc are required in absolute coordinates. G06 can be programmed as G6.

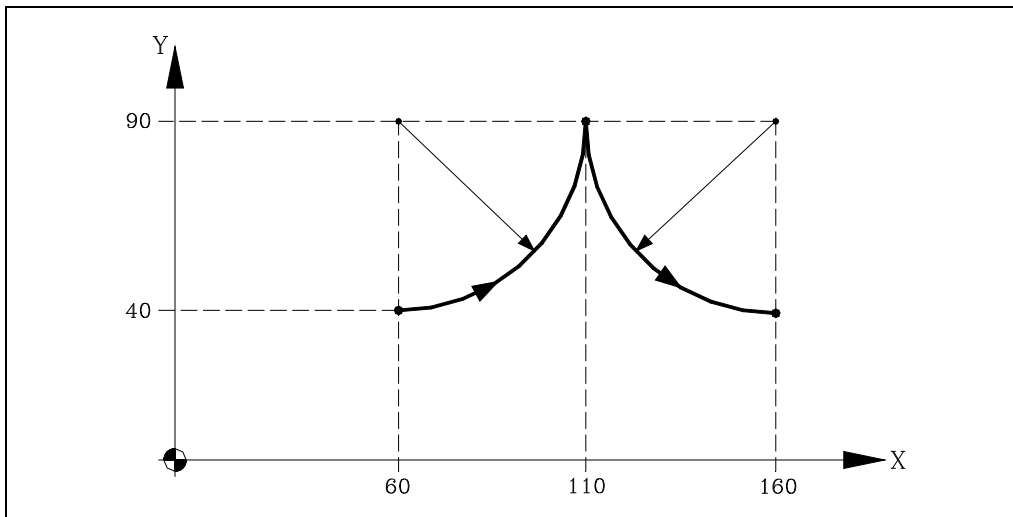

Various programming modes are analyzed below, point X60 Y40 being the starting point.

Cartesian coordinates:

```
G90 G17 G06 G03 X110 Y90 I60 J90
G06 X160 Y40 I160 J90
```

Polar coordinates:

```
G90 G17 G06 G03 Q0 I60 J90
G06 Q-90 I160 J90
```

6.

PATH CONTROL

Circular interpolation with absolute arc center coordinates (G06)

FAGOR 


CNC 8035

·M· MODEL
(SOFT V15.3x)

6.5 Arc tangent to previous path (G08)

Via function G08 you can program an arc tangential to the previous path without having to program the coordinates (I,J &K) of the center.

Only the coordinates of the endpoint of the arc are defined, either in polar coordinates or in Cartesian coordinates according to the axes of the work plane.

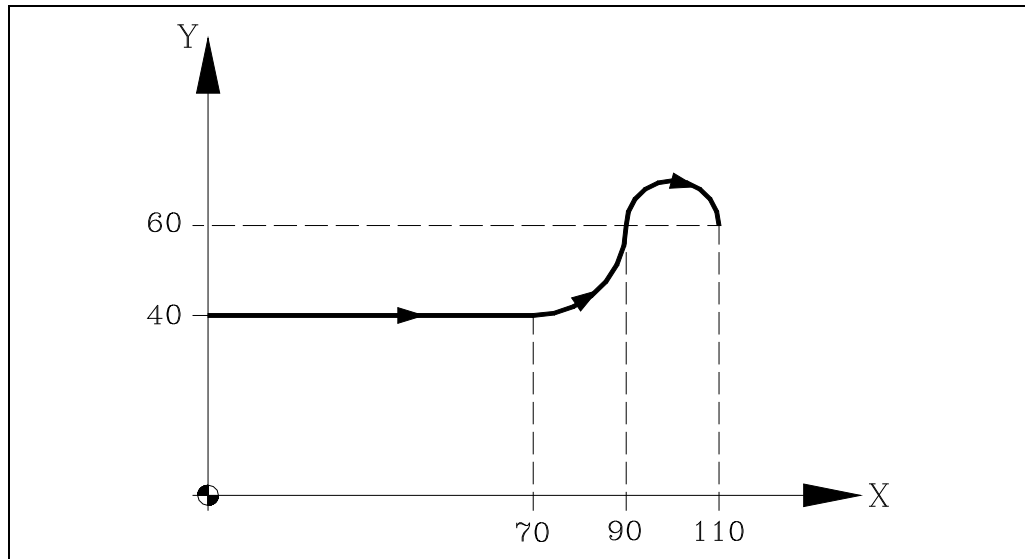

Supposing that the starting point is X0 Y40, you wish to program a straight line, then an arc tangential to the line and finally an arc tangential to the previous one.

```
G90 G01 X70
```

```
G08 X90 Y60 ; Arc tangent to previous path.
```

```
G08 X110 Y60 ; Arc tangent to previous path.
```

Function G08 is not modal, so it should always be programmed if you wish to execute an arc tangential to the previous path. Function G08 can be programmed as G8.

Function G08 enables the previous path to be a straight line or an arc and does not alter its history. The same function G01, G02 or G03 stays active after the block is finished.



When using function G08 it is not possible to execute a complete circle, as an infinite range of solutions exists. The CNC displays the corresponding error code.

6.6 Arc defined by three points (G09)

Through function G09 you can define an arc by programming the endpoint and an intermediate point (the starting point of the arc is the starting point of the movement). In other words, instead of programming the coordinates of the center, you program any intermediate point.

The endpoint of the arc is defined in Cartesian or polar coordinates, and the intermediate point is always defined in Cartesian coordinates by the letters I, J, or K, each one being associated to the axes as follows:

Axes X, U, A ==> I
 Axes Y, V, B ==> J
 Axes Z, W, C ==> K


In Cartesian coordinates:

G17 G09 X±5.5 Y±5.5 I±5.5 J±5.5

Polar coordinates:

G17 G09 R±5.5 Q±5.5 I±5.5 J±5.5

Example:

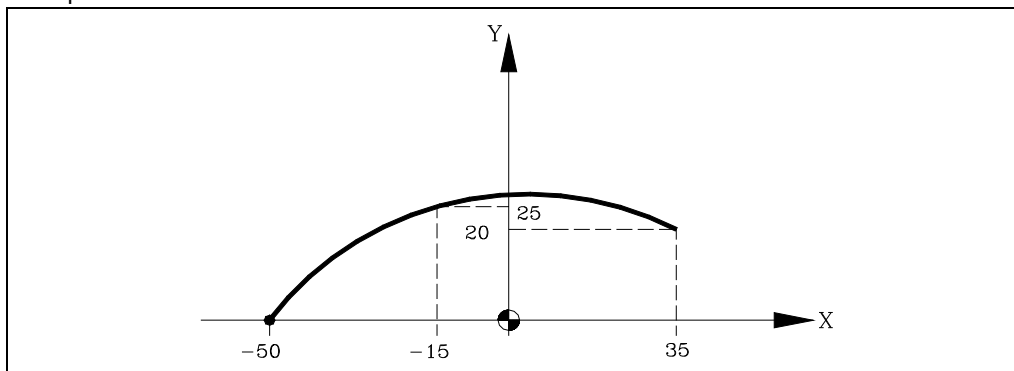

Being initial point X-50 Y0.

G09 X35 Y20 I-15 J25

Function G09 is not modal, so it should always be programmed if you wish to execute an arc defined by three points. Function G09 can be programmed as G9.

When G09 is programmed it is not necessary to program the direction of movement (G02 or G03).

Function G09 does not alter the history of the program. The same G01, G02 or G03 function stays active after finishing the block.



Function G09 may not be used to programmed a full circle because all three points must be different. The CNC displays the corresponding error code.

6.

PATH CONTROL
 Arc defined by three points (G09)




CNC 8035

·M· MODEL
 (SOFT V15.3x)

6.7 Helical interpolation

A helical interpolation consists in a circular interpolation in the work plane while moving the rest of the programmed axes.

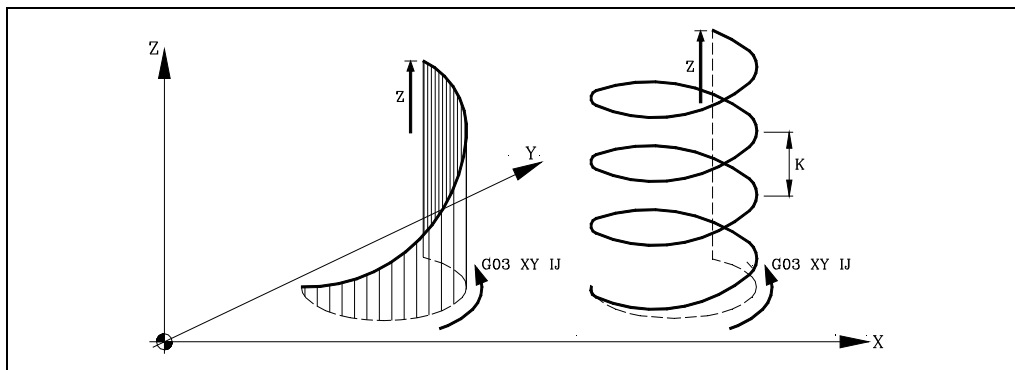

The helical interpolation is programmed in a block where the circular interpolation must be programmed by means of functions: G02, G03, G08 or G09.

```
G02 X Y I J Z
G02 X Y R Z A
G03 Q I J A B
G08 X Y Z
G09 X Y I J Z
```

If the helical interpolation is supposed to make more than one turn, the linear movement of another axis must also be programmed (one axis only).

On the other hand, the pitch along the linear axis must also be set (format 5.5) by means of the I, J and K letters. Each one of these letters is associated with the axes as follows:

```
Axes X, U, A    ==>    I
Axes Y, V, B    ==>    J
Axes Z, W, C    ==>    K
```

```
G02 X Y I J Z K
G02 X Y R Z K
G03 Q I J A I
G08 X Y B J
G09 X Y I J Z K
```

Example:

Programming a helical interpolation where the starting point is X0 Y0 Z0.

As the example shows, it is not necessary to program the last point (X, Y):

```
G03 I15 J0 Z18 K5
```

6.

PATH CONTROL
Helical interpolation




CNC 8035

-M- MODEL
(SOFT V15.3x)

6.8 Tangential entry at the beginning of a machining operation (G37)

Via function G37 you can tangentially link two paths without having to calculate the intersection points.


Function G37 is not modal, so it should always be programmed if you wish to start a machining operation with tangential entry:

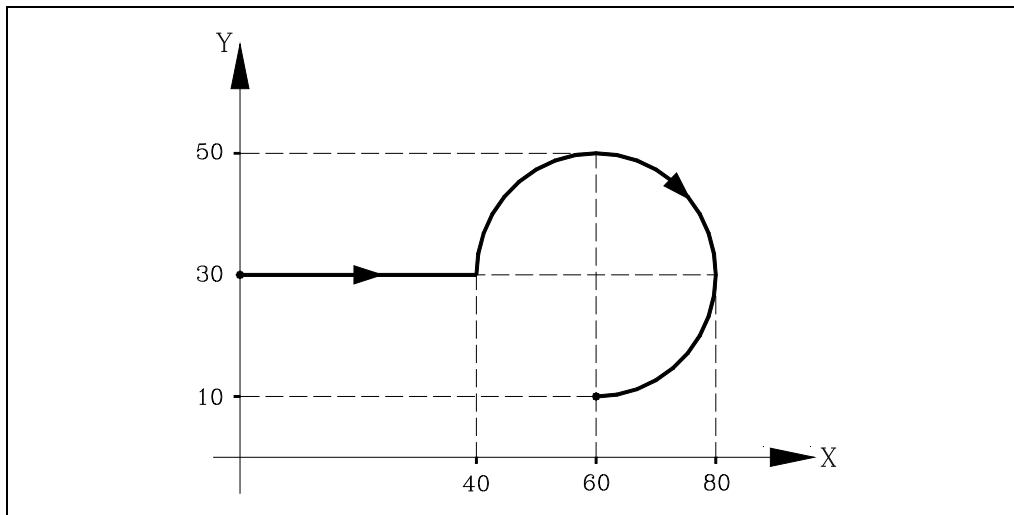

If the starting point is X0 Y30 and you wish to machine an arc (the path of approach being straight) you should program:

```
G90 G01 X40
G02 X60 Y10 I20 J0
```

If, however, in the same example you require the entrance of the tool to the part to be machined tangential to the path and describing a radius of 5 mm, you should program:

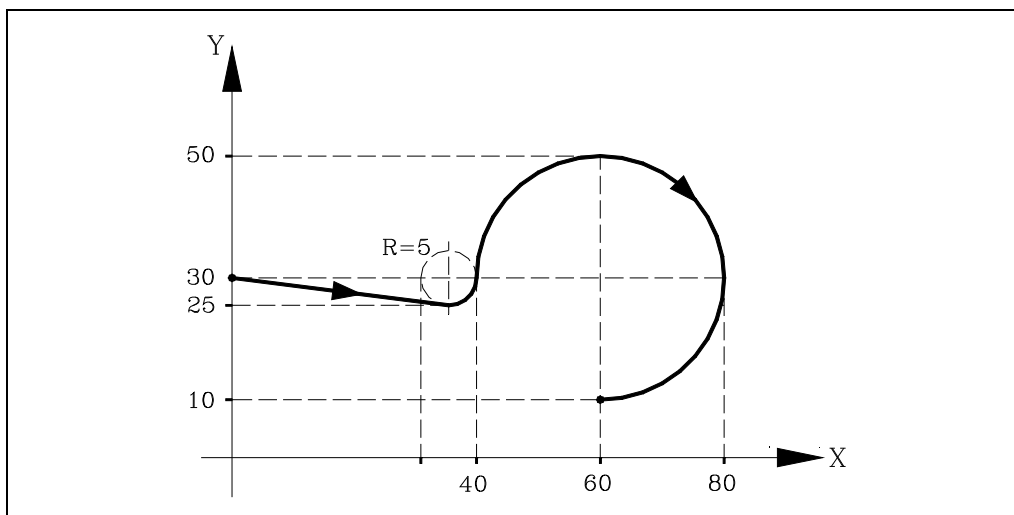

```
G90 G01 G37 R5 X40
G02 X60 Y10 I20 J0
```

As can be seen in the figure, the CNC modifies the path so that the tool starts to machine with a tangential entry to the part.

You have to program Function G37 plus value R in the block which includes the path you want to modify.

R5.5 should appear in all cases following G37, indicating the radius of the arc which the CNC enters to obtain tangential entry to the part. This R value must always be positive.

6.

PATH CONTROL

Tangential entry at the beginning of a machining operation (G37)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

Function G37 should only be programmed in the block which includes a straight-line movement (G00 or G01). If you program in a block which includes circular movement (G02 or G03), the CNC displays the corresponding error.

6.

PATH CONTROL

Tangential entry at the beginning of a machining operation (G37)



CNC 8035


·M· MODEL
(SOFT V15.3x)

6.9 Tangential exit at the end of a machining operator (G38)

Function G38 enables the ending of a machining operation with a tangential exit of the tool. The path should be in a straight line (G00 or G01). Otherwise, the CNC will display the corresponding error.

Function G38 is not modal, so it should be programmed whenever a tangential exit of the tool is required.

Value R 5.5 should always appear after G38. It also indicates the radius of the arc which the CNC applies to get a tangential exit from the part. This R value must always be positive.

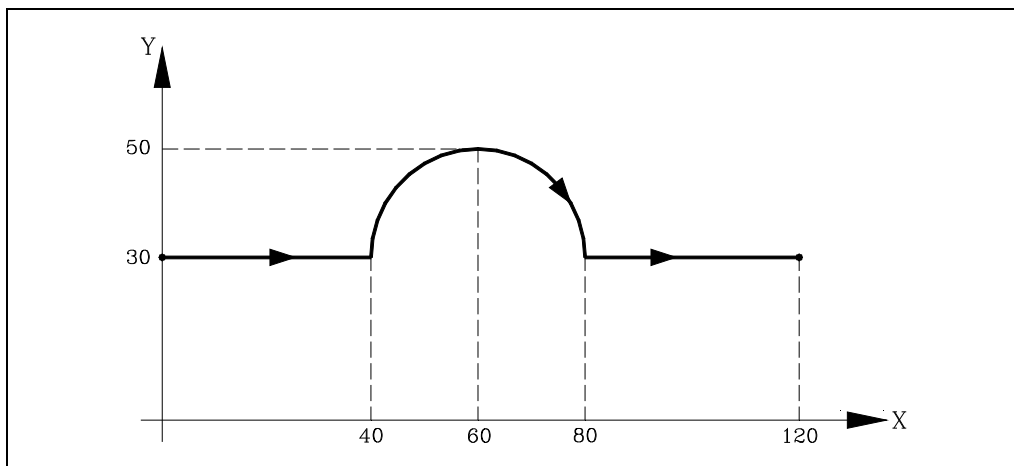


If the starting point is X0 Y30 and you wish to machine an arc (with the approach and exit paths in a straight line), you should program :

```
G90 G01 X40
G02 X80 I20 J0
G00 X120
```

If, however, in the same example you wish the exit from machining to be done tangentially and describing a radius of 5 mm, you should program :

```
G90 G01 X40
G02 G38 R5 X80 I20 J0
G00 X120
```

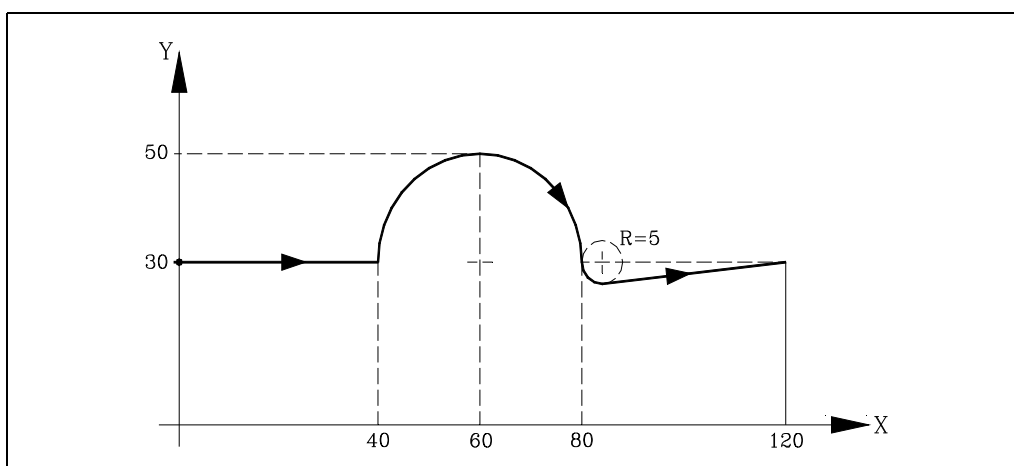

6.

PATH CONTROL
Tangential exit at the end of a machining operator (G38)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

6.10 Automatic radius blend (G36)

In milling operations, it is possible to round a corner via function G36 with a determined radius, without having to calculate the center nor the start and end points of the arc.


Function G36 is not modal, so it should be programmed whenever controlled corner rounding is required.

This function should be programmed in the block in which the movement the end you want to round is defined.

The R5.5 value should always follow G36. It also indicates the rounding radius which the CNC applies to get the required corner rounding. This R value must always be positive.

6.

PATH CONTROL
Automatic radius blend (G36)

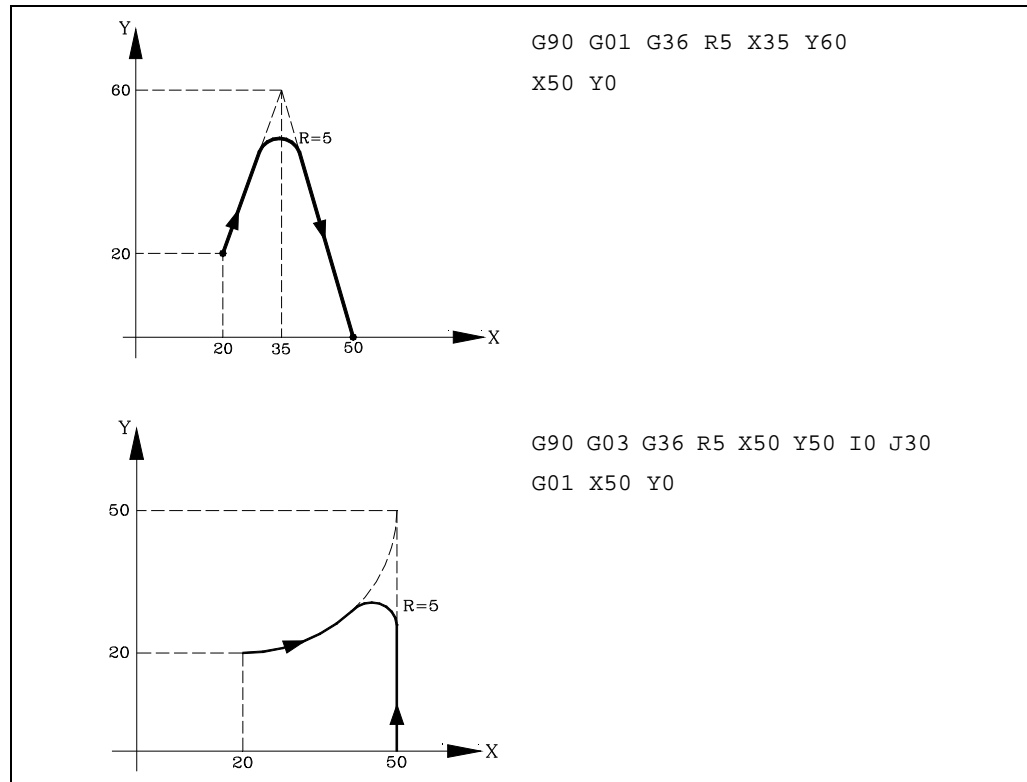

CNC 8035

·M· MODEL
(SOFT V15.3x)


6.11 Chamfer (G39)

In machining operations it is possible (using G39) to chamfer corners between two straight lines, without having to calculate intersection points.

Function G39 is not modal, so it should be programmed whenever the chamfering of a corner is required.

This function should be programmed in the block in which the movement whose end you want to chamfer is defined.

The R5.5 value should always follow G39. It also indicates the distance from the end of the programmed movement as far as the point where you wish to carry out the chamfering. This R value must always be positive.

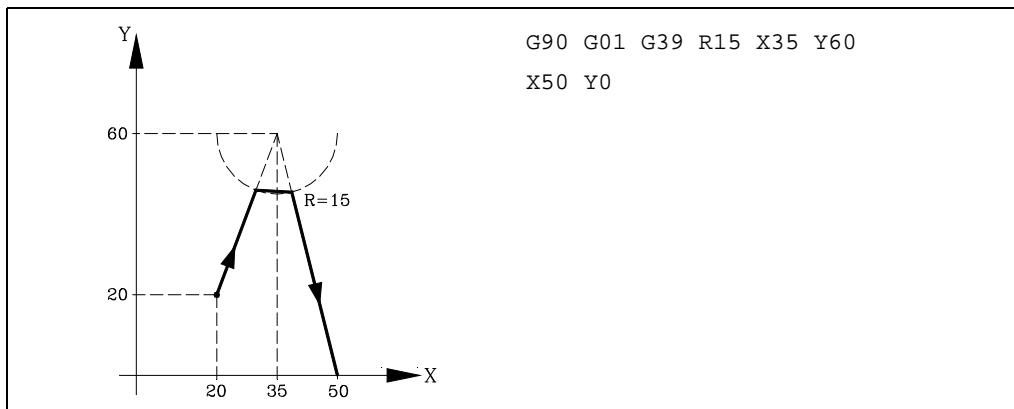

6.

PATH CONTROL
Chamfer (G39)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

6.12 Threading (G33)

If the machine spindle is equipped with a rotary encoder, you can thread with a tool tip via function G33.

Although this threading is often done along the entire length of an axis, the CNC enables threading to be done interpolating more than one axis at a time.

Programming format:

```
G33 X.....C L Q
```

X...C ±5.5 End point of the thread

L 5.5 Thread pitch

Q ±3.5 Optional. It indicates the spindle angular position (± 359.9999) of the thread's starting point. If not programmed, a value of "0" is assumed.

Considerations

Whenever G33 is executed, if s.m.p. M19TYPE (P43) =0, and before making the thread, the CNC references the spindle (home search).

Spindle machine parameter M19TYPE (P43) must be set to "1" in order to be able to program parameter Q (angular spindle position).

When executing function G33 Q (s.m.p. M19TYPE (P43) =1), spindle had to be homed after the last power-up and before executing the thread.

When executing function G33 Q (s.m.p. M19TYPE (P43) =1) and s.m.p. DECINPUT (P31) =NO, no home search is needed because the spindle will be homed automatically after power-up when turning the spindle in M3 or in M4 for the first time.

This search will be carried out at the feedrate set by s.m.p. REFEED2 (P35). After finding home, the spindle will speed up or slow down to the programmed speed without stopping.

If the spindle has motor feedback with a SINCOS encoder (without reference mark), the home search will be done directly at the programmed S speed without going through the speed set by s.m.p. REFEED2.

If after power-up, an M19 is executed before an M3 or M4, that M19 will be executed without homing the spindle when executing the first M3 or M4.

If the feedback device does not have the reference mark synchronized, the home search in M3 might not coincide with the home search in M4. This does not happen with FAGOR feedback.

If the threads are blended together in round corner, only the first one can have an entry angle (Q).

While function G33 is active, neither the programmed feedrate "F" nor the programmed Spindle speed "S" can be varied. They will both be set to 100%.

Function G33 is modal and incompatible with G00, G01, G02, G03, G34 and G75.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G00 or G01, depending on how general machine parameter "IMOVE" has been set.

6.

PATH CONTROL
Threading (G33)




CNC 8035


·M· MODEL
(SOFT V15.3x)

Example

We would like to make a thread in a single pass in X0 Y0 Z0, with a depth of 100 mm and a pitch of 5 mm using a threadcutting tool located in Z10.

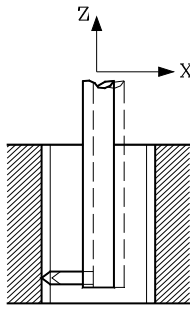

G90 G0 X Y Z	; Positioning
G33 Z -100 L5	; Threading
M19	; Spindle orientation
G00 X3	; Cutter withdrawal
Z30	; Withdrawal (exit the hole)

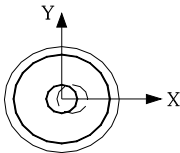

6.

PATH CONTROL
Threading (G33)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

6.13 Variable pitch threads (G34)

To make variable-pitch threads, the spindle of the machine must have a rotary encoder.

Although this threading is often done along the entire length of an axis, the CNC enables threading to be done interpolating more than one axis at a time.

Programming format:

```
G34 X . . . . . C L Q K
```

X...C ±5.5 End point of the thread.

L 5.5 Thread pitch.

Q ±3.5 Optional. It indicates the spindle angular position (±359.9999) of the thread's starting point. If not programmed, a value of 0 is assumed.

K ±5.5 Thread pitch increase or decrease per spindle turn.

Considerations

Whenever G34 is executed and before making the thread, the CNC references the spindle (home search) and positions the spindle at the angular position indicated by parameter Q.

Parameter "Q" is available when spindle machine parameter "M19TYPE" has been set to "1".

When working in round corner mode (G05), it is possible to blend different threads in the same part.

While function G34 is active, neither the programmed feedrate "F" nor the programmed Spindle speed "S" can be varied. They will both be set to 100%.

Function G34 is modal and incompatible with G00, G01, G02, G03, G33 and G75.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G00 or G01, depending on how general machine parameter "IMOVE" has been set.

Blending a fixed-pitch thread (G33) with a variable-pitch thread (G34).

The starting thread pitch (L) of the G34 must coincide with the thread pitch of the G33.

The pitch increase in the first turn of the spindle in variable pitch will be half and increment (K/2) and in the rest of the turns it will be the full increment K.

Blending a variable-pitch thread (G34) with a fixed-pitch thread.

It is used to finish a variable-pitch thread (G34) with a portion of the thread keeping the final pitch of the previous thread.

Since it is very complicated to calculate the final thread pitch, the fixed-pitch thread is not programmed with G33 but with G34 ... L0 K0. The CNC calculates the pitch.

Blending two variable-pitch threads (G34).

Two variable-pitch threads (G34) cannot be blended together.

6.

PATH CONTROL
Variable pitch threads (G34)



CNC 8035

·M· MODEL
(SOFT V15.3x)

6.14 Move to hardstop (G52)

By means of function G52 it is possible to program the movement of an axis until running into an object. This feature may be interesting for forming machines, live tailstocks, bar feeders, etc.

The programming format is:

```
G52 X. .C ±5.5
```

After G52, program the desired axis as well as the target coordinate of the move.

The axis will move towards the programmed target coordinate until running into something. If the axis reaches the programmed target coordinate without running into the hardstop it will stop.

Function G52 is not modal; therefore, it must be programmed every time this operation is to be carried out.

Also, it assumes functions G01 and G40 modifying the program history. It is incompatible with functions G00, G02, G03, G33, G34, G41, G42, G75 and G76.

6.**PATH CONTROL**
Move to hardstop (G52)**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

6.15 Feedrate "F" as an inverted function of time (G32)

There are instances when it is easier to define the time required by the various axes of the machine to reach the target point instead of defining a common feedrate for all of them.

A typical case may be when a linear axis (X, Y, Z) has to move together (interpolated) with a rotary axis programmed in degrees.

Function G32 indicates that the "F" functions programmed next set the time it takes to reach the target point.

In order for a greater value of "F" to indicate a greater feedrate, the value assigned to "F" is defined as "Inverted function of time" and it is assumed as the activation of this feature.

"F" units: 1/min

Example: G32 X22 F4

indicates that the movement must be executed in 1/4 minute; i.e. in 0.25 minutes.

Function G32 is modal and incompatible with G94 and G95.

On power-up, after executing M02, M30 or after an Emergency or Reset, the CNC assumes G94 or G95 depending on the setting of general machine parameter "IFFED".

Considerations

The CNC variable PROGFIN will show the feedrate programmed as an inverted function of time and variable FEED will show the resulting feedrate in mm/min or inches/min.

If the resulting feedrate of any axis exceeds the maximum value set by machine parameter "MAXFEED", the CNC will apply this maximum value.

The programmed "F" is ignored on G00 movements. All the movements will be carried out at the feedrate set by axis machine parameter "G00FEED".

When programming "F0" the movement will be carried out at the feedrate set by axis machine parameter "MAXFEED".

Function G32 may be programmed and executed in the PLC channel.

Function G32 is canceled in JOG mode.

6.

PATH CONTROL
Feedrate "F" as an inverted function of time (G32)



CNC 8035

·M· MODEL
(SOFT V15.3x)

ADDITIONAL PREPARATORY FUNCTIONS

7

7.1 Interruption of block preparation (G04)

The CNC reads up to 20 blocks ahead of the one it is executing, with the aim of calculating beforehand the path to be followed.

Each block is evaluated (in its absence) at the time it is read, but if you wish to evaluate it at the time of execution of the block you use function G04.

This function holds up the preparation of blocks and waits for the block in question to be executed in order to start the preparation of blocks once more.

A case in point is the evaluation of the "status of block-skip inputs" which is defined in the block header.

Example:

```
.  
.   
      G04           ; Interrupts block preparation  
/1 G01 X10 Y20 ; block-skip condition "/1"  
.   
.
```

Function G04 is not modal, so it should be programmed whenever you wish to interrupt block preparation.

It should be programmed on its own and in the block previous to the one in which the evaluation in execution is required. Function G04 can be programmed as G4.

Every time G04 is programmed, active radius and length compensation are cancelled.

For this reason, care needs to be taken when using this function, because if it is introduced between machining blocks which work with compensation, unwanted profiles may be produced.


Example: The following program blocks are performed in a section with G41 compensation.

```

...
N10 X50 Y80
N15 G04
/1 N17 M10
N20 X50 Y50
N30 X80 Y50
...


```

Block N15 interrupts block preparation and the execution of block N10 will finish at point A.

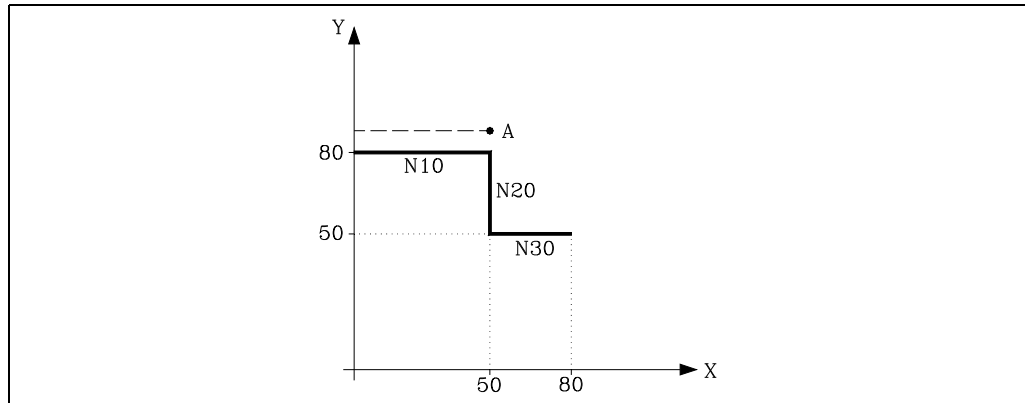

Once the execution of block N15 has been carried out, the CNC continues preparing blocks starting from block N17.

As the next point corresponding to the compensated path is point "B", the CNC will move the tool to this point, executing path "A-B".

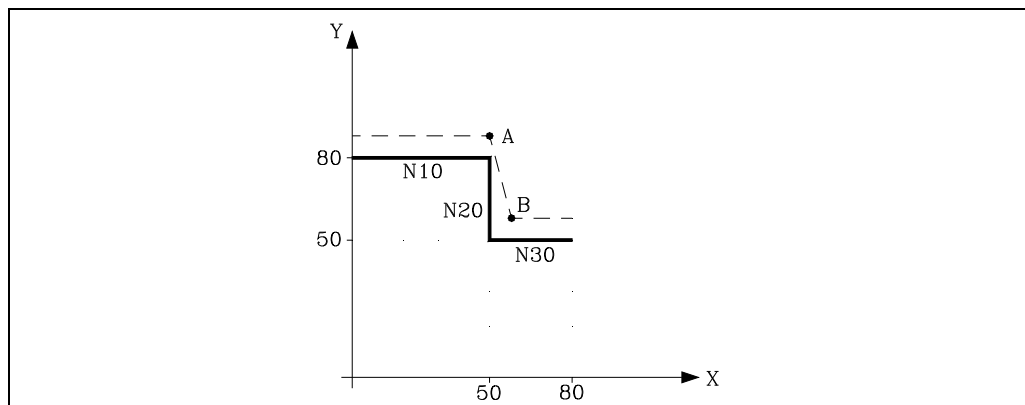

As you can see, the resulting path is not the required one, so we recommend avoiding the use of function G04 in sections which work with compensation.

7.

ADDITIONAL PREPARATORY FUNCTIONS
Interruption of block preparation (G04)



CNC 8035

-M- MODEL
(SOFT V15.3x)

7.1.1 G04 K0: Block preparation interruption and coordinate update

The function associated with G04 K0 may be used to update the coordinates of the axes of the channel after finishing particular PLC routines.

The PLC routines that require updating the coordinates of the axes of the channel are the following:

- PLC routine using the SWITCH* marks.
- PLC routines where an axis goes into DRO mode and then back into normal axis mode during the execution of part programs.

G04 operation:

Function	Description
G04	Interrupts block preparation.
G04 K50	It executes a dwell 50 hundredths of a second.
G04 K0 or G04 K	It interrupts block preparation and updates the CNC coordinates to the current position. (G4 K0 works in the CNC and PLC channel).

7.

ADDITIONAL PREPARATORY FUNCTIONS

Interruption of block preparation (G04)



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.2 Dwell (G04 K)

A dwell can be programmed via function G04 K.

The dwell value is programmed in hundredths of a second via format K5 (1..99999).

Example:

```
G04 K50 ; Dwell of 50 hundredths of a second (0.5 seconds)
```

```
G04 K200 ; Dwell of 200 hundredths of a second (2 seconds)
```

Function G04 K is not modal, so it should be programmed whenever a dwell is required. Function G04 K can be programmed as G4 K.

The dwell is executed at the beginning of the block in which it is programmed.

Note: When programming G04 K0 or G04 K, instead of applying a delay, it only interrupts block preparation and it will refresh the coordinates. See ["7.1.1 G04 K0: Block preparation interruption and coordinate update"](#) on page 113.

7.

ADDITIONAL PREPARATORY FUNCTIONS
Dwell (G04 K)



CNC 8035


·M· MODEL
(SOFT V15.3x)

7.3 Working with square (G07) and round (G05,G50) corners

7.3.1 G07 (square corner)

When working in G07 (square corner) the CNC does not start executing the following program block until the position programmed in the current block has been reached.

The CNC considers that the programmed position has been reached when the axis is within the "INPOSW" (in-position zone or dead band) from the programmed position.

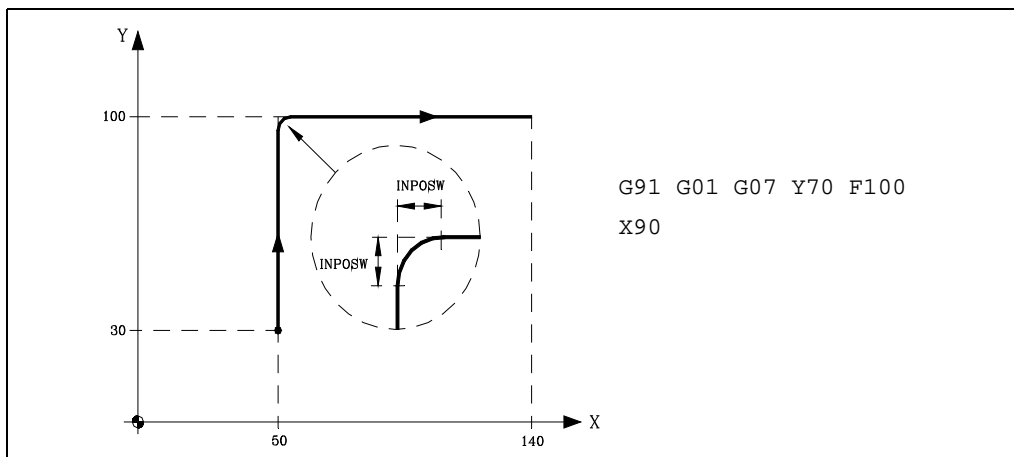

The theoretical and real profile coincide, obtaining square corners, as seen in the figure.

Function G07 is modal and incompatible with G05, G50 and G51. Function G07 can be programmed as G7.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G05 or G07 depending on how the general machine parameter "ICORNER" is set.

7.

ADDITIONAL PREPARATORY FUNCTIONS

Working with square (G07) and round (G05,G50) corners

FAGOR 


CNC 8035

·M· MODEL
(SOFT V15.3x)

7.3.2 G05 (round corner)

When working in G05 (round corner), the CNC starts executing the following block of the program as soon as the theoretical interpolation of the current block has concluded. It does not wait for the axes to physically reach the programmed position.

The distance prior to the programmed position where the CNC starts executing the next block depends on the actual axis feedrate.

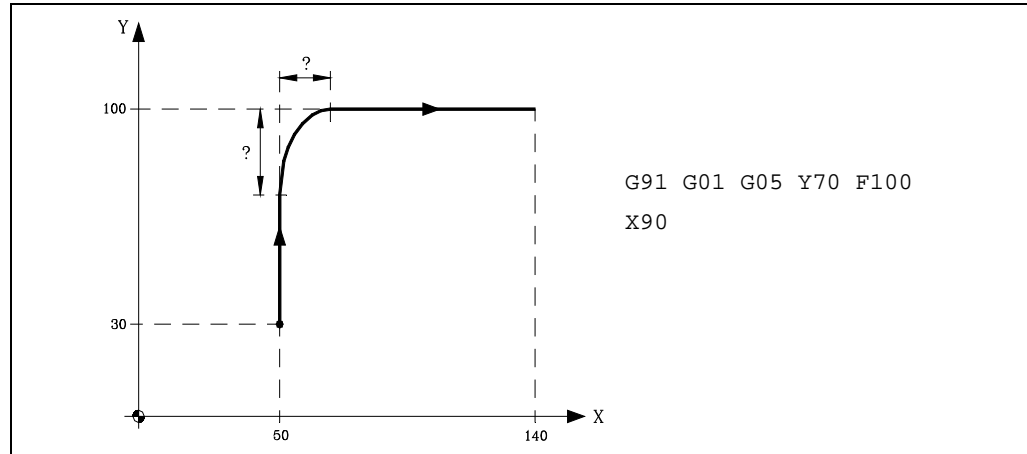

Via this function round corners can be obtained, as shown in the figure.

The difference between the theoretical and real profiles depends on the programmed feedrate value "F". The higher the feedrate, the greater the difference between both profiles.

Function G05 is modal and incompatible with G07, G50 and G51. Function G05 can be programmed as G5.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G05 or G07 depending on how the general machine parameter "ICORNER" is set.

7.

ADDITIONAL PREPARATORY FUNCTIONS
 Working with square (G07) and round (G05,G50) corners




CNC 8035

·M· MODEL
(SOFT V15.3x)

7.3.3 Controlled round corner (G50)

When working in G50 (controlled round corner); once the theoretical interpolation of the current block has concluded, the CNC waits for the axis to enter the area defined by machine parameter "INPOSW2" and it then starts executing the following block of the program.

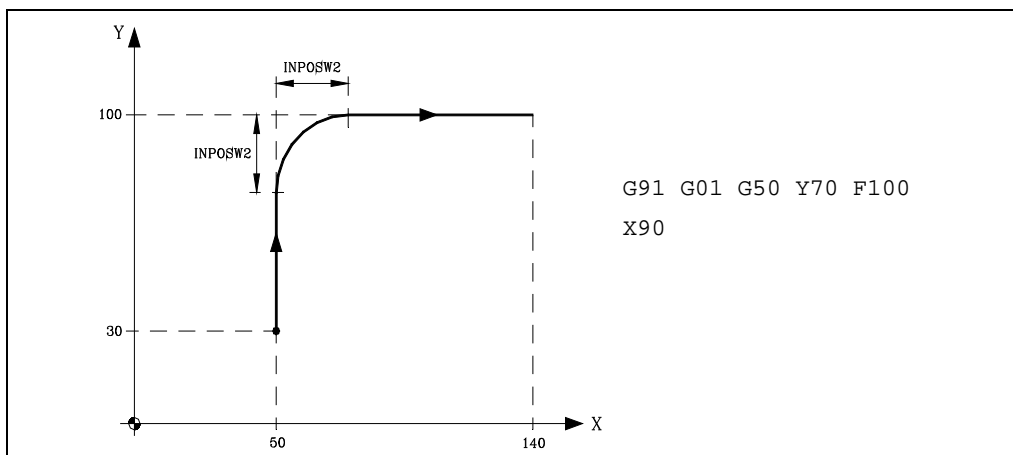

Function G50 assures that the difference between the theoretical and actual paths stays smaller than what was set by machine parameter "INPOSW2".

On the other hand, when working in G05, the difference between the theoretical and real profiles depends on the programmed feedrate value "F". The higher the feedrate, the greater the difference between both profiles.

Function G50 is modal and incompatible with G07, G05 and G51.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G05 or G07 depending on how the general machine parameter "ICORNER" is set.

7.

ADDITIONAL PREPARATORY FUNCTIONS
Working with square (G07) and round (G05,G50) corners



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.4 Look-ahead (G51)

Programs consisting of very small movement blocks (CAM, etc.) tend to run very slowly. With look-ahead, high speed machining is possible for this type of programs.

The look-ahead function analyzes in advance the path to be machined (up to 75 blocks) in order to calculate the maximum feedrate for each section of the path. This function provides smoother and faster machining in programs with very small movements, even in the order of microns.

It is recommended to have the CPU-TURBO option when using the look-ahead function.


When operating with "Look-Ahead", it is a good idea to adjust the axes so their following error (lag) is as small as possible because the contouring error will be at least equal to the minimum following error.

Programming format.

The programming format is:

G51 [A] E B

- A (0-255) Is optional and it defines the percentage of acceleration to be applied.
When not programmed or programmed with a "0" value, the CNC assumes the acceleration value set by machine parameter for each axis.
- E (5.5) Maximum contouring error.
The lower this parameter value is, the lower the machining feedrate will be.
- B (0-180) It makes it possible to machine square corners using the Look-ahead function.
It indicates the angular value (in degrees) of the programmed corners, below which, the machining operation will be carried out in square corner mode.

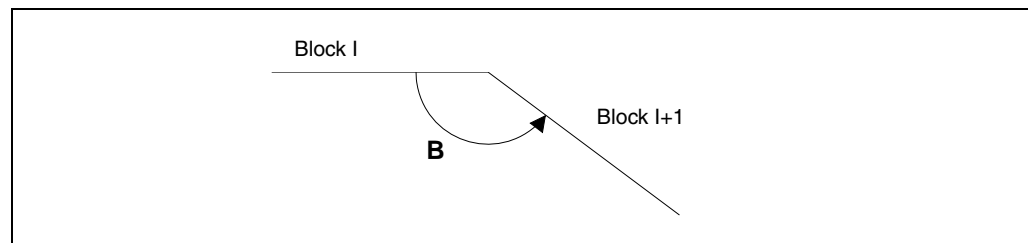

Parameter "A" permits using a standard working acceleration and another one to be used when executing with Look-Ahead.

If parameter "B" is not programmed, the square corner management at the corners is canceled.

The square-corner management at the corners is valid for the look-ahead algorithm with jerk management and for the look-ahead algorithm without jerk management.

Considerations for the execution.

When calculating the feedrate, the CNC takes the following into account:

- The programmed feedrate.
- The curvature and the corners.
- The maximum feedrate of the axes.
- The maximum accelerations.
- The jerk.

If any of the circumstances listed below occurs while executing with Look-Ahead, the CNC slows down to "0" at the previous block and it recovers the machining conditions for Look-Ahead in the next motion block.

- Motionless block.
- Execution of auxiliary functions (M, S, T).
- Single block execution mode.
- MDI mode.
- Tool inspection mode.

If a Cycle Stop, Feed-Hold, etc. occurs while executing in Look-Ahead mode, the machine may not stop at the current block, several additional blocks will be necessary to stop with the permitted deceleration.

To prevent motionless blocks from causing a square-corner effect, change bit 0 of general machine parameter MANTFCON (P189).

Function properties.

Function G51 is modal and incompatible with G05, G07 and G50. Should any of them be programmed, function G51 will be canceled and the new one will be selected.

Function G51 must be programmed alone in a block and there must be no more information in that block.

On power-up, after executing an M02, M30, or after an EMERGENCY or RESET, the CNC will cancel G51, if it was active, and it will assume G05 or G07 according to the setting of general machine parameter "ICORNER".

On the other hand, the CNC will issue Error 7 (Incompatible G functions) when programming any of the following functions while G51 is active:

G33	Electronic threading (G33)
G34	Variable-pitch threading.
G52	Move to hardstop.
G95	Feedrate per revolution.

7.

ADDITIONAL PREPARATORY FUNCTIONS

Look-ahead (G51)



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.4.1 Advanced look-ahead algorithm (integrating Fagor filters)

This mode is indicated when machining accuracy is required, especially if Fagor filters have been set for the axes by machine parameters.

The advanced look-ahead algorithm calculates the feedrates at the corners so as to take the effect of those filters into consideration. When programming G51 E, the contouring errors when machining corners will be closer to the value programmed in that G51 function depending on the filters.

To activate the advanced look-ahead algorithm, use bit 15 of g.m.p. LOOKATYP (P160).

Considerations

- If there are no Fagor filters set by machine parameters in the axes of the main channel, activating the advanced look-ahead algorithm will internally activate FIR filters of the 5th order and a frequency of 30 Hz in all the axes of the channel.
- If there are Fagor filters set by machine parameters, activating the advanced look-ahead algorithm will keep the values of those filters as long as their frequency is not higher than 30Hz. If their frequency is higher than 30 Hz, it will assume the values of 5th order and a frequency of 30 Hz.

If there are several filters defined in the axes of the channel, the one with the lowest frequency will be assumed as long as it is not higher than 30Hz.
- Even if the advanced look-ahead algorithm (using Fagor filters) is active with bit 15 of g.m.p. LOOKATYP (P160), it will not start working in the following cases:
 - If g.m.p. IPOTIME (P73) = 1.
 - If a.m.p. SMOTIME (P58) of any of the axes of the main channel is other than 0.
 - If any of the axes of the main channel has defined by parameter a non-Fagor type filter, a.m.p. TYPE (P71) is other than 2.

In these cases, when activating G51, the CNC will issue the corresponding error message.

7.

ADDITIONAL PREPARATORY FUNCTIONS
 Look-ahead (G51)



CNC 8035

·M· MODEL
(SOFT V15.3x)


7.4.2 Look-ahead operation with Fagor filters active

This option makes it possible to use Fagor filters with Look-ahead (not advanced look-ahead algorithm). It will only be considered if the advanced look-ahead algorithm is deactivated; that is, if bit 15 of g.m.p. LOOKATYP (P160) = 0.

To activate/deactivate this option, use bit 13 of g.m.p. LOOKATYP (P160).

Effect of Fagor filters when machining circles

When machining circles, the error will be smaller when using Fagor filters than without using these filters:

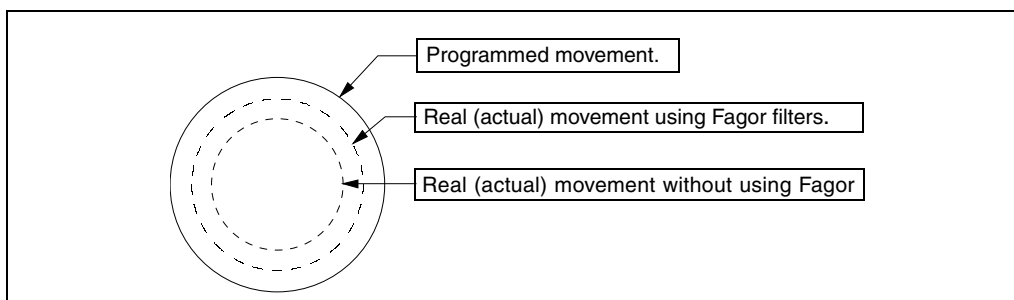

7.

ADDITIONAL PREPARATORY FUNCTIONS

Look-ahead (G51)

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

7.4.3 Smoother machining feedrate

Depending on the CNC processing power (that depends on the model and its parameter settings), and depending on the type of part being executed, it activates the management of the smoothing of the F (machining feedrate) to keep it stable. This helps achieve smoother machining in programs that demand high calculating power (programs with very small blocks and high programmed feedrate)

This option is valid for any look-ahead algorithm. Use bit 14 of general machine parameter LOOKATYP (P160) to activate it.



If this option is activated with look-ahead algorithm with jerk management (bit 0 of g.m.p. LOOKATYP (P160)=1), it is not necessary to set general machine parameter TLOOK (P161).

7.**ADDITIONAL PREPARATORY FUNCTIONS**

Look-ahead (G51)

**CNC 8035**-M- MODEL
(SOFT V15.3x)

7.5 Mirror image (G10, G11, G12, G13, G14)

The functions to activate the mirror image are the following.


- G10: Cancel mirror image.
- G11: Mirror image on X axis.
- G12: Mirror image on Y axis.
- G13: Mirror image on Z axis.
- G14: Mirror image on any axis (X..C), or in several at the same time.

Examples:

G14 W

G14 X Z A B

When the CNC works with mirror images, it executes the movements programmed in the axes that have mirror image selected, with the sign changed.

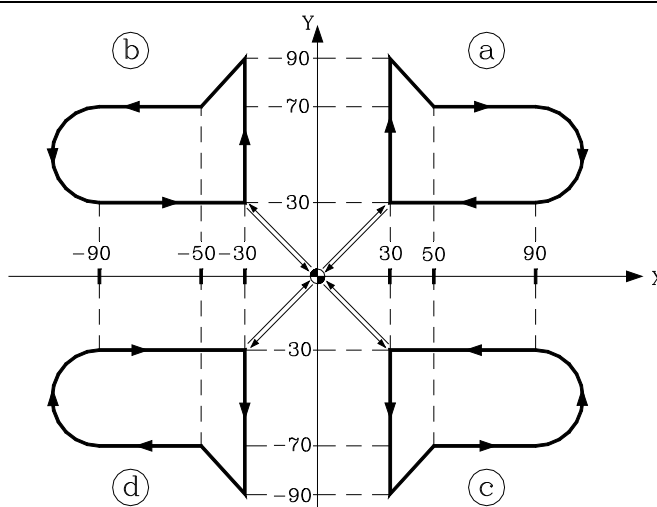

The following subroutine defines the machining of part "a".

```
G91 G01 X30 Y30 F100
Y60
X20 Y-20
X40
G02 X0 Y-40 I0 J-20
G01 X-60
X-30 Y-30
```

The programming of all parts would be :

```
Execution of subroutine ; machines "a"
G11 ; Mirror image on X axis.
Execution of subroutine ; machines "b"
G10 G12 ; Mirror image on Y axis.
Execution of subroutine ; machines "c"
G11 ; Mirror image on X and Y axes.
Execution of subroutine ; Machines "d"
M30 ; End of program
```

7.

ADDITIONAL PREPARATORY FUNCTIONS
Mirror image (G10, G11, G12, G13, G14)

FAGOR 

CNC 8035

-M- MODEL
(SOFT V15.3x)

Functions G11, G12, G13, and G14 are modal and incompatible with G10.

G11, G12, and G13 can be programmed in the same block, because they are not incompatible with each other. Function G14 must be programmed alone in the block.

If function G73 (pattern rotation) is also active in a mirror image program, the CNC first applies the mirror image function and then the pattern rotation.

If while one of the mirror imaging functions (G11, G12, G13, and G14) is active, a new coordinate origin (part zero) is preset with G92, this new origin will not be affected by the mirror imaging function.

On power-up, after executing M02, M30 or after EMERGENCY or RESET, the CNC assumes code G10.

7.

ADDITIONAL PREPARATORY FUNCTIONS

Mirror image (G10, G11, G12, G13, G14)



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.6 Scaling factor (G72)

By using function G72 you can enlarge or reduce programmed parts.

In this way, you can produce families of parts which are similar in shape but of different sizes with a single program.

Function G72 should be programmed on its own in a block. There are two formats for programming G72 :

- Scaling factor applied to all axes.
- Scaling factor applied to one or more axes.

7.**ADDITIONAL PREPARATORY FUNCTIONS**
Scaling factor (G72)**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

7.6.1 Scaling factor applied to all axes.

The programming format is:

G72 S5.5

Following G72 all coordinates programmed are multiplied by the value of the scaling factor defined by S until a new G72 scaling factor definition is read or the definition is cancelled.

7.

ADDITIONAL PREPARATORY FUNCTIONS
Scaling factor (G72)

Programming example (starting point X-30 Y10)

The following subroutine defines the machining of the part.

```
G90 X-19 Y0
G01 X0 Y10 F150
G02 X0 Y-10 I0 J-10
G01 X-19 Y0
```

The programming of the parts would be :

Execution of subroutine Machines "a".

```
G92 X-79 Y-30 ; Coordinate preset
                (zero offset)

G72 S2 ; Applies a scaling factor of 2
```

Execution of subroutine Machines "b".


```
G72 S1 ; Cancel the scaling factor
M30 ; End of program
```



CNC 8035

·M· MODEL
(SOFT V15.3x)

Examples of application of the scaling factor.

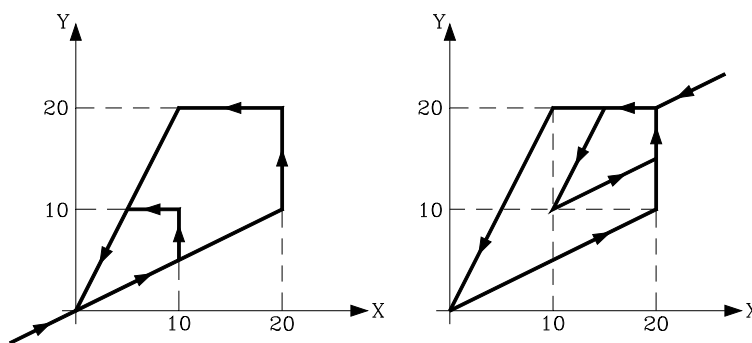

```
G90 G00 X0 Y0
N10 G91 G01 X20 Y10
Y10 X-10
X-10 X20
N20 X-10 Y-20

; Scaling factor
G72 S0.5

; Repeats from block 10 to block 20
(RPT N10,20)
M30
```

```
G90 G00 X20 Y20
N10 G91 G01 X-10
Y -20
Y10
N20 Y10

; Scaling factor
G72 S0.5

; Repeats from block 10 to block 20
(RPT N10,20)
M30
```

Function G72 is modal and is cancelled when another scaling factor with a value of S1 is programmed, or on power-up, after executing M02, M30 or after EMERGENCY or RESET.

7.

ADDITIONAL PREPARATORY FUNCTIONS
Scaling factor (G72)



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.6.2 Scaling factor applied to one or more axes.

The programming format is:

```
G72 X...C 5.5
```

After G72 the axis or axes and the required scaling factor are programmed.

All blocks programmed after G72 are treated by the CNC as follows :

1. The CNC calculates the movement of all the axes in relation to the programmed path and compensation.
2. It then applies the scaling factor indicated to the calculated movement of the corresponding axis or axes.

If the scaling factor is applied on one or more axes, the CNC will apply the scaling factor indicated both to the movement of the corresponding axis or axes and to their feedrate.


If, within the same program, both scaling factor types are applied, the one applied to all the axes and the one for one or several axes, the CNC applies a scaling factor equal to the product of the two scaling factors programmed for this axis to the axis or axes affected by both types.

Function G72 is modal and will be cancelled when the CNC is turned on, after executing M02, M30 or after an EMERGENCY or RESET.




This type of scaling factor is ignored when simulating without moving the axes.

Application of the scaling factor to a plane axis, working with tool radius compensation.

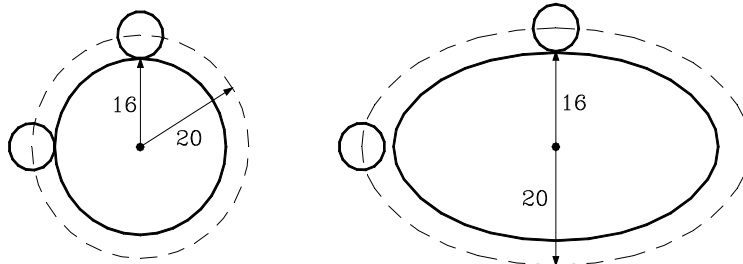

As it can be observed, the tool path does not coincide with the required path, as the scaling factor is applied to the calculated movement.

If a scaling factor equal to $360/2\pi R$ is applied to a rotary axis, R being the radius of the cylinder on which you wish to machine, this axis can be considered linear, and any figure with tool radius compensation can be programmed on the cylindrical surface.

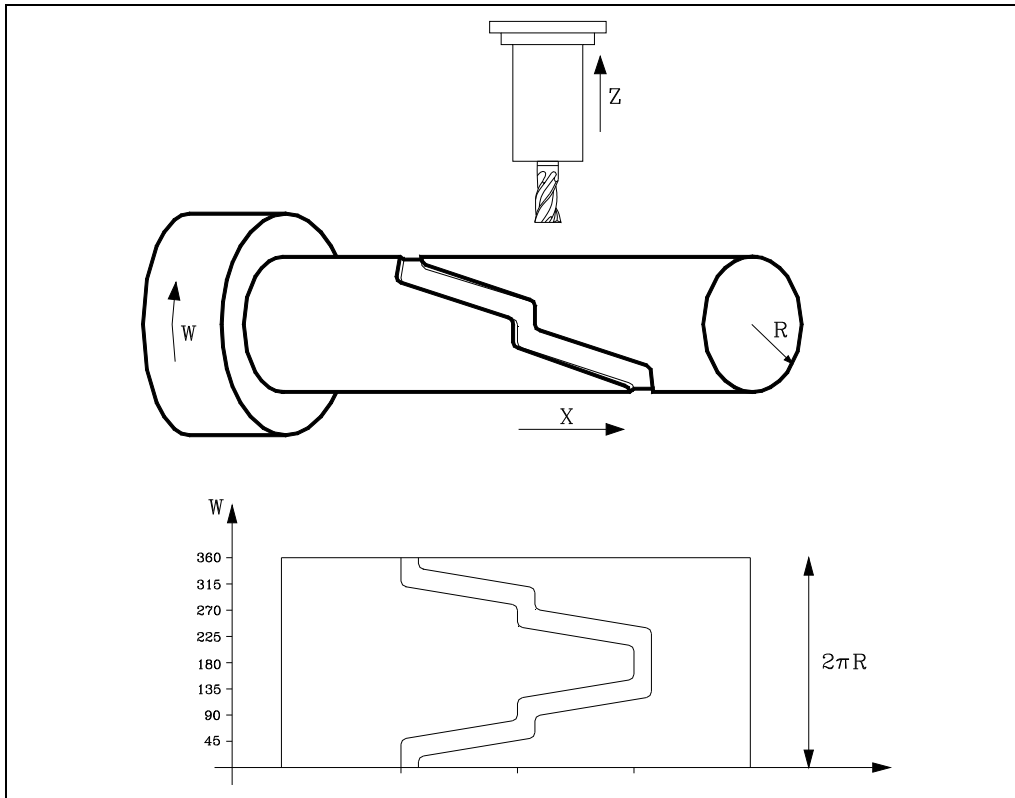

7.

ADDITIONAL PREPARATORY FUNCTIONS Scaling factor (G72)



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.7 Pattern rotation (G73)

Function G73 enables you to turn the system of coordinates, taking either the coordinates origin or the programmed rotation center as the active rotation center.


The format which defines the rotation is the following :

G73 Q+/-5.5 I±5.5 J±5.5


Where:

- Q: Indicates the rotation angle in degrees.
- I, J: They are optional and define the abscissa and ordinate respectively of the rotation center. If they are not defined, the coordinate origin will be taken as the rotation center.

The "I" and "J" values are defined in absolute coordinates and referred to the coordinate origin of the work plane. These coordinates are affected by the active scaling factor and mirror images.

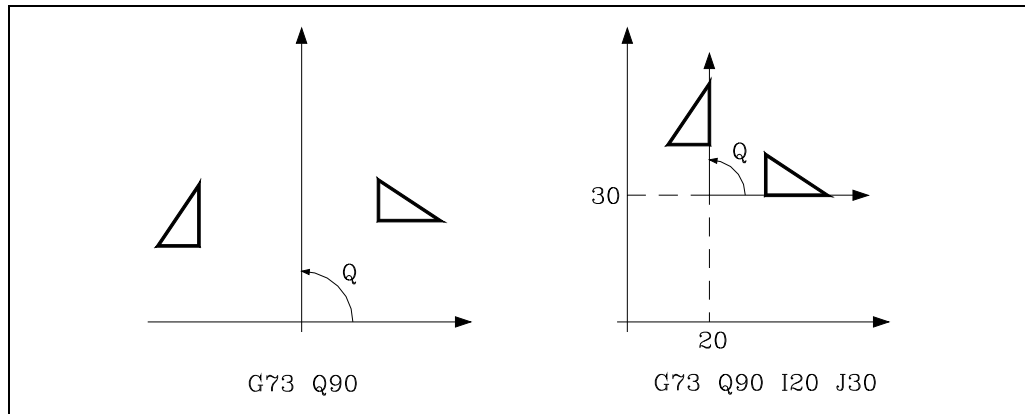


You should remember that G73 is incremental i.e. the different Q values programmed add up.

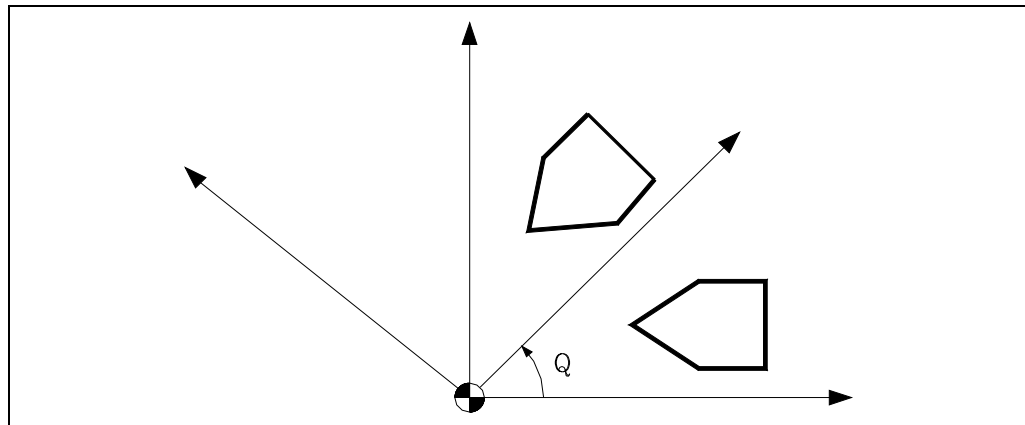

Function G73 should be programmed on its own in a block.

Assuming that the starting point is X0 Y0, you get :

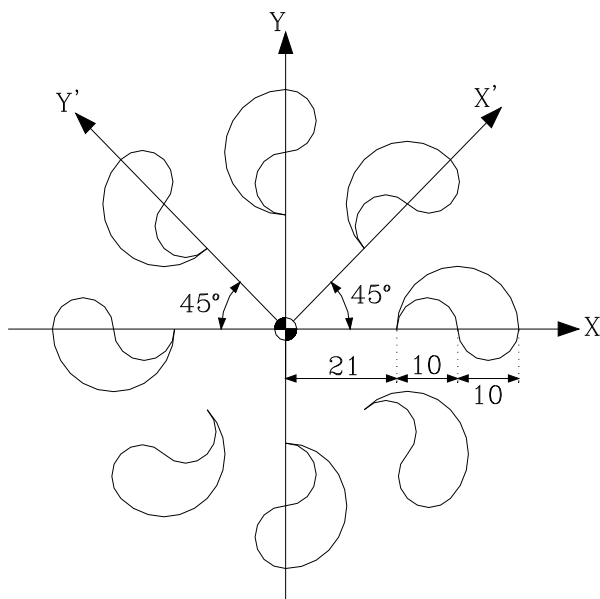

```

N10 G01 X21 Y0 F300 ; Positioning at starting point
G02 Q0 I5 J0
G03 Q0 I5 J0
Q180 I-10 J0
N20 G73 Q45 ; Coordinate (pattern) rotation
(RPT N10, N20) N7 ; Repeat from block 10 to 20 seven times
M30 ; End of program
    
```

In a program which rotates the coordinate system, if any mirror image function is also active the CNC first applies the mirror image function and then the turn.

The pattern rotation function can be cancelled either by programming G72 (on its own, without angle value) or via G16, G17, G18, or G19, or on power-up, after executing M02, M30 or after EMERGENCY or RESET.

7.

ADDITIONAL PREPARATORY FUNCTIONS Pattern rotation (G73)



CNC 8035

·M· MODEL
(SOFT V15.3x)

7.

ADDITIONAL PREPARATORY FUNCTIONS

Pattern rotation (G73)



CNC 8035

·M· MODEL
(SOFT V15.3x)

The CNC has a tool offset table, its number of components being defined via the general machine parameter "NTOFFSET". The following is specified for each tool offset:

- Tool radius in work units in R±5.5 format.
- Tool length in work units in L±5.5 format.
- Wear of tool radius, in work units, in I±5.5 format. The CNC adds this value to the theoretical radius (R) to calculate the real radius (R+I).
- Wear of tool length, in work units, in K±5.5 format. The CNC adds this value to the theoretical length (L) to calculate the real length (L+K).

When tool radius compensation is required (G41 or G42), the CNC applies the sum of R+I values of the selected tool offset as the compensation value.

When tool length compensation is required (G43), the CNC applies the sum of L+K values of the selected tool offset as the compensation value.

8.1 Tool radius compensation (G40, G41, G42)

In normal milling operations, it is necessary to calculate and define the path of the tool taking its radius into account so that the required dimensions of the part are achieved.

Tool radius compensation allows the direct programming of part contouring and of the tool radius without taking the dimensions of the tool into account.


The CNC automatically calculates the path the tool should follow based on the contour of the part and the tool radius value stored in the tool offset table.

There are three preparatory functions for tool radius compensation:

G40: Cancellation of tool radius compensation

G41: Tool radius compensation to the left of the part.

G42: Tool radius compensation to the right of the part.

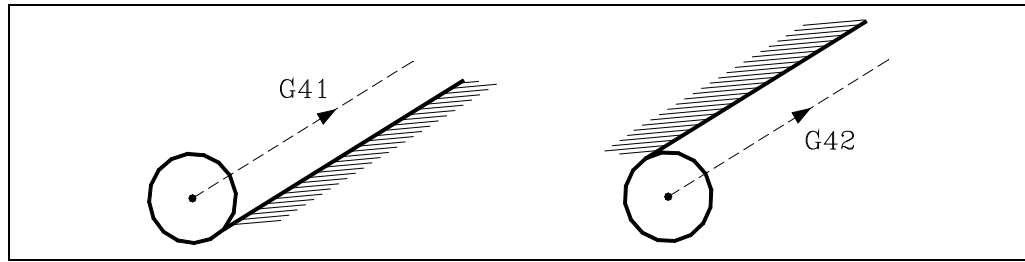

G41 The tool is to the left of the part, depending on the machining direction.

G42 The tool is to the right of the part, depending on the machining direction.

Tool values R, L, I, K should be stored in the tool offset table before starting machining, or should be loaded at the beginning of the program via assignments to variables TOR, TOL, TOI, TOK.

Once the plane in which compensation will be applied has been chosen via codes G16, G17, G18, or G19, this is put into effect by G41 or G42, assuming the value of the tool offset selected via code D, or (in its absence) by the tool offset shown in the tool table for the selected tool (T).

Functions G41 and G42 are modal and incompatible to each other. They are cancelled by G40, G04 (interruption of block preparation), G53 (programming with reference to machine zero), G74 (home search), machining canned cycles (G81, G82, G83, G84, G85, G86, G87, G88, G89) and also on power-up, after executing M02, M30 or after EMERGENCY or RESET.

8.

TOOL COMPENSATION
Tool radius compensation (G40, G41, G42)

8.1.1 Beginning of tool radius compensation

Once the plane in which tool radius compensation has been selected (via G16, G17, G18, or G19), functions G41 or G42 must be used to activate it.

G41: Tool radius compensation to the left of the part.

G42: Tool radius compensation to the right of the part.

In the same block (or a previous one) in which G41 or G42 is programmed, functions T, D, or only T must be programmed so that the tool offset value to be applied can be selected from the tool offset table. If no tool offset is selected, the CNC takes D0 with R0 L0 I0 K0.

When the new selected tool has function M06 associated with it and this, in turn, has an associated subroutine, the CNC will first process the motion block of that subroutine as the starting block of the compensation.

If in that subroutine, a block is executed that contains function G53 (programming in machine coordinates), the previously programmed G41 or G42 is canceled.

The selection of tool radius compensation (G41 or G42) can only be made when functions G00 or G01 are active (straight-line movements).

If the compensation is selected while G02 or G03 are active, the CNC will display the corresponding error message.


The following pages show different cases of starting tool radius compensation, in which the programmed path is represented by a solid line and the compensated path with a dotted line.

Beginning of compensation without programming a movement

After activating the compensation, it could happen that the plane axes do not get involved in the first motion block either because they have not been programmed or because the same point as the tool position has been programmed or because a null incremental move has been programmed.

In this case, the compensation is applied in the current tool position; depending on the first movement programmed in the plane, the tool moves perpendicular to the path on its starting point.

The first movement programmed in the plane may be either linear or circular.

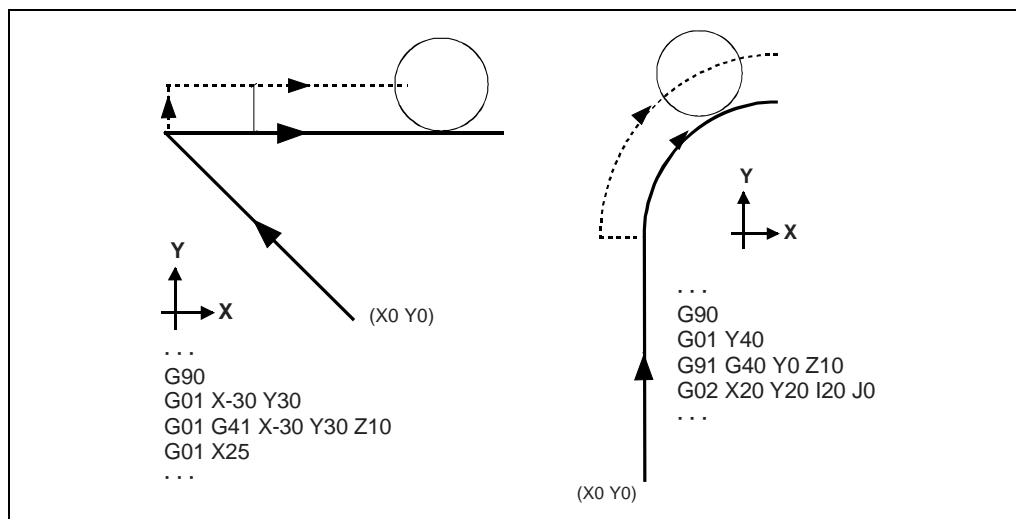

8.

TOOL COMPENSATION
Tool radius compensation (G40, G41, G42)



CNC 8035


·M· MODEL
(SOFT V15.3x)

STRAIGHT-STRAIGHT path

8.

TOOL COMPENSATION


Tool radius compensation (G40, G41, G42)

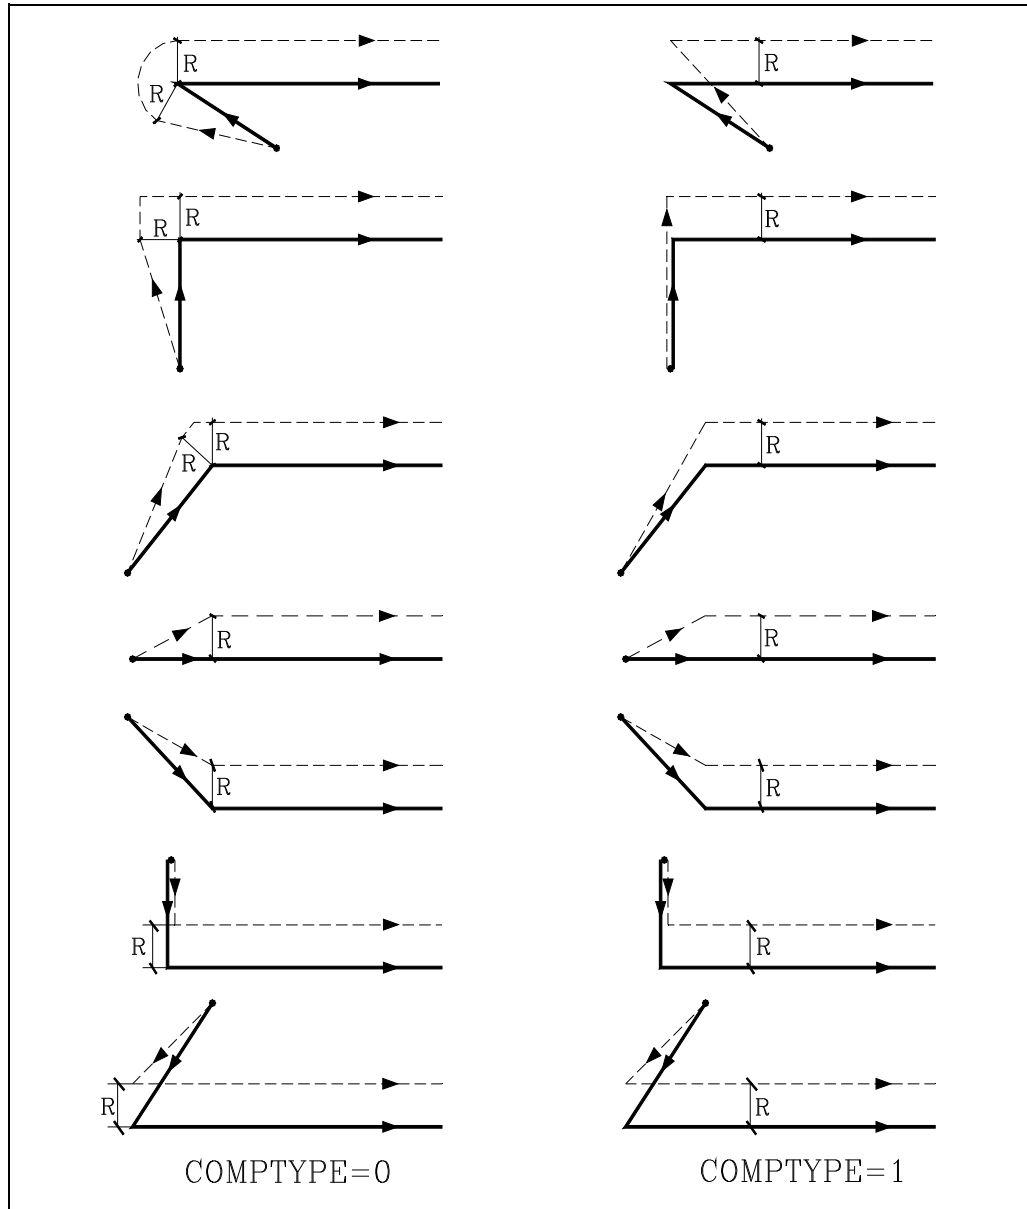

CNC 8035

·M· MODEL
(SOFT V15.3x)

STRAIGHT-CURVED path

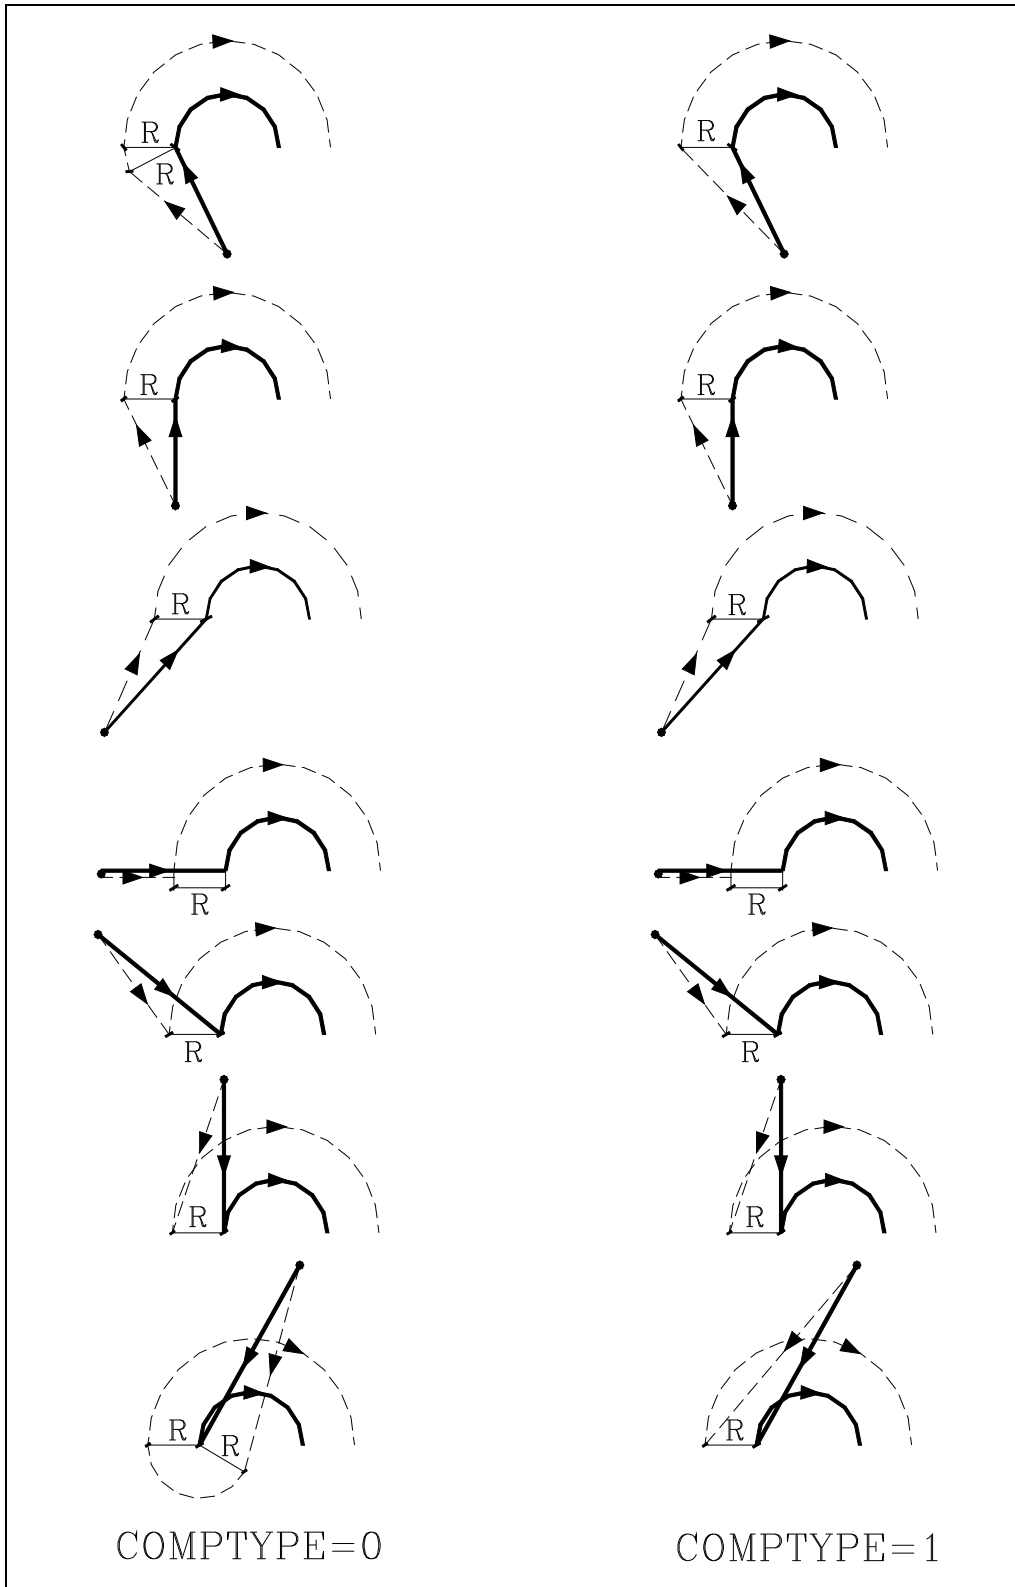

8.

TOOL COMPENSATION
 Tool radius compensation (G40, G41, G42)



CNC 8035

·M· MODEL
 (SOFT V15.3x)

8.1.2 Sections of tool radius compensation


The CNC reads up to 20 blocks ahead of the one it is executing, with the aim of calculating beforehand the path to be followed. When working with tool radius compensation, the CNC needs to know the next programmed movement to calculate the path to follow; therefore, no more than 17 blocks can be programmed in a row.

The diagrams (below) show the different paths followed by a tool controlled by a programmed CNC with tool radius compensation. The programmed path is represented by a solid line and the compensated path by a dotted line.

8.

TOOL COMPENSATION

Tool radius compensation (G40, G41, G42)

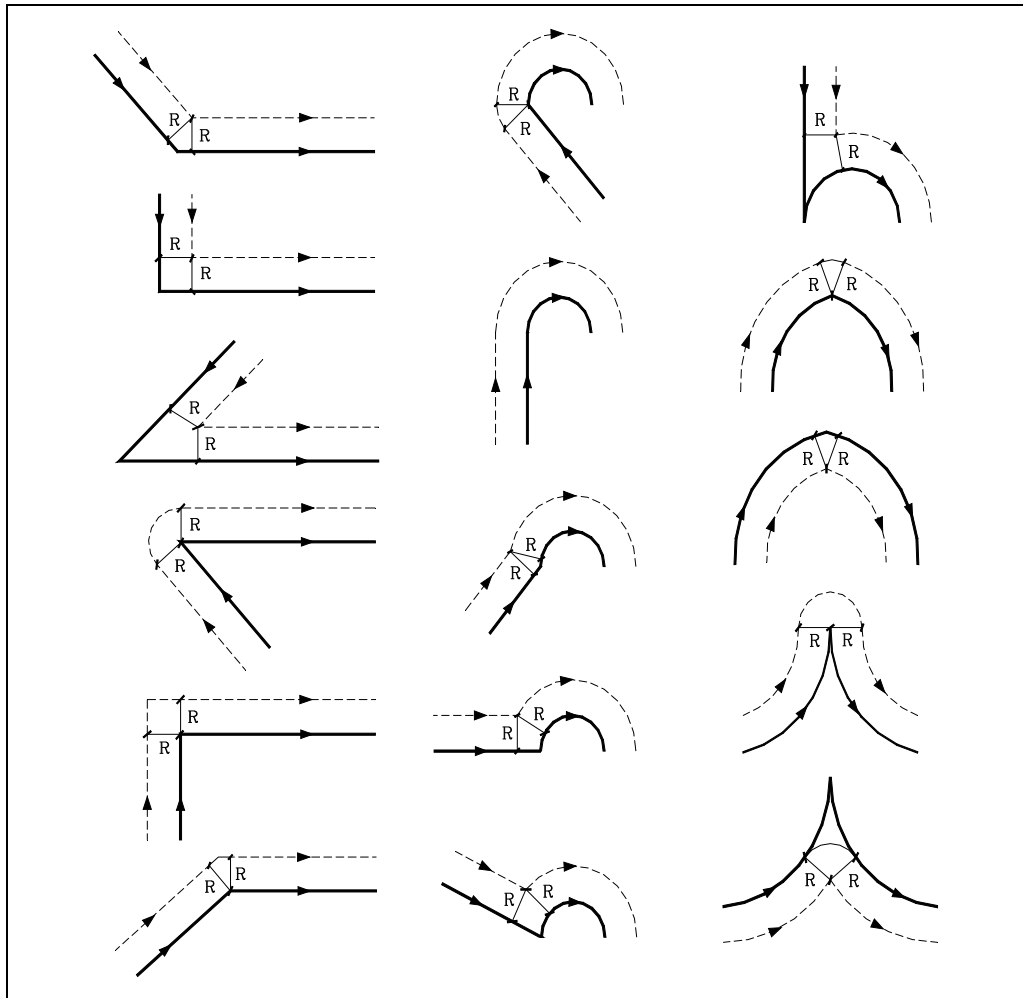

The way the various paths are blended (joined) depends on the setting of machine parameter COMPMODE.

- If it is set to $\cdot 0 \cdot$, the compensation method depends on the angle between paths.
With an angle between paths of up to 300° , both paths are joined with straight sections. In the rest of the cases, both paths are joined with arcs.
- If it is set to $\cdot 1 \cdot$, both paths are joined with arcs.
- If it is set to $\cdot 2 \cdot$, the compensation method depends on the angle between paths.
With an angle between paths of up to 300° , it calculates the intersection. In the rest of the cases it is compensated like COMPMODE = 0.



CNC 8035

·M· MODEL
(SOFT V15.3x)

8.1.3 Cancellation of tool radius compensation

Tool radius compensation is cancelled by using function G40.

It should be remembered that canceling radius compensation (G40) can only be done in a block in which a straight-line movement is programmed (G00 or G01).


If G40 is programmed while functions G02 or G03 are active, the CNC displays the corresponding error message.

The following pages show different cases of canceling tool radius compensation, in which the programmed path is represented by a solid line and the compensated path with a dotted line.

End of compensation without programming a movement

After cancelling the compensation, it could happen that the plane axes do not get involved in the first motion block either because they have not been programmed or because the same point as the tool position has been programmed or because a null incremental move has been programmed.

In this case, the compensation is canceled in the current tool position; depending on the last movement executed in the plane, the tool moves to the end point without compensating the programmed path.

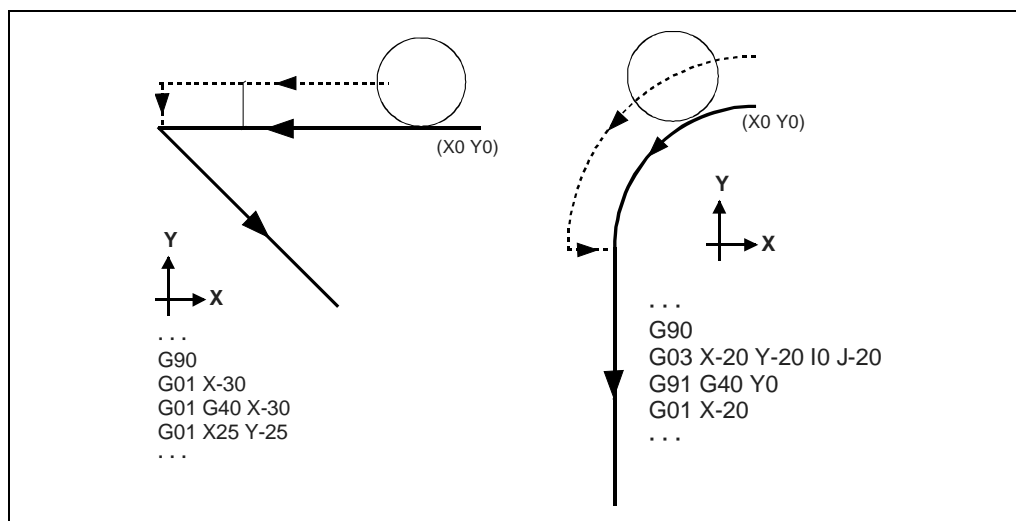

8.

TOOL COMPENSATION


Tool radius compensation (G40, G41, G42)

STRAIGHT-STRAIGHT path

8.

TOOL COMPENSATION


Tool radius compensation (G40, G41, G42)

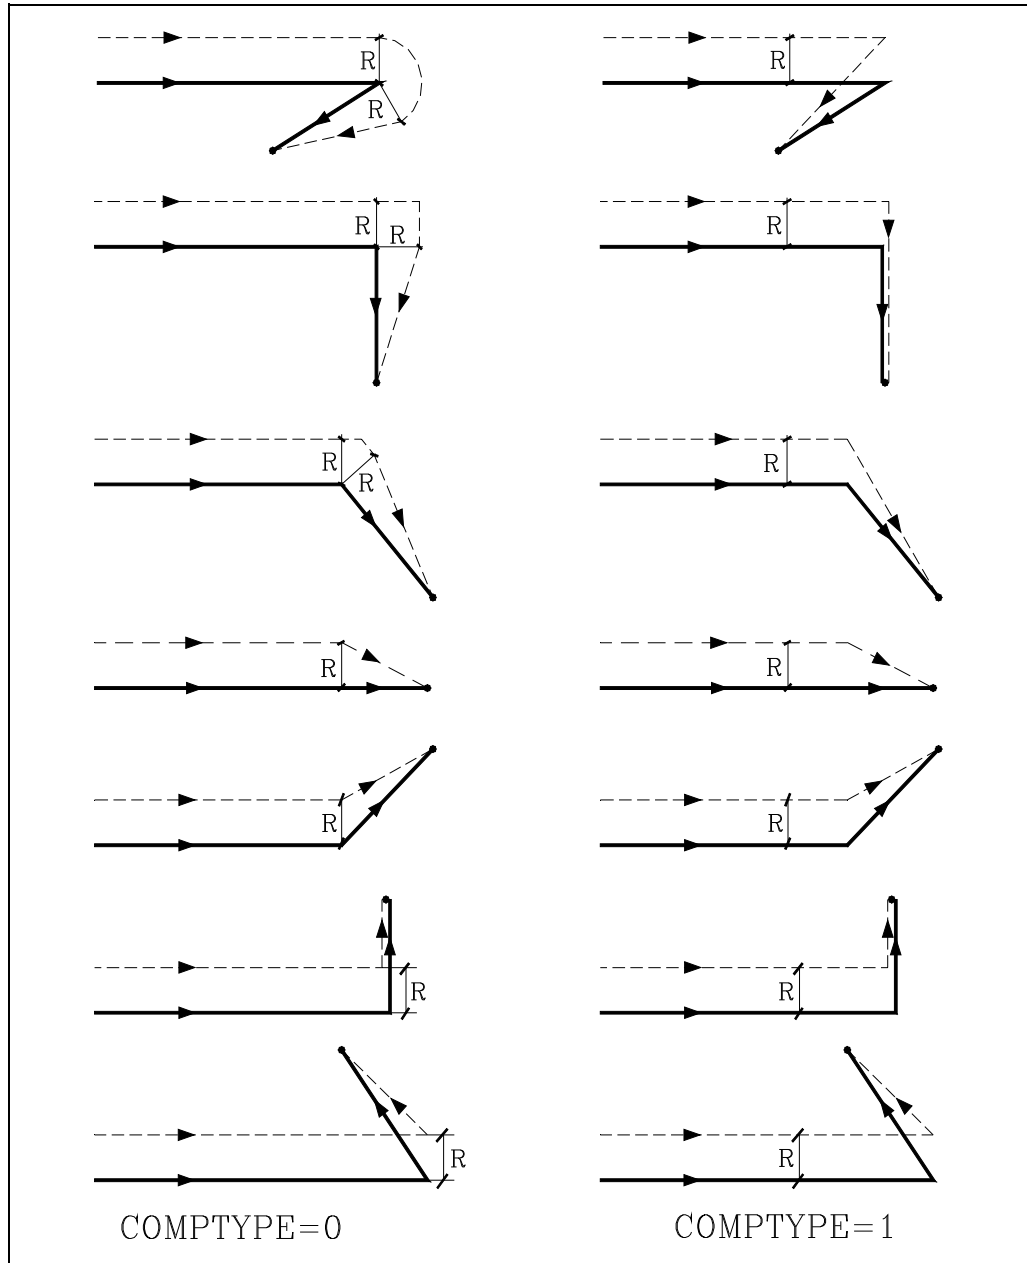

CNC 8035

·M· MODEL
(SOFT V15.3x)

CURVED-STRAIGHT path

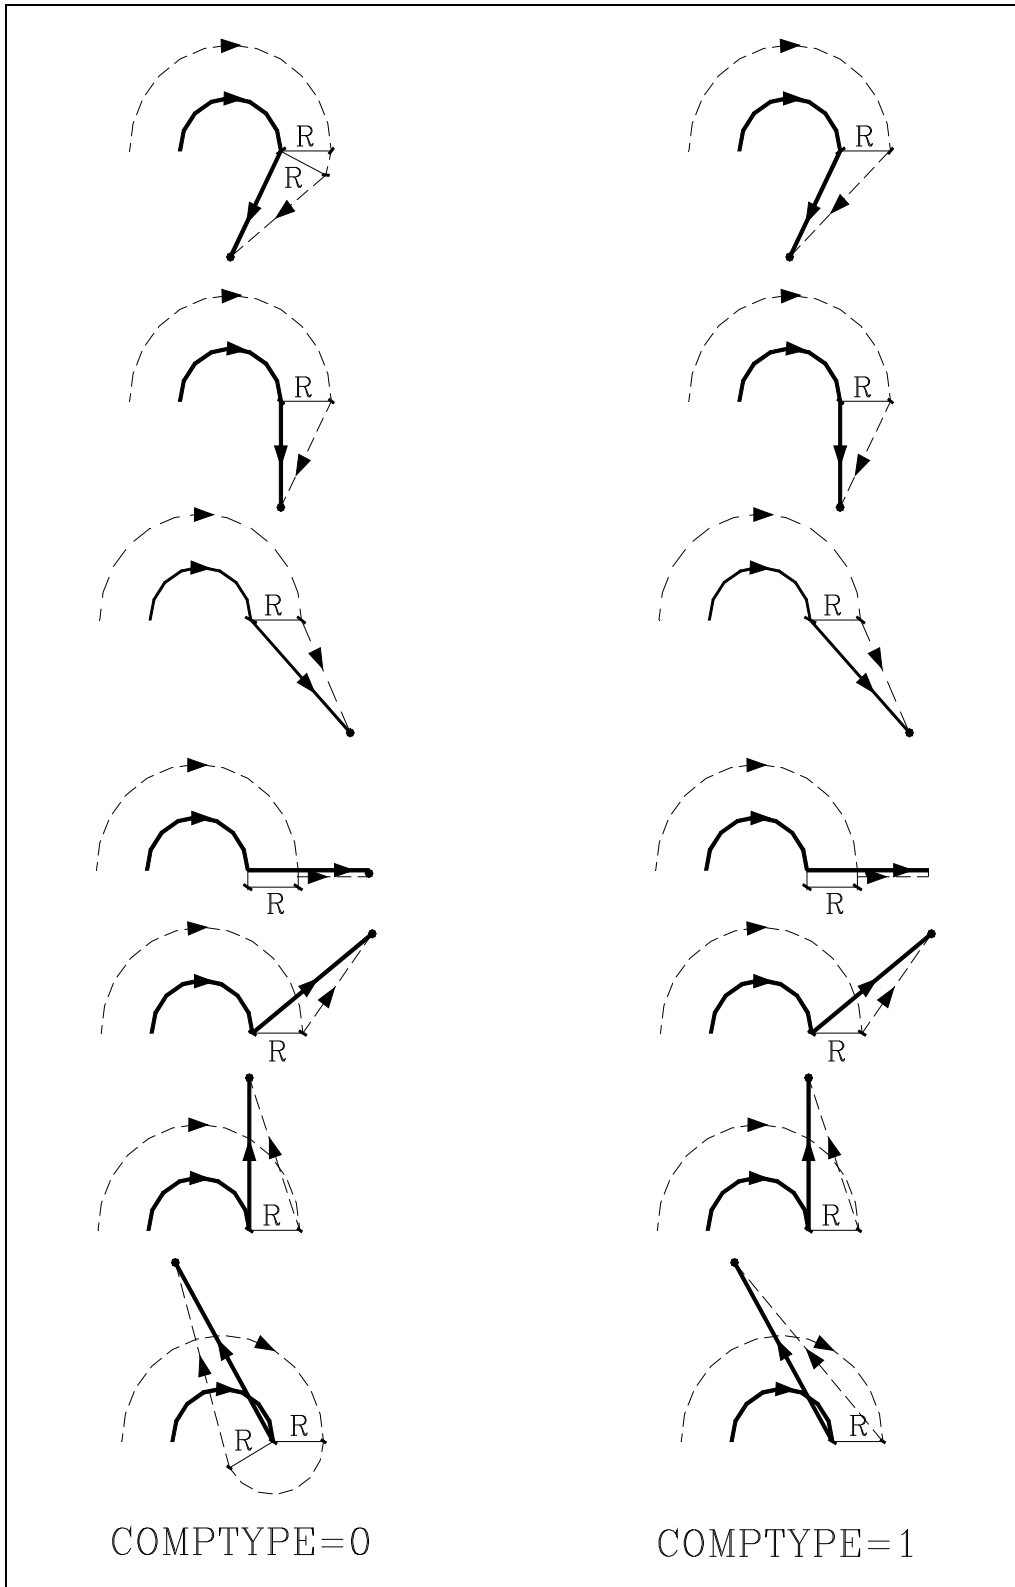

8.


TOOL COMPENSATION
 Tool radius compensation (G40, G41, G42)



CNC 8035

·M· MODEL
 (SOFT V15.3x)

Example of machining with radius compensation

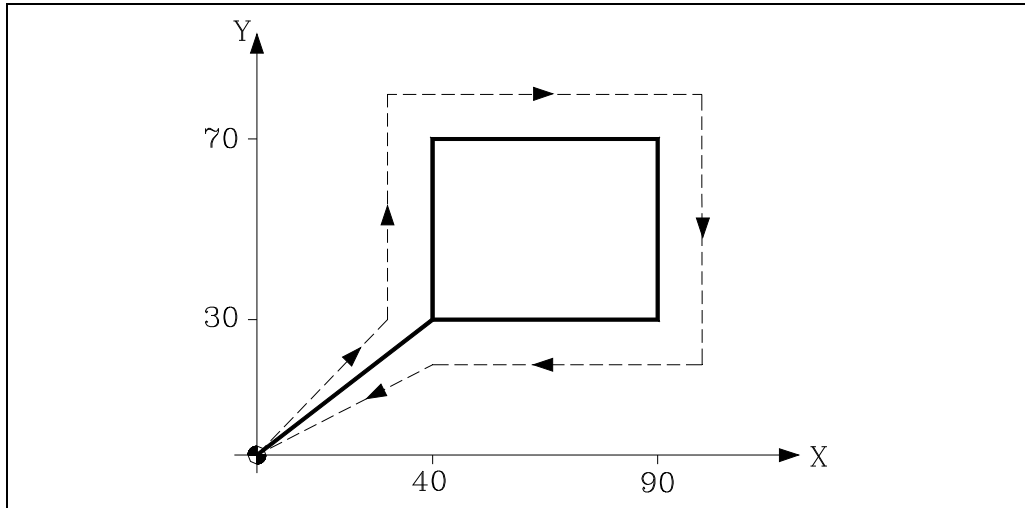

The programmed path is represented by a solid line and the compensated path by a dotted line.

Tool radius	10mm
Tool number	T1
Tool offset number	D1

; Preset

G92 X0 Y0 Z0

; Tool, offset and spindle start at S100

G90 G17 S100 T1 D1 M03

; Begins compensation

G41 G01 X40 Y30 F125Y70

X90

Y30

X40

; Cancels compensation

G40 G00 X0 Y0

M30

8.

TOOL COMPENSATION


Tool radius compensation (G40, G41, G42)



CNC 8035

·M· MODEL
(SOFT V15.3x)

Example of machining with radius compensation

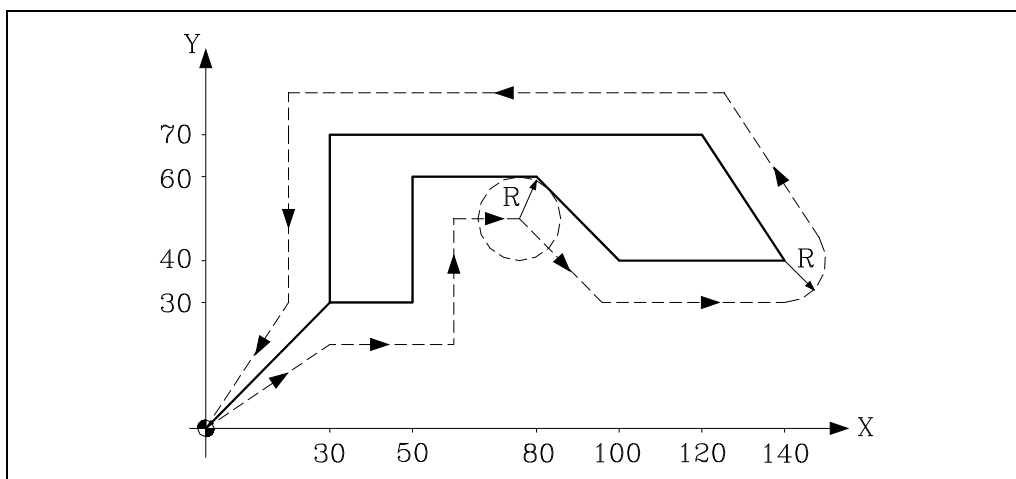

The programmed path is represented by a solid line and the compensated path by a dotted line.

Tool radius	10mm
Tool number	T1
Tool offset number	D1

; Preset

G92 X0 Y0 Z0

; Tool, offset and spindle start at S100

G90 G17 F150 S100 T1 D1 M03

; Begins compensation

G42 G01 X30 Y30

X50

Y60

X80

X100 Y40

X140

X120 Y70

X30

Y30

; Cancels compensation

G40 G00 X0 Y0

M30



TOOL COMPENSATION


Tool radius compensation (G40, G41, G42)



CNC 8035

·M· MODEL
(SOFT V15.3x)

Example of machining with radius compensation

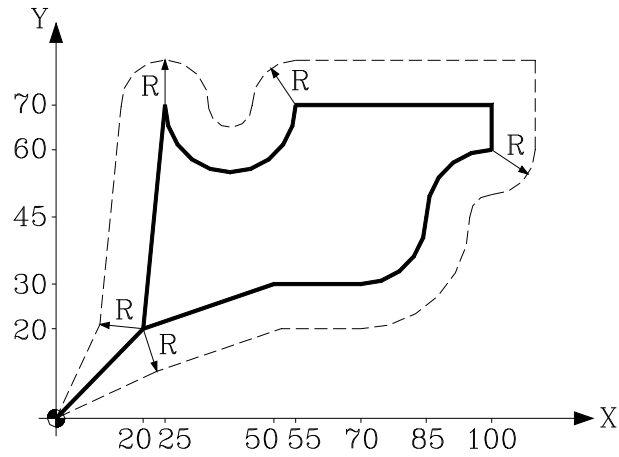

The programmed path is represented by a solid line and the compensated path by a dotted line.

Tool radius	10mm
Tool number	T1
Tool offset number	D1

```

; Preset
G92 X0 Y0 Z0

; Tool, offset and spindle start at S100
G90 G17 F150 S100 T1 D1 M03

; Begins compensation
G42 G01 X20 Y20
X50 Y30
X70
G03 X85Y45 I0 J15
G02 X100 Y60 I15 J0
G01 Y70
X55
G02 X25 Y70 I-15 J0
G01 X20 Y20

; Cancels compensation
G40 G00 X0 Y0 M5
M30
    
```

8.

TOOL COMPENSATION
Tool radius compensation (G40, G41, G42)



CNC 8035

-M- MODEL
(SOFT V15.3x)

8.1.4 Change of type of tool radius compensation while machining

The compensation may be changed from G41 to G42 or vice versa without having to cancel it with G40. It may be changed in any motion block and even in a motionless one, i.e. without moving the axes of the plane or by programming the same point twice.

It compensates independently the last movement before the change and the first one after the change. To change the type of compensation, the different cases are solved according to these criteria:


A. The compensated paths cut each other.

The programmed paths are compensated each on its corresponding side. The change of sides takes place at the intersection point of both paths.

B. The compensated paths do not cut each other.

An additional section is inserted between the two paths. From the point perpendicular to the first path at the end point up to the point perpendicular to the second path at the starting point. Both points are located at a distance R from the programmed path.

Here is a summary of the different cases:

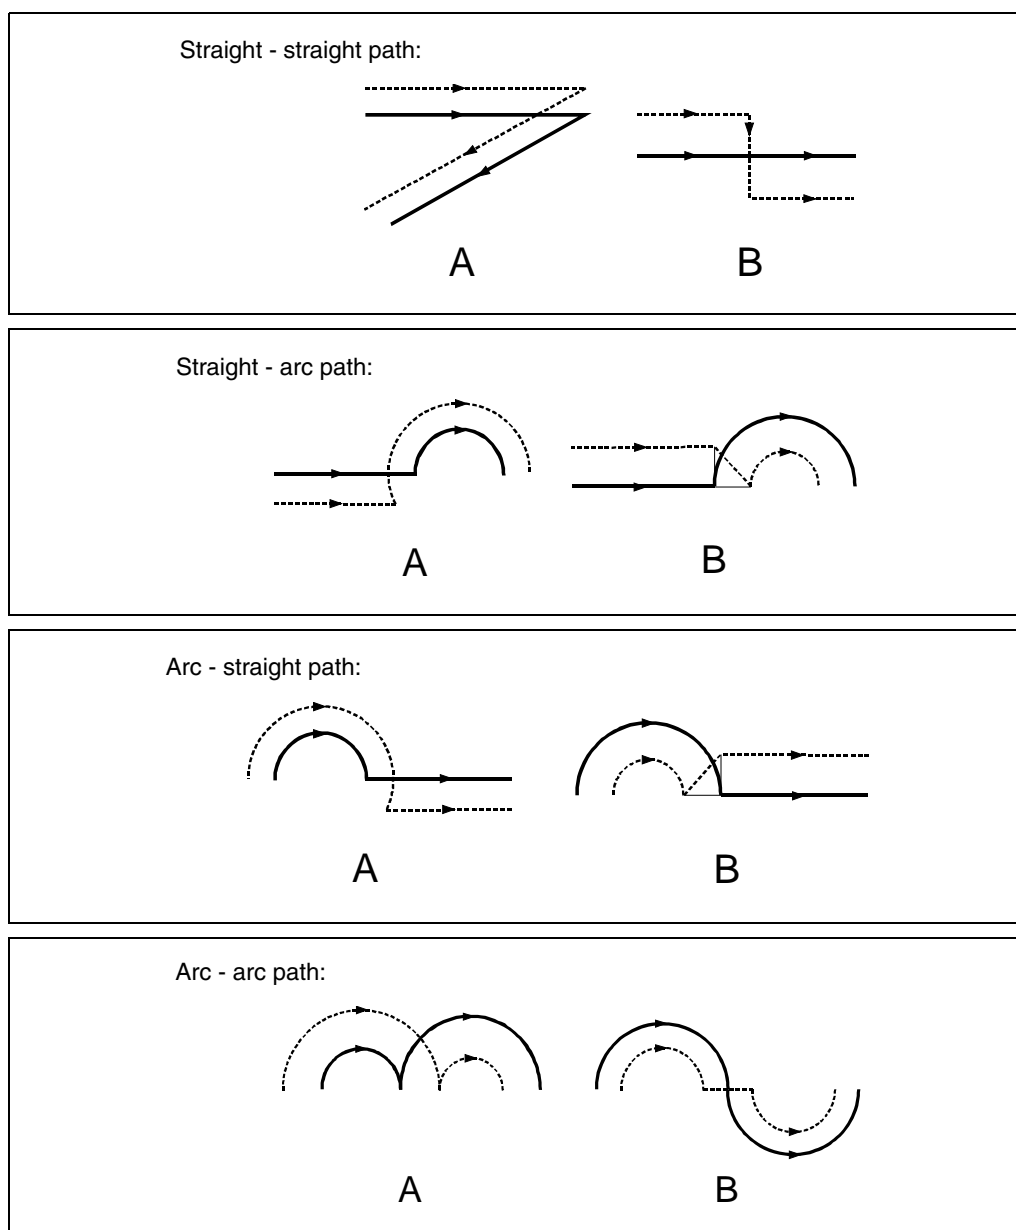

TOOL COMPENSATION
Tool radius compensation (G40, G41, G42)



CNC 8035

·M· MODEL
(SOFT V15.3x)

8.2 Tool length compensation (G43, G44, G15)

With this function it is possible to compensate possible differences in length between the programmed tool and the tool being used.

The tool length compensation is applied on to the axis indicated by function G15 or, in its absence, to the axis perpendicular to the main plane.

If G17, tool length compensation on the Z axis.

If G18, tool length compensation on the Y axis

If G19, tool length compensation on the X axis.

Whenever one of functions G17, G18 or G19 is programmed, the CNC assumes as new longitudinal axis (upon which tool length compensation will be applied) the one perpendicular to the selected plane.

On the other hand, if function G15 is executed while functions G17, G18 or G19 are active, the new longitudinal axis (selected with G15) will replace the previous one.

The function codes used in length compensation are as follows:

G43: Tool length compensation.

G44: Cancellation of tool length compensation.

Function G43 only indicates that a longitudinal compensation is to be applied. The CNC starts applying it when the longitudinal (perpendicular) axis starts moving.

```

; Preset
G92 X0 Y0 Z50

; Tool, offset ...
G90 G17 F150 S100 T1 D1 M03

; Selects compensation
G43 G01 X20 Y20
X70

; Begins compensation
Z30

```

When G43 is programmed, the CNC compensates the length in accordance with the value of the tool offset selected with code D, or (in its absence) the tool offset shown in the tool table for the selected tool (T).

Tool values R, L, I, K should be stored in the tool offset table before starting machining, or should be loaded at the beginning of the program via assignments to variables TOR, TOL, TOI, TOK.

If no tool offset is selected, the CNC takes D0 with R0 L0 I0 K0.

Function G43 is modal and can be canceled via G44 and G74 (home search). If general machine parameter "ILCOMP=0", it is also canceled on power-up, after executing M02, M30 or after EMERGENCY or RESET.

G53 (programming with respect to machine zero) temporarily cancels G43 only while executing a block which contains a G53.

Length compensation can be used together with canned cycles, although here care should be taken to apply this compensation before starting the cycle.

8.


TOOL COMPENSATION
Tool length compensation (G43, G44, G15)



CNC 8035

·M· MODEL
(SOFT V15.3x)

Example of machining with tool length compensation

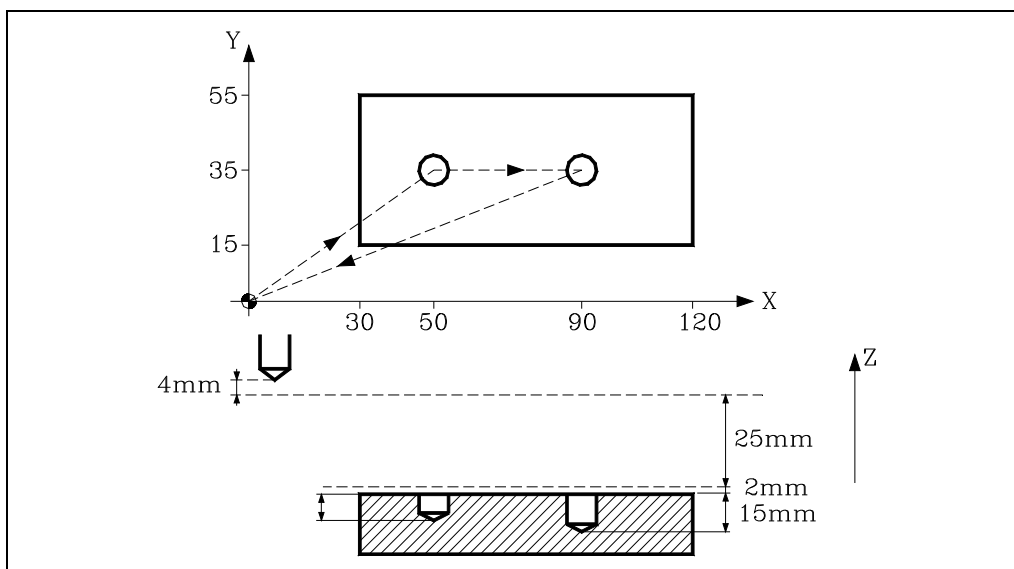

It is assumed that the tool used is 4 mm shorter than the programmed one.

Tool length	-4mm
Tool number	T1
Tool offset number	D1

```

; Preset
G92 X0 Y0 Z0

; Tool, offset ...
G91 G00 G05 X50 Y35 S500 M03

; Begins compensation
G43 Z-25 T1 D1
G01 G07 Z-12 F100
G00 Z12
X40
G01 Z-17

; Cancels compensation
G00 G05 G44 Z42 M5
G90 G07 X0 Y0
M30
    
```

8.

TOOL COMPENSATION
 Tool length compensation (G43, G44, G15)




CNC 8035

-M- MODEL
 (SOFT V15.3x)

8.3 Collision detection (G41 N, G42 N)

Using this option, the CNC analyzes in advance the blocks to be executed in order to detect loops (profile intersections with itself) or collisions of the programmed profile. The number of blocks to be analyzed (up to 50) may be defined by the user.

The example shows machining errors (E) due to a collision in the programmed profile. This type of errors may be avoided using collision detection.

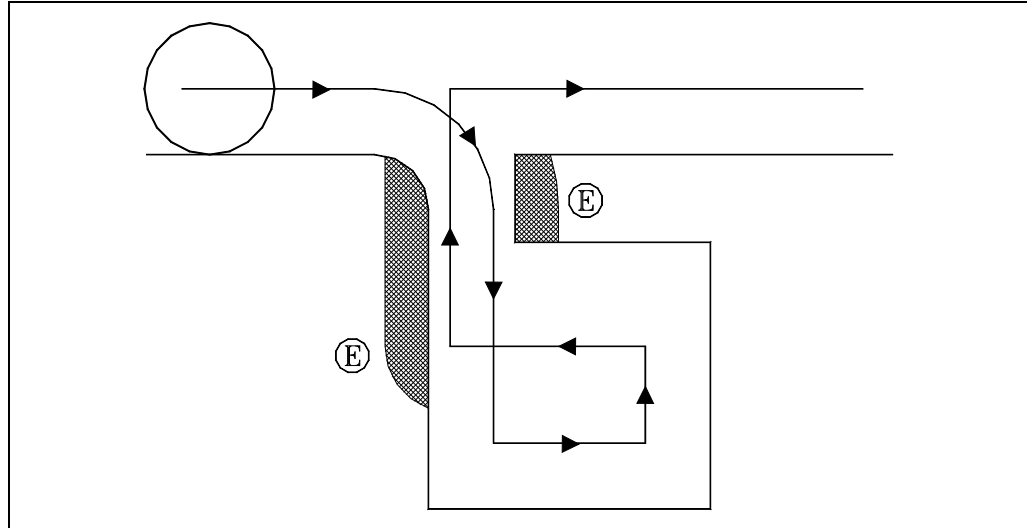

When detecting a loop or a collision, the blocks that caused it will not be executed and a warning will be issued for each loop or collision eliminated.

Possible cases: a step on a straight path, a step in a circular path and tool radius compensation too large.

The information contained in the eliminated blocks, not being the moving in the active plane, will be executed (including the movements of the axes).

Block detection is defined and activated with tool radius compensation functions G41 and G42. A new parameter N (G41 N y G42 N) has been added to activate the feature and define the number of blocks to analyze.

Possible values from N3 to N50. Without "N", or with N0, N1 and N2, it behaves like in older versions.

In CAD generated programs that are made up of lots of very short blocks, it is recommended to use very low N values (around 5) so as not to jeopardize block processing time.

When this function is active, the history of active G functions shows G41 N or G42 N.

8.

TOOL COMPENSATION
Collision detection (G41 N, G42 N)

These canned cycles can be performed on any plane, the depth being along the axis selected as longitudinal via function G15 or, in its absence, along the axis perpendicular to this plane.

The CNC offers the following machining canned cycles :

G69	Complex deep hole drilling
G81	Drilling canned cycle.
G82	Drilling cycle with dwell.
G83	Deep hole drilling canned cycle with constant peck (drilling step).
G84	Tapping canned cycle.
G85	Reaming canned cycle.
G86	Boring cycle with withdrawal in G00
G87	Rectangular pocket canned cycle.
G88	Circular pocket canned cycle.
G89	Boring cycle with withdrawal in G01
G210	Bore milling canned cycle
G211	Inside thread milling canned cycle.
G212	Outside thread milling canned cycle.

It also offers the following functions that can be used with the machining canned cycles:

G79	Change of canned cycle parameters.
G98	Return to the starting plane at the end of the canned cycle
G99	Return to the reference plane at the end of the canned cycle.

9.1 Canned cycle definition

A canned cycle is defined by the G function indicating the canned cycle and its corresponding parameters.

A canned cycle cannot be defined in a block which has nonlinear movements (G02, G03, G08, G09, G33 or G34).

Also, a canned cycle cannot be executed while function G02, G03, G33 or G34 is active. The CNC will issue the corresponding error message.

However, once a canned cycle has been defined in a block and following blocks, functions G02, G03, G08 or G09 can be programmed.

9.

CANNED CYCLES
Canned cycle definition



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.2 Influence zone of a canned cycle

Once a canned cycle has been defined it remains active, and all blocks programmed after this block are under its influence while it is not cancelled.

In other words, every time a block is executed in which some axis movement has been programmed, the CNC will carry out (following the programmed movement) the machining operation which corresponds to the active canned cycle.

If, in a movement block within the area of influence of a canned cycle, the number of times a block is executed (repetitions) "N" is programmed at the end of the block, the CNC repeats the programmed positioning and the machining operation corresponding to the canned cycle the indicated number of times.

If a number of repetitions (times) "N0" is programmed, the machining operation corresponding to the canned cycle will not be performed. The CNC will only carry out the programmed movement.

If, within the area of influence of a canned cycle, there is a block which does not contain any movement, the machining operation corresponding to the defined canned cycle will not be performed, except in the calling block.

G81...	Definition and execution of the canned cycle (drilling).
G90 G1 X100	The X axis moves to X100, where the hole is to be drilled.
G91 X10 N3	The CNC runs the following operation 3 times. <ul style="list-style-type: none"> • Incremental move to X10. • Runs the cycle defined above.
G91 X20 N0	Incremental move only to X20 (no drilling).

9.

CANNED CYCLES
Influence zone of a canned cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)


9.2.1 G79. Modification of the canned cycle parameters

The CNC allows one or several parameters of an active canned cycle to be modified by programming the G79 function, without any need for redefining the canned cycle.

The CNC will continue to maintain the canned cycle active and will perform the following machinings of the canned cycle with the updated parameters.

The G79 function must be programmed alone in a block, and this block must not contain any more information.

Next 2 programming examples are shown assuming that the work plane is formed by the X and Y axes, and that the longitudinal axis (perpendicular) is the Z axis:

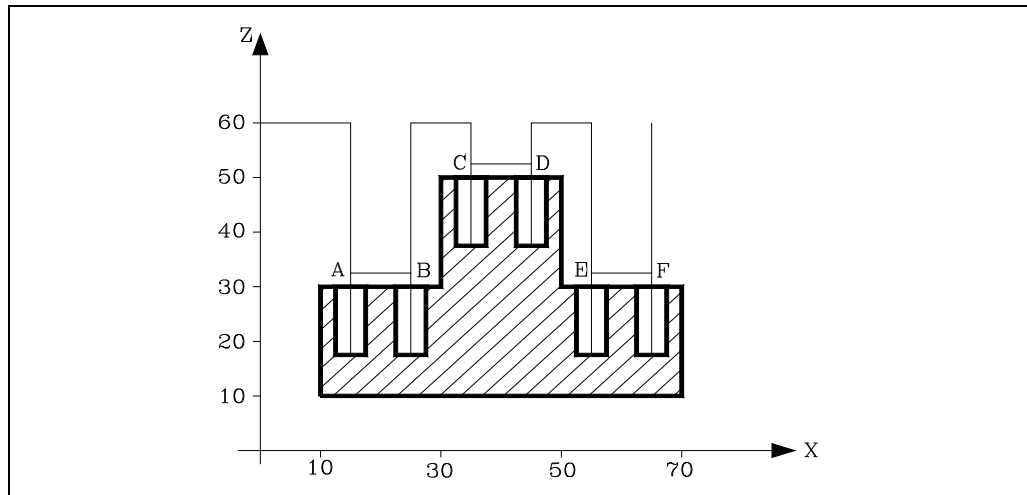

```

T1
M6
; Starting point.
G00 G90 X0 Y0 Z60
; Defines drilling cycle. Drills in A.
G81 G99 G91 X15 Y25 Z-28 I-14
; Drills in B.
G98 G90 X25
; Modifies reference plane and machining depth.
G79 Z52
; Drills in C.
G99 X35
; Drills in D.
G98 X45
; Modifies reference plane and machining depth.
G79 Z32
; Drills in E.
G99 X55
; Drills in F.
G98 X65
M30
    
```


9.

CANNED CYCLES
Influence zone of a canned cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)

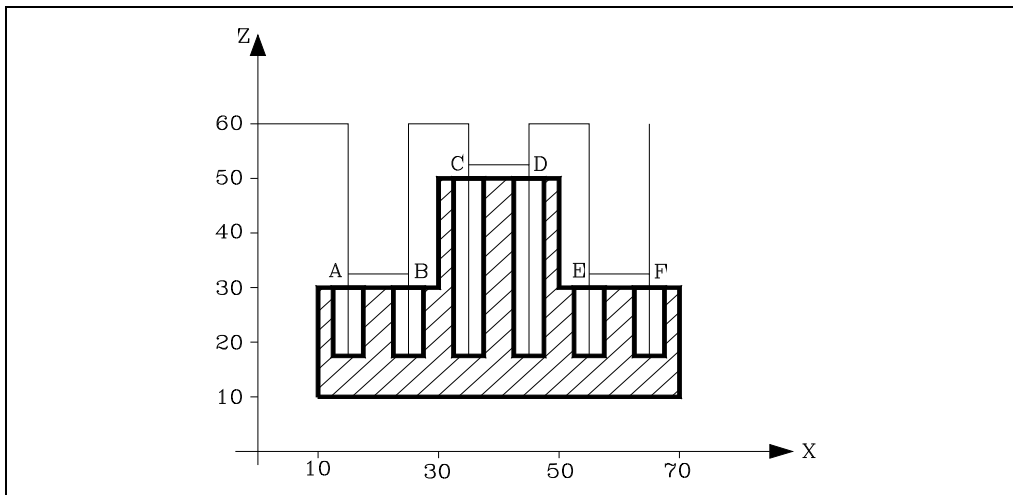

```

T1
M6
; Starting point.
G00 G90 X0 Y0 Z60
; Defines drilling cycle. Drills in A.
G81 G99 X15 Y25 Z32 I18
; Drills in B.
G98 X25
; Modifies reference plane.
G79 Z52
; Drills in C.
G99 X35
; Drills in D.
G98 X45
; Modifies reference plane.
G79 Z32
; Drills in E.
G99 X55
; Drills in F.
G98 X65
M30
    
```

9.

CANNED CYCLES
Influence zone of a canned cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.3 Canned cycle cancellation

A canned cycle can be cancelled via :

- Function G80, which can be programmed in any block.
- After defining a new canned cycle. This will cancel and replace any other that may be active.
- After executing M02, M30, or after EMERGENCY or RESET.
- When searching home with function G74.
- Selecting a new work plane via functions G16, G17, G18, or G19.

9.

CANNED CYCLES
Canned cycle cancellation



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.4 Some general points to consider

- A canned cycle may be defined anywhere in the program, that is, in the main program as well as in a subroutine.
- Calls to subroutines can be made from a block within the influence of a canned cycle without implying the cancellation of the canned cycle.
- The execution of a canned cycle will not alter the history of previous “G” functions.
- Nor will the spindle turning direction be altered. A canned cycle can be entered with any turning direction (M03 or M04), leaving in the same direction in which the cycle was entered.
Should a canned cycle be entered with the spindle stopped, it will start in a clockwise direction (M03), and maintain the same turning direction until the cycle is completed.
- Should it be required to apply a scaling factor when working with canned cycles, it is advisable that this scale factor be common to all the axes involved.
- The execution of a canned cycle cancels radius compensation (G41 and G42). It is equivalent to G40.
- If tool length compensation (G43) is to be used, this function must be programmed in the same block or in the one before the definition of the canned cycle.
The CNC applies the tool length compensation when the longitudinal (perpendicular) axis starts moving. Therefore, it is recommended to position the tool outside the canned cycle area when defining function G43 for the canned cycle.
- The execution of any canned cycle will alter the global parameter P299.

9.

CANNED CYCLES
Some general points to consider

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

9.5 Machining canned cycles

In all machining cycles there are three coordinates along the longitudinal axis to the work plane which, due to their importance, are discussed below:

- Initial plane coordinate. This coordinate is given by the position which the tool occupies with respect to machine zero when the cycle is activated.
- Coordinate of the reference plane. This is programmed in the cycle definition block and represents an approach coordinate to the part. It can be programmed in absolute coordinates or in incremental, in which case it will be referred to the initial plane.
- Machining depth coordinate. This is programmed in the cycle definition block. It can be programmed in absolute coordinates or in incremental coordinates, in which case it will be referred to the reference plane.

There are two functions which allow to select the type of withdrawal of the longitudinal axis after machining.

- G98: G98 Selects the withdrawal of the tool as far as the initial plane, once the indicated machining has been done.
- G99: G99 Selects the withdrawal of the tool as far as the reference plane, once the indicated machining has been done.

These functions can be used both in the cycle definition block and the blocks which are under the influence of the canned cycle. The initial plane will always be the coordinate which the longitudinal axis had when the cycle was defined.

The structure of a canned cycle definition block is as follows:

G**	Machining point	Parameters	F S T D M	N****
-----	-----------------	------------	-----------	-------

It is possible to program the starting point in the canned cycle definition block (except the longitudinal axis), both in polar coordinates and in Cartesian coordinates.

After defining the point at which it is required to carry out the canned cycle (optional), the functions and parameters corresponding to the canned cycle will be defined, and afterwards, if required, the complementary functions F S T D M are programmed.

When programming, at the end of the block, the number of times a block is to be executed "N", the CNC performs the programmed move and the machining operation corresponding to the active canned cycle the indicated number of times.

If "N0" is programmed, it will not execute the machining operation corresponding to the canned cycle. The CNC will only carry out the programmed movement.

The general operation for all the cycles is as follows:

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Positioning (if programmed) at the starting point for the programmed cycle.
3. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
4. Execution of the programmed machining cycle.
5. Rapid withdrawal of the longitudinal axis to the initial plane or reference plane, depending on whether G98 or G99 has been programmed.

The explanation of each cycle assumes that the work plane is formed by the X and Y axes, and that the longitudinal axis (perpendicular) is the Z axis:

Programming in other planes

The programming format is always the same, it does not depend on the work plane. Parameters XY indicate the coordinate in the work plane (X = abscissa, Y = ordinate) and the penetration along the longitudinal axis.

The following examples show how to drill in X and Y in both directions.



CNC 8035

·M· MODEL
(SOFT V15.3x)

Function G81 defines the drilling canned cycle. It is defined with parameters:

- X Coordinate of the point to be machined along the abscissa axis.
- Y Coordinate of the point to be machined along the ordinate axis.
- I Drilling depth.
- K Dwell at the bottom.

In the following examples, the part surface has a 0 coordinate, the holes are 8 mm deep and the reference coordinate is 2 mm above the surface.

Example 1:

G19
G1 X25 F1000 S1000 M3
G81 X30 Y20 Z2 I-8 K1

Example 2:

G19
G1 X-25 F1000 S1000 M3
G81 X25 Y15 Z-2 I8 K1

Example 3:

G18
G1 Y25 F1000 S1000 M3
G81 X30 Y10 Z2 I-8 K1

Example 4:

G18
G1 Y-25 F1000 S1000 M3
G81 X15 Y60 Z-2 I8 K1

9.

CANNED CYCLES
Machining canned cycles



CNC 8035


·M· MODEL
(SOFT V15.3x)

9.6 G69. Drilling canned cycle with variable peck

This cycle makes successive drilling steps until the final coordinate is reached. The tool withdraws a fixed amount after each drilling operation, it being possible to select that every J drillings it withdraws to the reference plane. A dwell can also be programmed after every drilling.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G69 G98/G99 X Y Z I B C D H J K L R

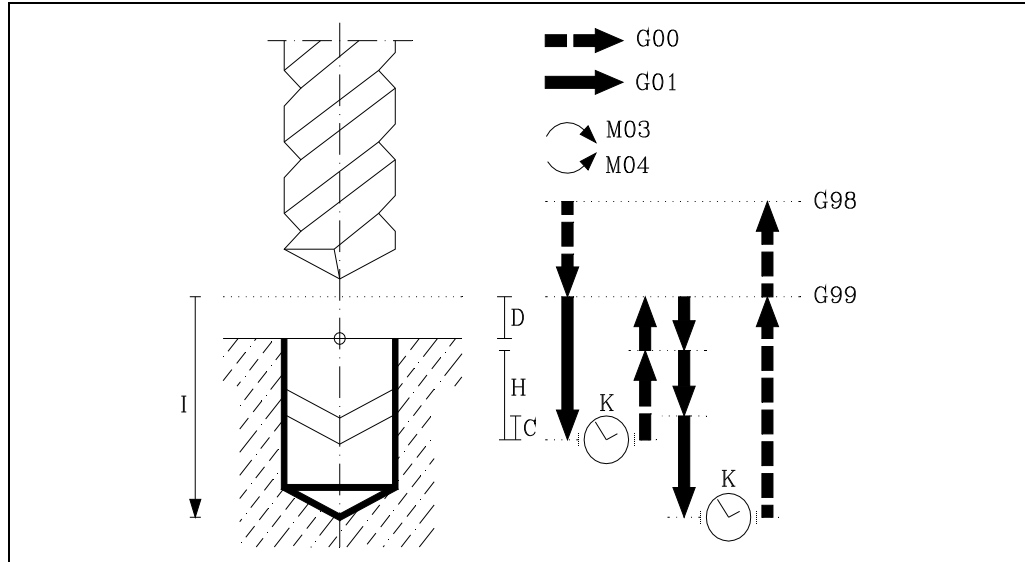

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been drilled.

G99 The tool withdraws to the Reference Plane, once the hole has been drilled.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Drilling depth.

Defines the total drilling depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the part surface.

[B5.5] Drilling peck (step)

Defines the drilling step in the axis longitudinal to the main plane.

9.
CANNED CYCLES
 G69. Drilling canned cycle with variable peck



CNC 8035

·M· MODEL
(SOFT V15.3x)

[C5.5] Approach to the previous drilling

Defines the approach distance the longitudinal axis will move in rapid (G00) from the previous drilling step to start the next drilling step.

If not programmed, a value of 1 mm is assumed. If programmed with a 0 value, the CNC will display the corresponding error message.

[D5.5] Reference plane

Defines the distance between the reference plane and the surface of the part where the drilling is to be done.

In the first drilling, this amount will be added to "B" drilling step. If not programmed, a value of 0 is assumed.

[H±5.5] Withdrawal after drilling

Distance or coordinate the longitudinal axis returns to, in rapid (G00), after each drilling step.


"J" other than 0 means the distance and "J=0" indicates the relief coordinate or absolute coordinate it withdraws to.

If not programmed, the longitudinal axis returns to the reference plane.

[J4] Drilling passes to withdraw to the starting plane

Defines after how many drilling pecks the tool returns to the reference plane in G00. A value between 0 and 9999 may be programmed.

When not programmed or programmed with a "0" value, it returns to the position indicated by H (relief position) after each drilling peck.

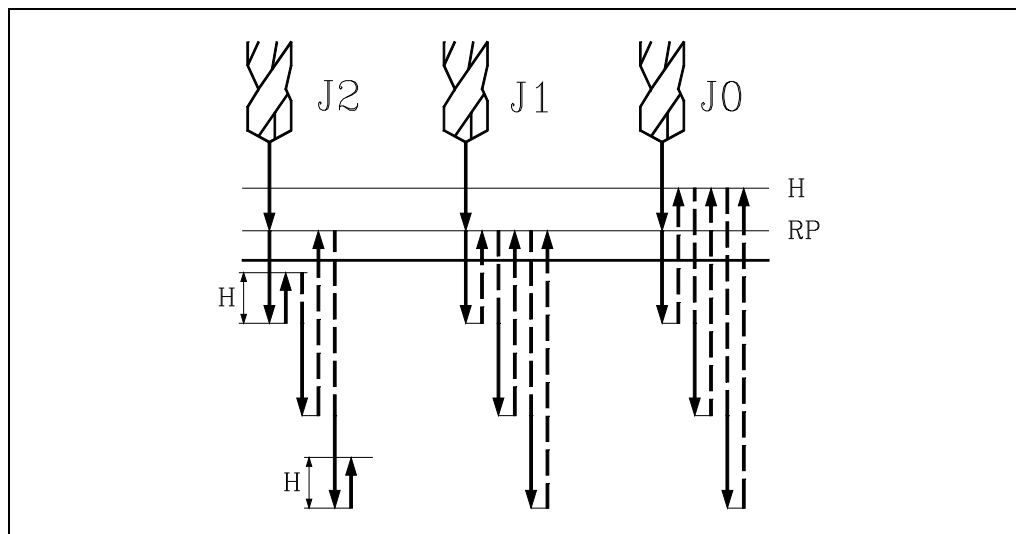

- With "J" greater than 1, after each peck, the tool returns the distance indicated by "H" and every "J" pecks to the reference plane (RP).
- With J1, it will return to the reference plane (RP) after each peck .
- With J0, it will return to the relief position indicated by H.

[K5] Dwell

Defines the dwell, in hundredths of a second, after each drilling peck until the withdrawal begins. If not programmed, the CNC will take the value of "K0".

[L5.5] Minimum drilling peck (step).

It defines the minimum value for the drilling peck. This parameter is used with "R" values other than 1. If not programmed or programmed with a 0 value, it assumes 1 mm.

9.

CANNED CYCLES
G69. Drilling canned cycle with variable peck



CNC 8035

·M· MODEL
(SOFT V15.3x)

[R5.5] Reduction factor for the drilling pecks.

Factor that reduces the drilling peck (step) "B". If it is not programmed or is programmed with a value of "0", it assumes a value of "1".

If $R = 1$, all the drilling pecks will be the same (the programmed "B" value).

If R is other than 1, the first drilling peck will be "B", the second one "R B", The third one "R (RB)" and so on. In other words, from the second peck on, the new peck will be the product of the R factor times the previous peck.

If R is selected with a value other than 1, the CNC will not allow smaller steps than that programmed in L.

9.

CANNED CYCLES

G69. Drilling canned cycle with variable peck




CNC 8035

·M· MODEL
(SOFT V15.3x)

9.6.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.

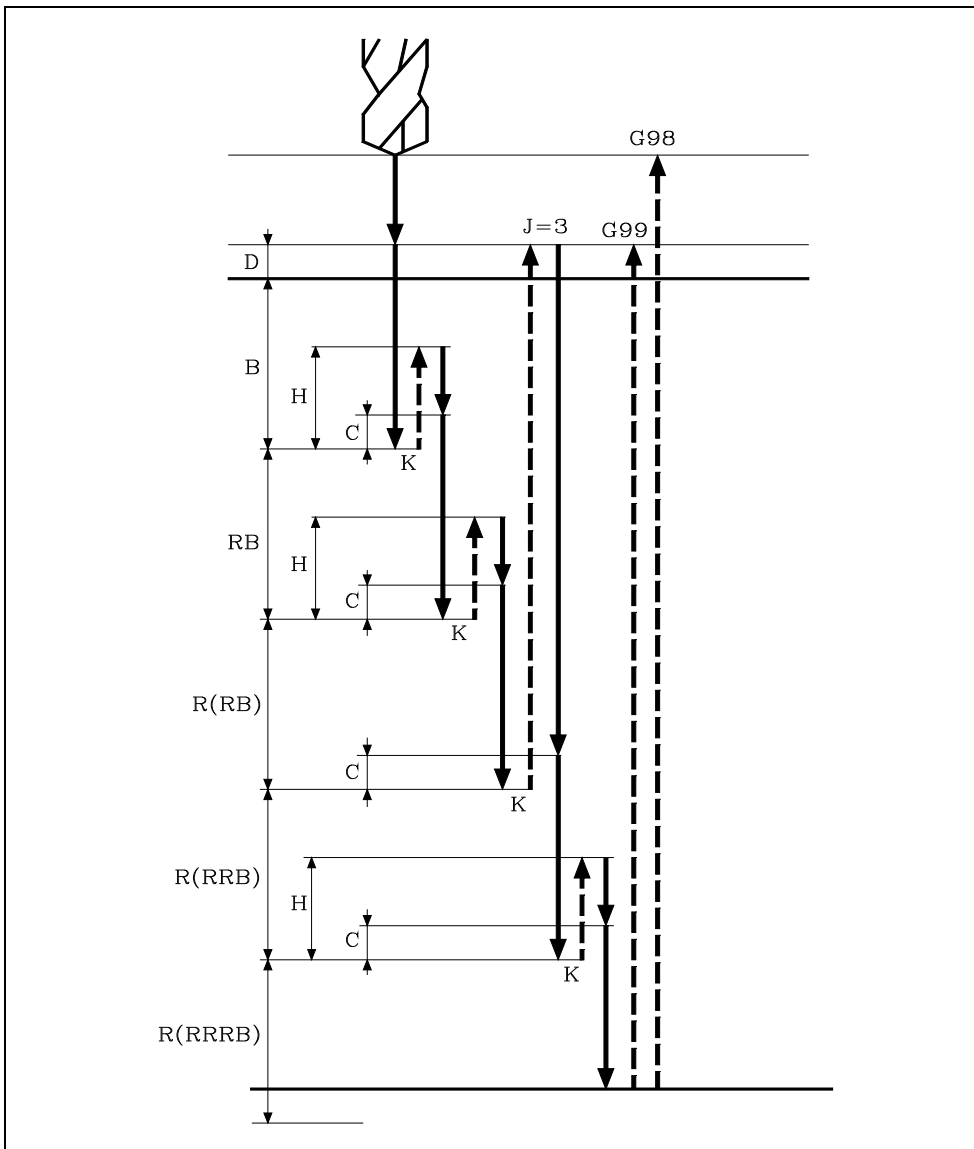

3. First drilling operation. The drilling axis moves in G01 to the programmed incremental depth " $B + D$ ".
4. Drilling loop. The following steps will be repeated until the programmed machining depth " I " is reached.
 1. Dwell K , in hundredths of a second, if it has been programmed.
 2. Withdrawal of the longitudinal axis in rapid (G00) as far as the reference plane, if the number of drillings programmed in J were made, otherwise it withdraws the distance programmed in " H ".
 3. Rapid approach (G00) of the longitudinal axis to a " C " distance from the next peck.
 4. New drilling step. G1 move of the longitudinal axis to the next incremental depth " B and R ".
This movement will be carried out either in G07 or G50 depending on the value assigned to the longitudinal axis "INPOSW2(P51)"
If P51=0, in G7 (square corner). If P51=1, in G50 (controlled round corner).
5. Dwell K , in hundredths of a second, if it has been programmed.
6. Withdrawal at rapid feedrate (G00) of the longitudinal axis to the initial or reference plane, depending on whether G98 or G99 has been programmed.

9.

CANNED CYCLES
G69. Drilling canned cycle with variable peck

FAGOR 

CNC 8035

-M- MODEL
(SOFT V15.3x)

The first drilling penetration is done in G07 or G50 depending on the value assigned to the parameter of the longitudinal axis "INPOSW2 (P51)" and to parameter "INPOSW1 (P19)". This is important to join a drilling operation with another one in multiple drilling so the tool path is faster and smoother.

If $INPOSW2 < INPOSW1$ in G07 (square corner).

If $INPOSW2 \geq INPOSW1$ in G50 (controlled round corner).

If a scaling factor is applied to this cycle, it should be borne in mind that this scaling factor will only affect the reference plane coordinates and drilling depth.

Therefore, and due to the fact that parameter "D" is not affected by the scaling factor, the surface coordinate of the part will not be proportional to the programmed cycle.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

```

; Tool selection.
T1
M6

; Starting point.
G0 G90 X0 Y0 Z0

; Canned cycle definition.
G69 G98 G91 X100 Y25 Z-98 I-52 B12 C2 D2 H5 J2 K150 L3 R0.8 F100 S500 M8

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

Tool withdrawal

While machining, the CNC lets withdraw the tool to the starting plane stopping the spindle when the tool reaches the starting plane.

Activating PLC mark RETRACYC (M5065) stops the main axis and the tool is withdrawn without stopping the spindle. The spindle stops when the tool is retracted, once it reaches the starting plane.

Options after tool withdrawal

Once the tool has been retracted, the user will have the following options:

- Finish the hole.
- Go to the next hole.
- Go into tool inspection.

After this, the CNC will display the following message:

"To end the cycle, press START to skip to the next SKIPCYCL".

9.

CANNED CYCLES
G69. Drilling canned cycle with variable peck



CNC 8035

·M· MODEL
(SOFT V15.3x)

Finish the hole:

To finish the hole, press the [START] key.

It goes down in G0 with spindle running to 1 mm before the coordinate where the hole stopped. From then on, it continues at the F and S programmed in the cycle.

Go to the next hole:

To go to the next hole, activate the PLC mark SKIPCYCL.

The CNC will display the following message:

"Press [START] to continue".

Pressing the [START] key, the CNC considers the cycle to be finished and continues with the next block.

Go into tool inspection

If you don't wish to finish the hole nor go to the next hole, it is possible to go into a standard tool inspection.

In this case, a block must be selected and a standard repositioning must be done before resuming the execution of the program.

After inspecting the tool, once repositioning is done, the following choices will be offered:

- Resume the interrupted cycle.
- Skip the interrupted cycle and resume at the next block.


9.**CANNED CYCLES**
G69. Drilling canned cycle with variable peck**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

9.7 G81. Drilling canned cycle

This cycle drills at the point indicated until the final programmed coordinate is reached. It is possible to program a dwell at the bottom of the drill hole.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G81 G98/G99 X Y Z I K

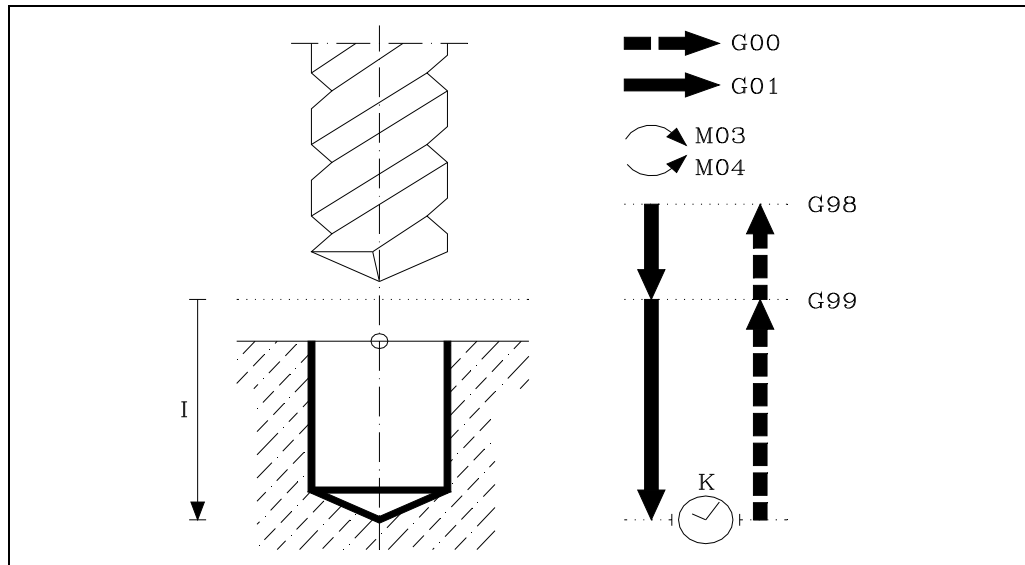

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been drilled.

G99 The tool withdraws to the Reference Plane, once the hole has been drilled.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Drilling depth.

Defines the total drilling depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the reference plane.

[K5] Dwell

Defines the dwell, in hundredths of a second, after each drilling peck until the withdrawal begins. If not programmed, the CNC will take the value of "K0".


9.

CANNED CYCLES
G81. Drilling canned cycle

9.7.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. Drill the hole. Movement of the longitudinal axis at work feedrate, to the bottom of the hole programmed in "I".
4. Dwell K, in hundredths of a second, if it has been programmed.
5. Withdrawal at rapid feedrate (G00) of the longitudinal axis to the initial or reference plane, depending on whether G98 or G99 has been programmed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

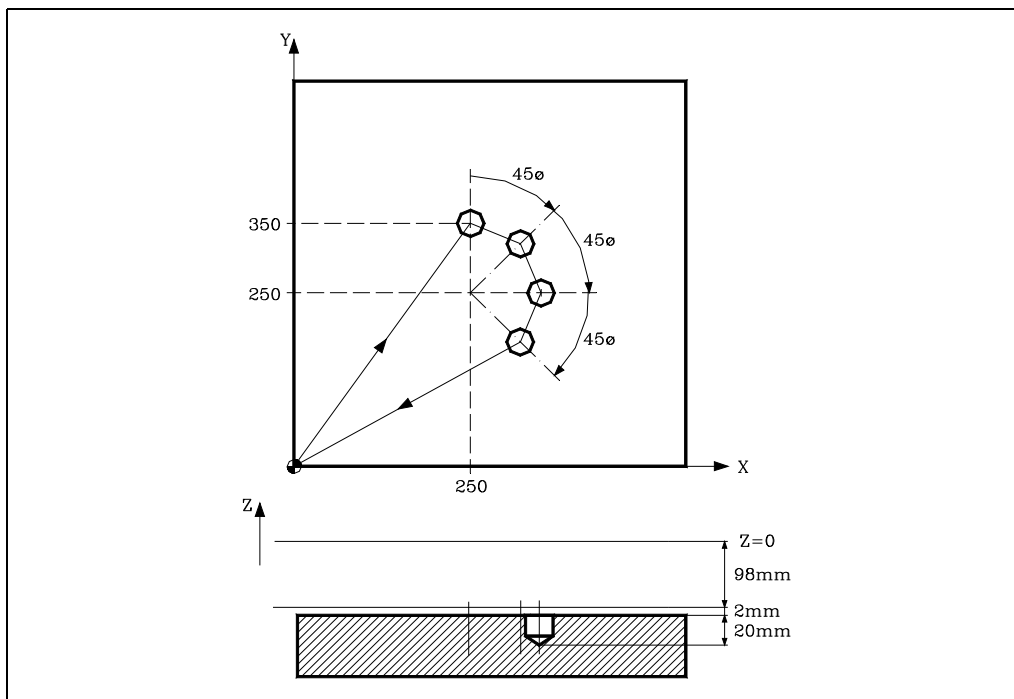

```

; Tool selection.
T1
M6

; Starting point.
G0 G90 X0 Y0 Z0

; Canned cycle definition.
G81 G98 G00 G91 X250 Y350 Z-98 I-22 F100 S500

; Polar coordinate origin.
G93 I250 J250

; Turn and canned cycle, 3 times
Q-45 N3

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

9.

CANNED CYCLES
G81. Drilling canned cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)

Tool withdrawal

While machining, the CNC lets withdraw the tool to the starting plane stopping the spindle when the tool reaches the starting plane.

Activating PLC mark RETRACYC (M5065) stops the main axis and the tool is withdrawn without stopping the spindle. The spindle stops when the tool is retracted, once it reaches the starting plane.

9.

CANNED CYCLES
G81. Drilling canned cycle

Options after tool withdrawal

Once the tool has been retracted, the user will have the following options:

- Finish the hole.
- Go to the next hole.
- Go into tool inspection.

After this, the CNC will display the following message:

"To end the cycle, press START to skip to the next SKIPCYCL".

Finish the hole:

To finish the hole, press the [START] key.

It goes down in G0 with spindle running to 1 mm before the coordinate where the hole stopped. From then on, it continues at the F and S programmed in the cycle.

Go to the next hole:

To go to the next hole, activate the PLC mark SKIPCYCL.

The CNC will display the following message:

"Press [START] to continue".

Pressing the [START] key, the CNC considers the cycle to be finished and continues with the next block.

Go into tool inspection

If you don't wish to finish the hole nor go to the next hole, it is possible to go into a standard tool inspection.

In this case, a block must be selected and a standard repositioning must be done before resuming the execution of the program.

After inspecting the tool, once repositioning is done, the following choices will be offered:

- Resume the interrupted cycle.
- Skip the interrupted cycle and resume at the next block.



CNC 8035


·M· MODEL
(SOFT V15.3x)

9.8 G82. Drilling canned cycle with dwell

This cycle drills at the point indicated until the final programmed coordinate is reached. Then it executes a dwell at the bottom of the drill hole.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G82 G98/G99 X Y Z I K

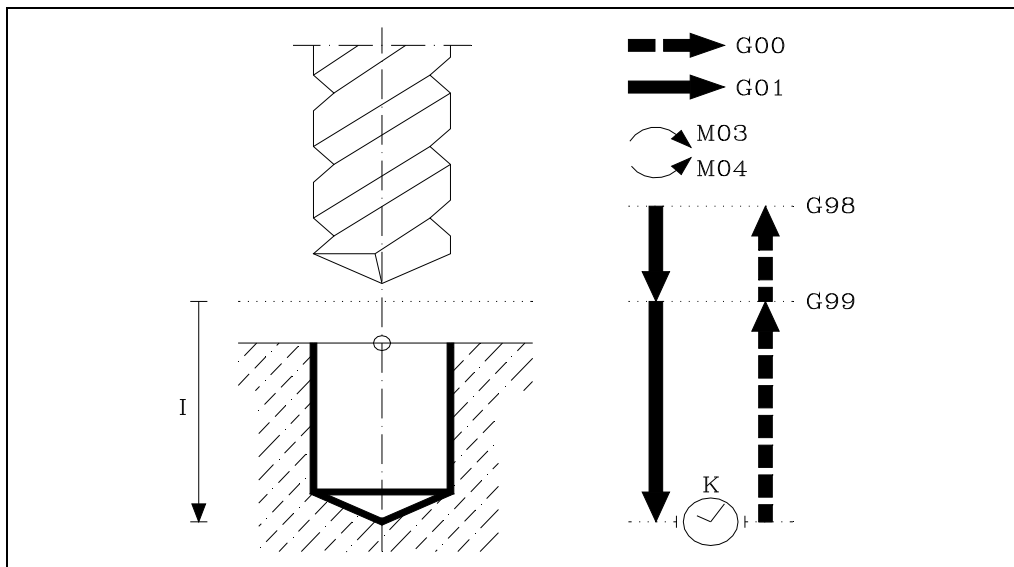

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been drilled.

G99 The tool withdraws to the Reference Plane, once the hole has been drilled.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Drilling depth.

Defines the total drilling depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the reference plane.

[K5] Dwell

Defines the dwell, in hundredths of a second, after each drilling until the withdrawal begins. Should this not be programmed, the CNC will take a value of K0.

9.

CANNED CYCLES
G82. Drilling canned cycle with dwell

FAGOR 


CNC 8035

-M- MODEL
(SOFT V15.3x)

9.8.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. Drill the hole. Movement of the longitudinal axis at work feedrate, to the bottom of the hole programmed in "I".
4. Dwell time K in hundredths of a second.
5. Withdrawal at rapid feedrate (G00) of the longitudinal axis to the initial or reference plane, depending on whether G98 or G99 has been programmed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

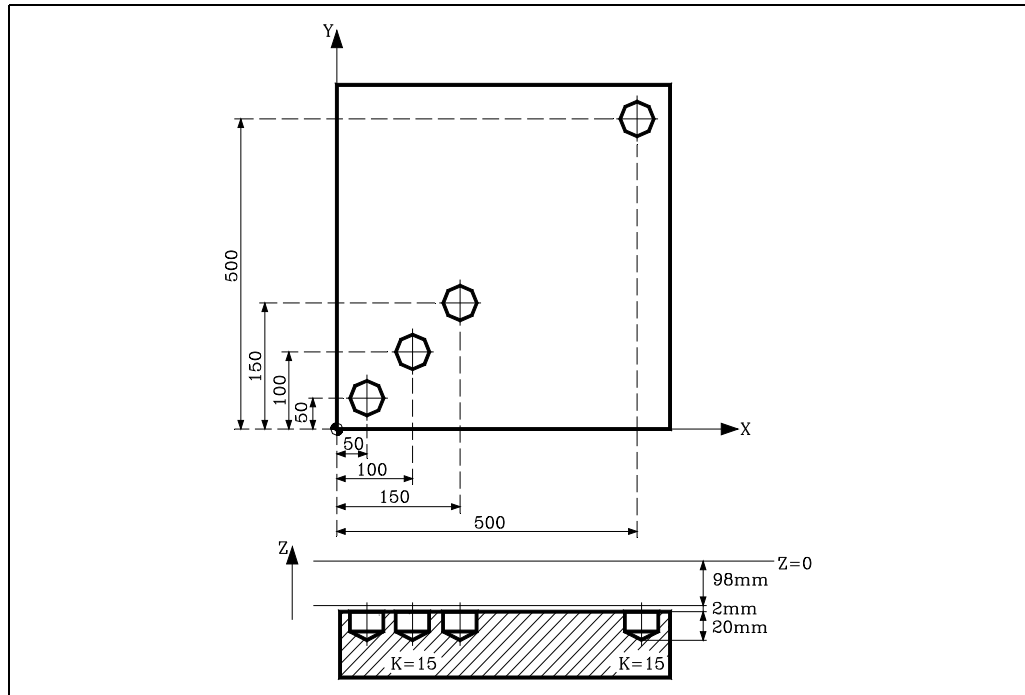

; Tool selection.

T1

M6

; Starting point.

G0 G90 X0 Y0 Z0

; Canned cycle definition. Three machining operations are carried out.

G82 G99 G91 X50 Y50 Z-98 I-22 K15 F100 S500 N3

; Positioning and canned cycle

G98 G90 G00 X500 Y500

; Cancels the canned cycle.

G80

; Positioning.

G90 X0 Y0

; End of program.

M30

9.

CANNED CYCLES

G82. Drilling canned cycle with dwell



CNC 8035

·M· MODEL
(SOFT V15.3x)

Tool withdrawal

While machining, the CNC lets withdraw the tool to the starting plane stopping the spindle when the tool reaches the starting plane.

Activating PLC mark RETRACYC (M5065) stops the main axis and the tool is withdrawn without stopping the spindle. The spindle stops when the tool is retracted, once it reaches the starting plane.

Options after tool withdrawal

Once the tool has been retracted, the user will have the following options:

- Finish the hole.
- Go to the next hole.
- Go into tool inspection.

After this, the CNC will display the following message:

"To end the cycle, press START to skip to the next SKIPCYCL".

Finish the hole:

To finish the hole, press the [START] key.

It goes down in G0 with spindle running to 1 mm before the coordinate where the hole stopped. From then on, it continues at the F and S programmed in the cycle.

Go to the next hole:

To go to the next hole, activate the PLC mark SKIPCYCL.

The CNC will display the following message:

"Press [START] to continue".

Pressing the [START] key, the CNC considers the cycle to be finished and continues with the next block.

Go into tool inspection

If you don't wish to finish the hole nor go to the next hole, it is possible to go into a standard tool inspection.

In this case, a block must be selected and a standard repositioning must be done before resuming the execution of the program.

After inspecting the tool, once repositioning is done, the following choices will be offered:

- Resume the interrupted cycle.
- Skip the interrupted cycle and resume at the next block.

9.

CANNED CYCLES
G82. Drilling canned cycle with dwell

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)


9.9 G83. Deep-hole drilling canned cycle with constant peck

This cycle makes successive drilling steps until the final coordinate is reached.

The tool withdraws as far as the reference plane after each drilling step.

Working in Cartesian coordinates, the basic structure of the block is as follows:

```
G83 G98/G99 X Y Z I J
```

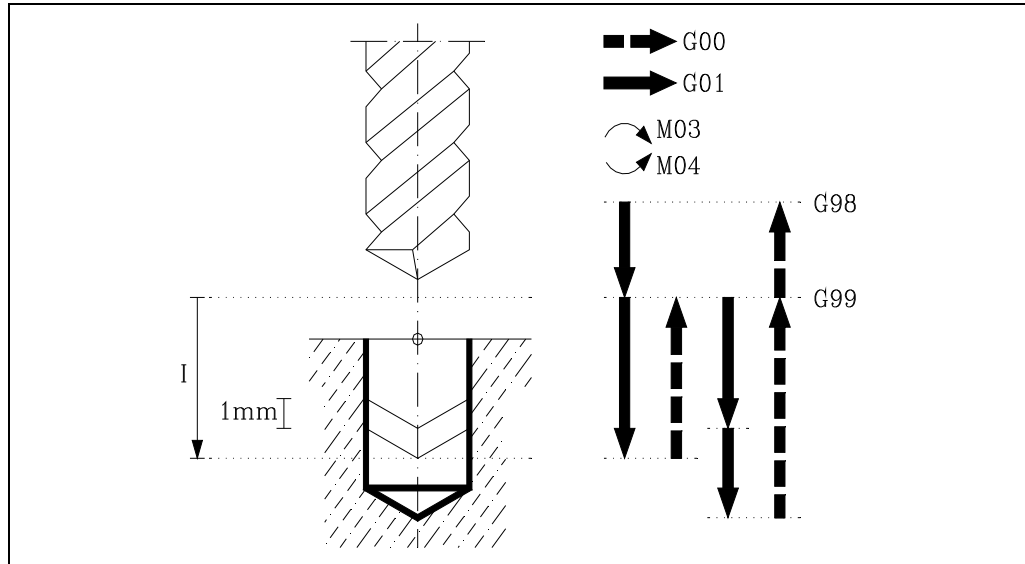

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been drilled.

G99 The tool withdraws to the Reference Plane, once the hole has been drilled.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.


If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Depth of each drilling peck

Defines the value of each drilling step according to the axis longitudinal to the main plane.

[J4] Drilling passes to withdraw to the starting plane

Defines the number of steps which the drill is to make. A value between 1 and 9999 may be programmed.

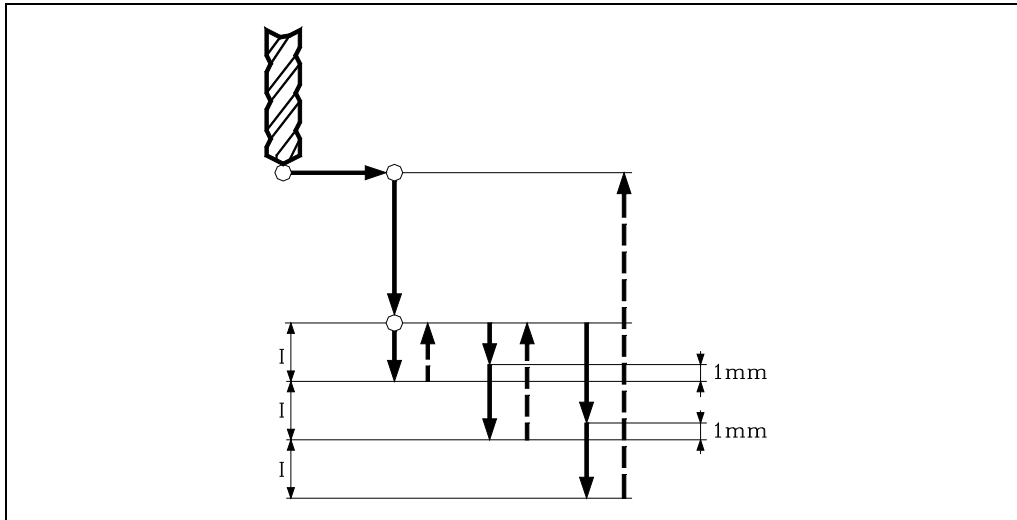

9.

CANNED CYCLES
G83. Deep-hole drilling canned cycle with constant peck



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.9.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. First drilling operation. The longitudinal axis moves in G01 to the programmed incremental depth "I".
4. Drilling loop. The following steps will be repeated "J-1" times as in the previous step the first programmed drilling was done.
 - .1- Withdrawal of the longitudinal axis in rapid (G00) to the reference plane.
 - .2- Longitudinal axis approach in rapid (G00):
 - If $INPOSW2 < INPOSW1$, down to 1mm off the previous drilling peck.
 - If not, down to twice the value of $INPOSW2$.
 - .3- New drilling step. G01 movement of the longitudinal axis to the incremental depth programmed in "I".
 - If $INPOSW2=0$ in G7. If not, in G50.
5. Withdrawal at rapid feedrate (G00) of the longitudinal axis to the initial or reference plane, depending on whether G98 or G99 has been programmed.


The first drilling penetration is done in G07 or G50 depending on the value assigned to the parameter of the longitudinal axis "INPOSW2 (P51)" and to parameter "INPOSW1 (P19)". This is important to join a drilling operation with another one in multiple drilling so the tool path is faster and smoother.

If $INPOSW2 < INPOSW1$ in G07 (square corner).

If $INPOSW2 \geq INPOSW1$ in G50 (controlled round corner).

If a scaling factor is applied to this cycle, drilling will be performed proportional to that programmed, with the same step "I" programmed, but varying the number of steps "J".

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

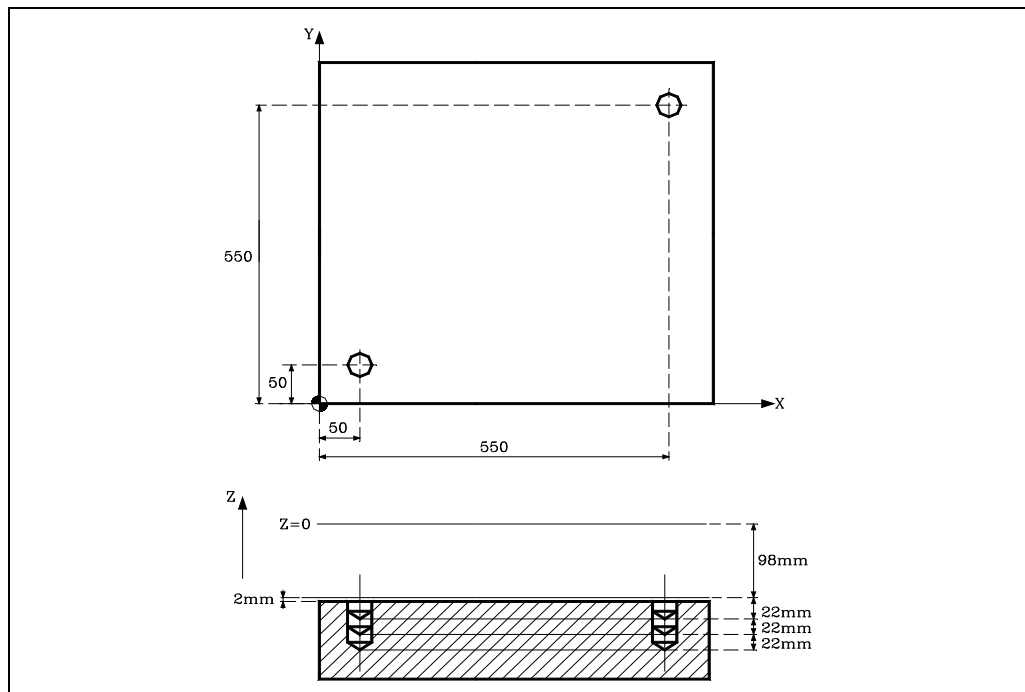

9.

CANNED CYCLES
G83. Deep-hole drilling canned cycle with constant peck



CNC 8035

.M. MODEL
(SOFT V15.3x)


```

; Tool selection.
T1
M6

; Starting point.
G0 G90 X0 Y0 Z0

; Canned cycle definition.
G83 G99 X50 Y50 Z-98 I-22 J3 F100 S500 M4

; Positioning and canned cycle
G98 G90 G00 X500 Y500

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30

```

Tool withdrawal

While machining, the CNC lets withdraw the tool to the starting plane stopping the spindle when the tool reaches the starting plane.

Activating PLC mark RETRACYC (M5065) stops the main axis and the tool is withdrawn without stopping the spindle. The spindle stops when the tool is retracted, once it reaches the starting plane.

Options after tool withdrawal

Once the tool has been retracted, the user will have the following options:

- Finish the hole.
- Go to the next hole.
- Go into tool inspection.

After this, the CNC will display the following message:

"To end the cycle, press START to skip to the next SKIPCYCL".

Finish the hole:

To finish the hole, press the [START] key.

It goes down in G0 with spindle running to 1 mm before the coordinate where the hole stopped. From then on, it continues at the F and S programmed in the cycle.

Go to the next hole:

To go to the next hole, activate the PLC mark SKIPCYCL.

The CNC will display the following message:

"Press [START] to continue".

Pressing the [START] key, the CNC considers the cycle to be finished and continues with the next block.

9.

CANNED CYCLES

G83. Deep-hole drilling canned cycle with constant peck


FAGOR

CNC 8035

 ·M· MODEL
 (SOFT V15.3x)

Go into tool inspection

If you don't wish to finish the hole nor go to the next hole, it is possible to go into a standard tool inspection.

In this case, a block must be selected and a standard repositioning must be done before resuming the execution of the program.

After inspecting the tool, once repositioning is done, the following choices will be offered:

- Resume the interrupted cycle.
- Skip the interrupted cycle and resume at the next block.

9.

CANNED CYCLES

G83. Deep-hole drilling canned cycle with constant peck



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.10 G84. Tapping canned cycle

This cycle taps at the point indicated until the final programmed coordinate is reached. General logic output "TAPPING" (M5517) stays active while executing this cycle.


Due to the fact that the tapping tool turns in two directions (one when tapping and the other when withdrawing from the thread), by means of the machine parameter of the spindle "SREVM05" it is possible to select whether the change in turning direction is made with the intermediate spindle stop, or directly.

General machine parameter "STOPAP(P116)" indicates whether general inputs /STOP, /FEEDHOL and /XFERINH are enabled or not while executing function G84.

It is possible to program a dwell before each reversal of the spindle turning direction, i.e., at the bottom of the thread hole and when returning to the reference plane.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G84 G98/G99 X Y Z I K R J

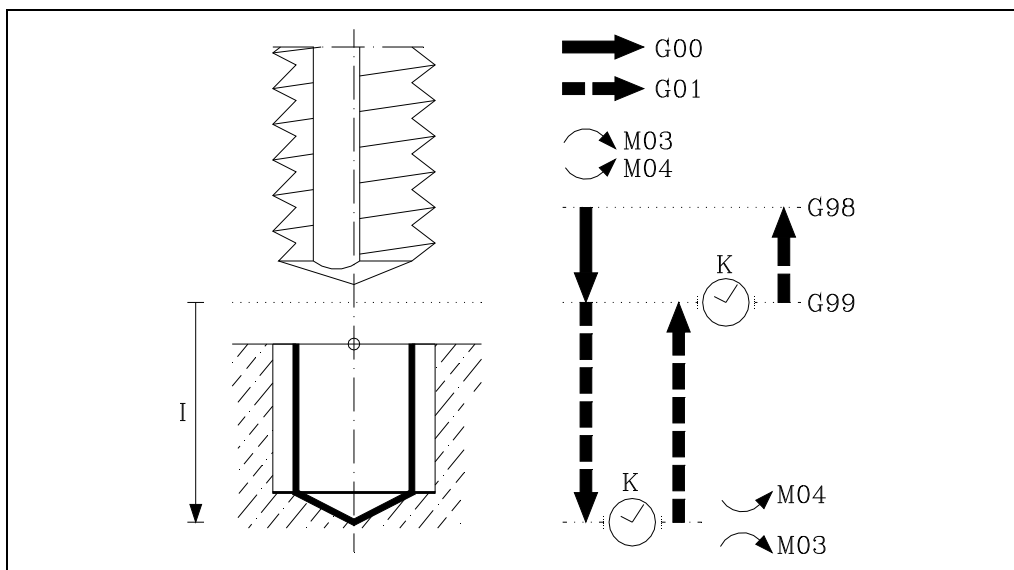

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has tapped.

G99 The tool withdraws to the Reference Plane, once the hole has tapped.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Thread depth.

Defines tapping depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the reference plane.

[K5] Dwell

Defines the dwell, in hundredths of a second, after the tapping until the withdrawal begins. If not programmed, the CNC will take the value of "K0".

9.

CANNED CYCLES
G84. Tapping canned cycle

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

[R] Type of tapping

Defines the type of tapping to be carried out.

- R0 Regular tapping.
- R1 Rigid tapping. The CNC stops the spindle with M19 and orients it to begin tapping.
- R2 Rigid tapping. If the spindle is turning in M3 or M4, the CNC does not stop it nor orient it to begin tapping. This option does not allow thread repair, even if the part has not been released because the thread start (entry) will coincide with the one machined earlier.

[J5.5] Withdrawal feedrate factor

When rigid tapping, the returning feedrate will be J times the tapping feedrate. When not programmed or programmed J1, they will both be the same.

In order to execute a rigid tapping, the spindle must be ready to operate in closed loop; in other words, that it must have a servo drive-motor system with rotary encoder.

When rigid tapping, the CNC interpolates the movement of the longitudinal axis with the spindle rotation.

9.

CANNED CYCLES
G84. Tapping canned cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.10.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. Movement of the longitudinal axis and at the working feedrate, to the bottom of the machined section, producing the threaded hole. The canned cycle will execute this movement and all later movements at 100% of F feedrate and the programmed S speed.


If rigid tapping is selected (parameter R=1), the CNC will activate the general logic output "RIGID" (M5521) to indicate to the PLC that a rigid tapping block is being executed.

4. Spindle stop (M05). This will only be performed when the spindle machine parameter "SREVM05" is selected and parameter "K" has a value other than "0"..
5. Dwell, if parameter "K" has been programmed.
6. Reverse the spindle turning direction.
7. Withdrawal, at J times the working feedrate, of the longitudinal axis to the reference plane. Once this coordinate has been reached, the canned cycle will assume the selected FEEDRATE OVERRIDE and the SPINDLE OVERRIDE.

If rigid tapping is selected (parameter R=1), the CNC will activate the general logic output "RIGID" (M5521) to indicate to the PLC that a rigid tapping block is being executed.

8. Spindle stop (M05). This will only be performed if the spindle machine parameter "SREVM05" is selected.
9. Dwell, if parameter "K" has been programmed.
10. Reverse the spindle turning direction restoring the initial turning direction.
11. Withdrawal, at rapid feedrate (G00), of the longitudinal axis as far as the initial plane if G98 has been programmed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

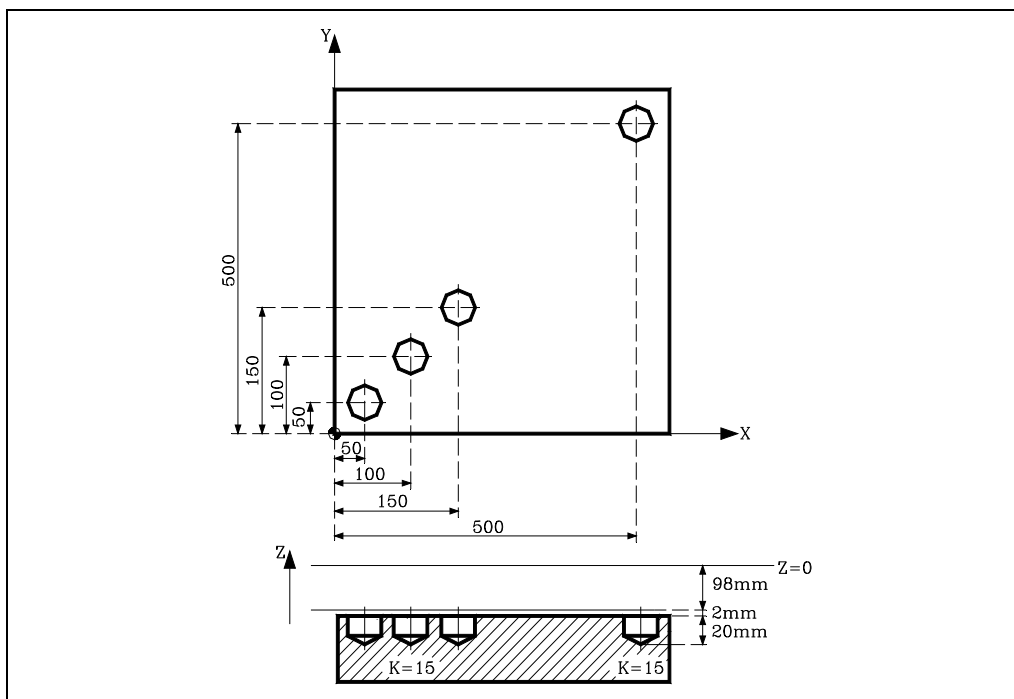

9.

CANNED CYCLES
G84. Tapping canned cycle



CNC 8035

M- MODEL
(SOFT V15.3x)

9.

CANNED CYCLES G84. Tapping canned cycle

```

; Tool selection.
T1
M6

; Starting point.
G0 G90 X0 Y0 Z0

; Canned cycle definition. Three machining operations are carried out.
G84 G99 G91 X50 Y50 Z-98 I-22 K150 F350 S500 N3

; Positioning and canned cycle
G98 G90 G00 X500 Y500

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

Tool withdrawal

While machining, the CNC lets withdraw the tool to the starting plane stopping the spindle when the tool reaches the starting plane.

Activating PLC mark RETRACYC (M5065) stops the main axis and the spindle, the tool is withdrawn changing the direction of the axis and spindle while keeping the machining F and S values.

The stopping and starting sequence of the spindle and the axis when tapping keeps the same synchronism and dwells as during the execution of the canned cycle.

Options after tool withdrawal

Once the tool has been retracted, the user will have the following options:

- Finish the hole.
- Go to the next hole.
- Go into tool inspection.

After this, the CNC will display the following message:

"To end the cycle, press START to skip to the next SKIPCYCL".

Finish the hole:

To finish the hole, press the [START] key.

The hole is repeated from the starting plane under the same F and S conditions without stopping at the point where it stopped.

Go to the next hole:

To go to the next hole, activate the PLC mark SKIPCYCL.

The CNC will display the following message:

"Press [START] to continue".

Pressing the [START] key, the CNC considers the cycle to be finished and continues with the next block.

Go into tool inspection

If you don't wish to finish the hole nor go to the next hole, it is possible to go into a standard tool inspection.

In this case, a block must be selected and a standard repositioning must be done before resuming the execution of the program.

After inspecting the tool, once repositioning is done, the following choices will be offered:

- Resume the interrupted cycle.
- Skip the interrupted cycle and resume at the next block.

9.**CANNED CYCLES**
G84. Tapping canned cycle**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)


9.11 G85. Reaming canned cycle

This cycle reams at the point indicated until the final programmed coordinate is reached.

It is possible to program a dwell at the bottom of the machined hole.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G85 G98/G99 X Y Z I K

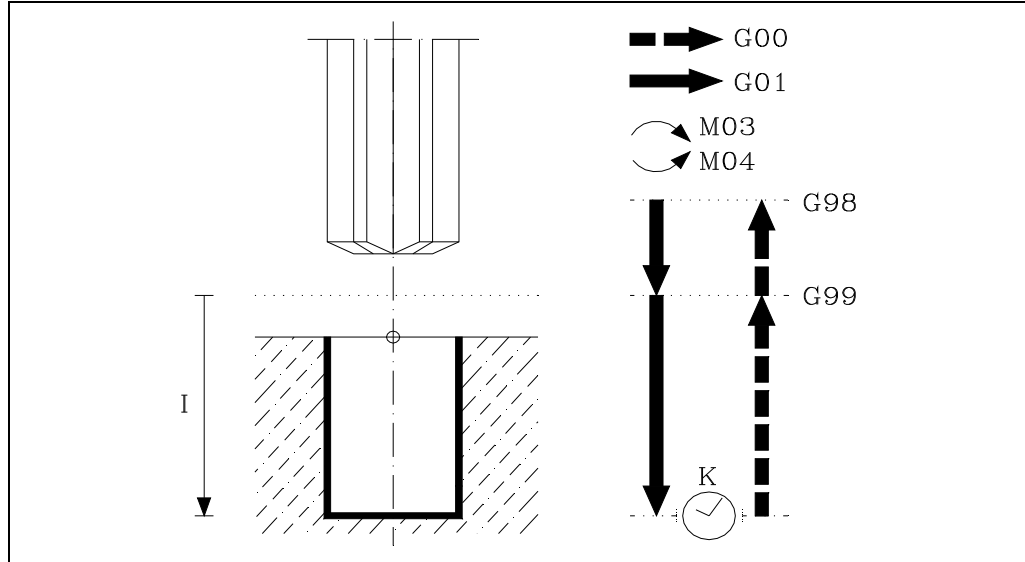

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been reamed.

G99 The tool withdraws to the Reference Plane, once the hole has been reamed.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Reaming depth.

Defines reaming depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the reference plane.

[K5] Dwell

Defines the dwell, in hundredths of a second, after the reaming until the withdrawal begins. If not programmed, the CNC will take the value of "K0".

9.

CANNED CYCLES
G85. Reaming canned cycle

9.11.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. Movement at the working feedrate (G01) of the longitudinal axis to the bottom of the machined hole, and reaming.
4. Dwell, if parameter "K" has been programmed.
5. Withdrawal at working feedrate, of the longitudinal axis as far as the reference plane.
6. Withdrawal, at rapid feedrate (G00), of the longitudinal axis as far as the initial plane if G98 has been programmed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

```

; Tool selection.
T1
M6

; Starting point.
G0 G90 X0 Y0 Z0

; Canned cycle definition.
G85 G98 G91 X250 Y350 Z-98 I-22 F100 S500

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

9.

CANNED CYCLES
G85. Reaming canned cycle


9.12 G86. Boring cycle with withdrawal in G00

This cycle bores at the point indicated until the final programmed coordinate is reached. It is possible to program a dwell at the bottom of the machined hole.

After the quill has penetrated, it is possible to orient the spindle and retract the quill before the exit movement, thus preventing the part from scratching. This is only available when using spindle orientation.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G86 G98/G99 X Y Z I K Q D E

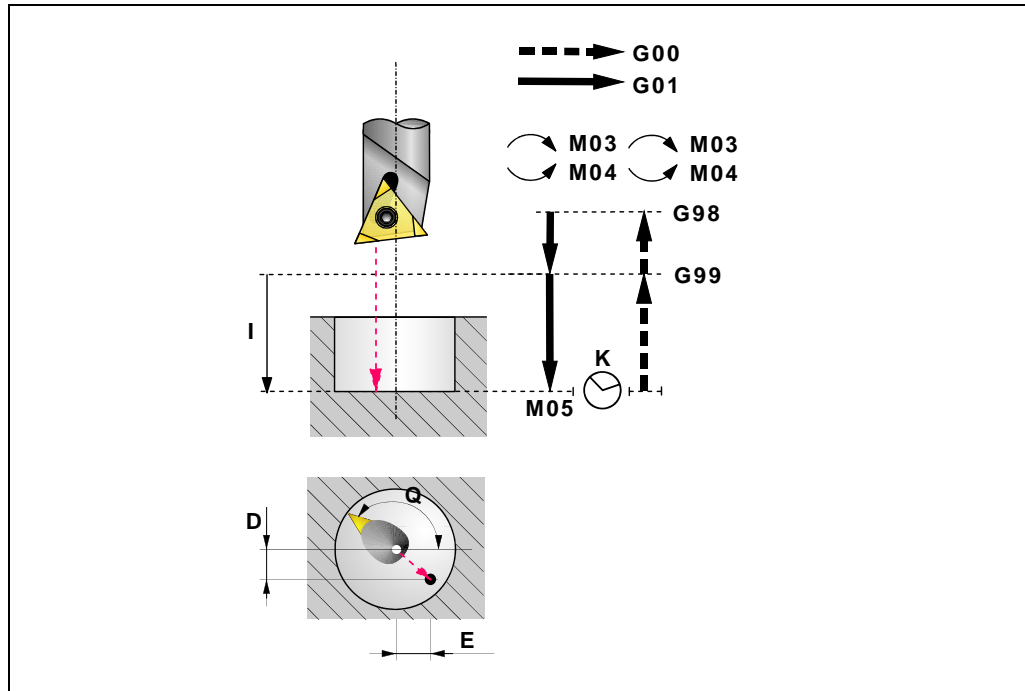

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been bored.

G99 The tool withdraws to the Reference Plane, once the hole has been bored.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Reaming depth.

Defines boring depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the reference plane.

[K5] Dwell

Defines the dwell, in hundredths of a second, after boring until the withdrawal begins. If not programmed, the CNC will take the value of "K0".

9.

CANNED CYCLES
G86. Boring cycle with withdrawal in G00



CNC 8035

·M· MODEL
(SOFT V15.3x)

[Q±5.5] Spindle position for the withdrawal

Defines the spindle position in degrees, to separate the cutter from the wall of the hole.

If not programmed, the withdrawal will be done without separating the cutter from the wall of the hole, with the spindle stopped and at rapid feedrate.

[D±5.5] Gap between the cutter and the wall of the hole on the X axis

Defines the gap between the cutter and the wall of the hole on the X axis for the withdrawal.

If not programmed there will be no gap between the cutter and the wall of the hole on the X axis.

Both Q and D must be programmed for the cutter to separate from the wall of the hole.

[E±5.5] Gap between the cutter and the wall of the hole on the Y axis

Defines the gap between the cutter and the wall of the hole on the Y axis for the withdrawal.

If not programmed there will be no gap between the cutter and the wall of the hole on the Y axis.

Both Q and E must be programmed for the cutter to separate from the wall of the hole.

9.

CANNED CYCLES

G86. Boring cycle with withdrawal in G00



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.12.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. Movement at the working feedrate (G01) of the longitudinal axis to the bottom of the machined hole, and boring.
4. Dwell, if parameter "K" has been programmed.
5. Spindle orientation to the position programmed in parameter Q.
6. Tool movement in a slow interpolated movement, the distances programmed in parameters D and E. If proper values are not programmed, the cutter could run into the wall instead of separating from it.
7. Rapid tool withdrawal (G00) to the initial plane or reference plane, depending on whether G98 or G99 has been programmed.
8. Rapid interpolated tool movement in the amounts programmed in parameters D and E, but in the opposite direction (undoing the movement made in step 6).
9. When spindle withdrawal has been completed, it will start in the same direction in which it was turning before.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

```

; Tool selection.
T1
M6

; Starting point.
G0 G90 X0 Y0 Z0

; Canned cycle definition.
G86 G98 G91 X250 Y350 Z-98 I-22 K20 F100 S500

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30

```

9.

CANNED CYCLES
G86. Boring cycle with withdrawal in G00



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.13 G87. Rectangular pocket canned cycle.


This cycle executes a rectangular pocket at the point indicated until the final programmed coordinate is reached.

It is possible to program, in addition to milling pass and feedrate, a final finishing step with its corresponding milling feedrate.

In order to obtain a good finish in the machining of the pocket walls, the CNC will apply a tangential entry and exit to the last milling step during each cutting operation.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G87 G98/G99 X Y Z I J K B C D H L V

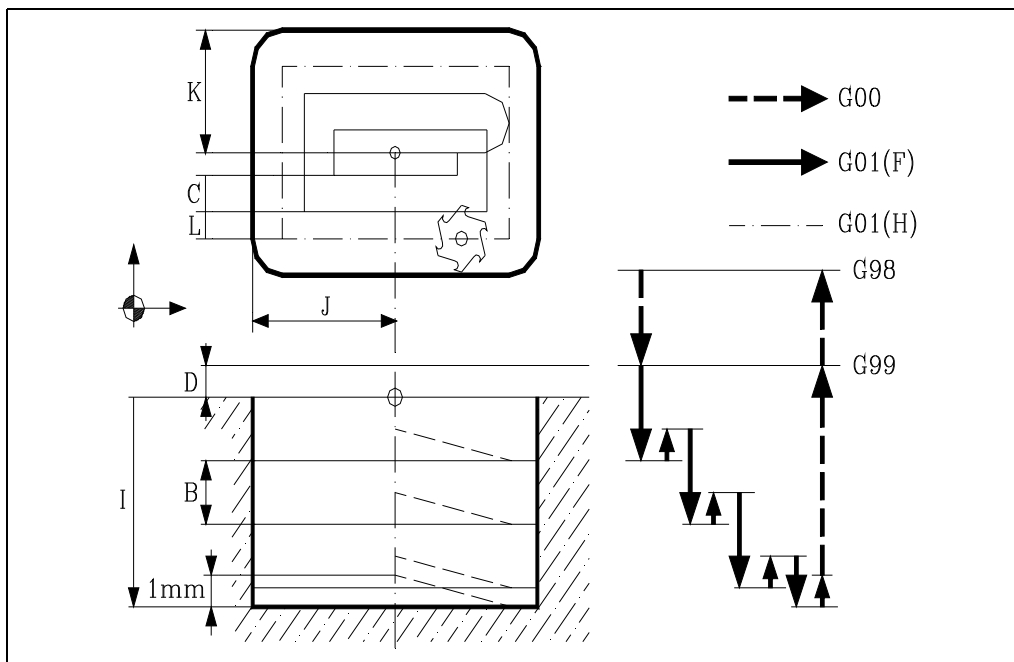

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the pocket has been made.

G99 The tool withdraws to the Reference Plane, once the pocket has been made.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate.

When programmed in absolute coordinates, it will be referred to the part zero and when programmed in incremental coordinates, it will be referred to the starting plane (P.P.).

If not programmed, it assumes as reference plane the current position of the tool. Thus, the starting plane (P.P.) and the reference plane (P.R.) will be the same.

9.

CANNED CYCLES

G87. Rectangular pocket canned cycle.


FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

9.

CANNED CYCLES
G87. Rectangular pocket canned cycle.

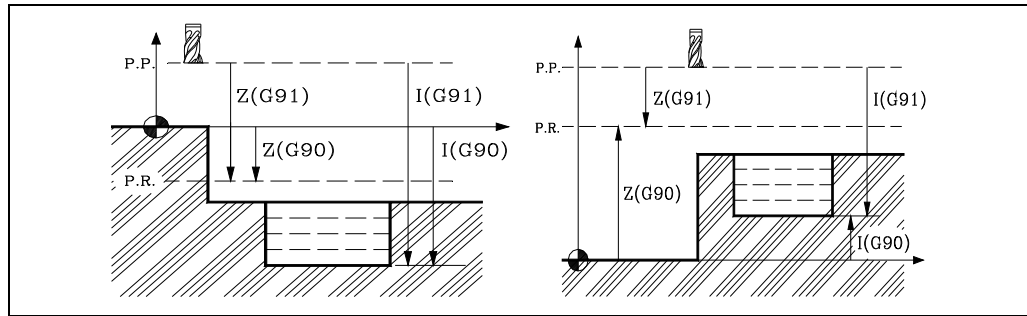


[I±5.5] Machining depth.

Defines the machining depth.

When programmed in absolute coordinates, it will be referred to the part zero and when programmed in incremental coordinates, it will be referred to the starting plane (P.P.).


[J±5.5] Half the width of the pocket along the abscissa axis

Defines the distance from the center to the edge of the pocket according to the abscissa axis. The sign indicates the pocket machining direction.

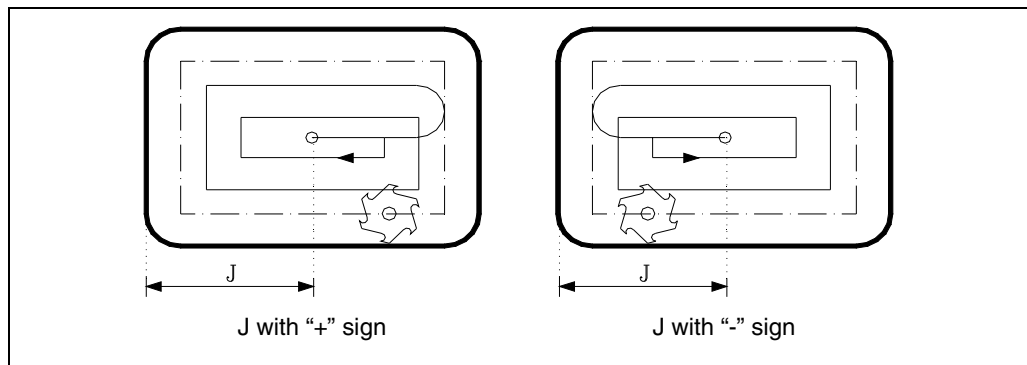

[K5.5] Half the width of the pocket along the ordinate axis

Defines the distance from the center to the edge of the pocket according to the ordinate axis.

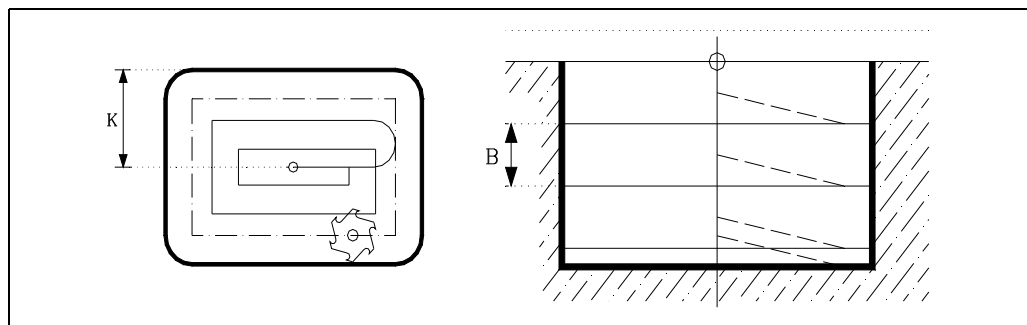

[B±5.5] Penetration step

Defines the cutting depth according to the longitudinal axis.

If this is programmed with a positive sign, the entire cycle will be executed with the same machining pass, this being equal to or less than that programmed.

If programmed with a negative sign, the whole pocket is machined with the given pass (step) except the last pass that machines the rest.



CNC 8035


-M- MODEL
(SOFT V15.3x)

[C±5.5] Milling pass

Defines the milling pass along the main plane.

If the value is positive, the entire cycle will be executed with the same milling step, this being equal to or less than that programmed.

If the value is negative, the entire pocket will be executed with the given step, except for the last step which will machine whatever remains.

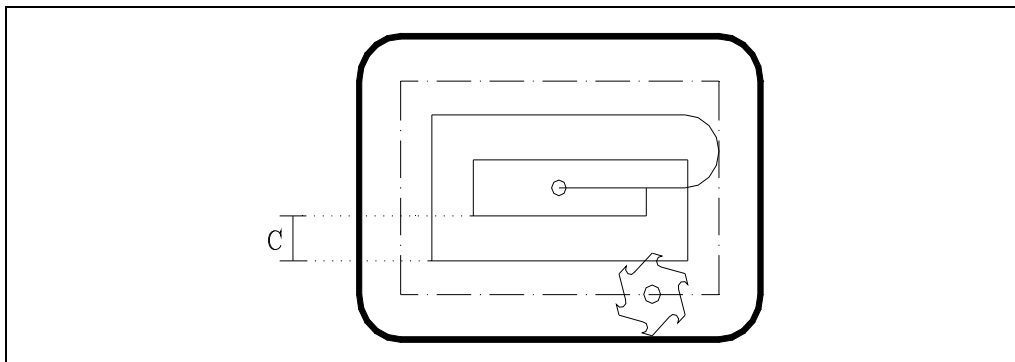

If not programmed, it assumes a value of 3/4 of the diameter of the selected tool.


If programmed with a value greater than the tool diameter, the CNC issues the relevant error message.

If programmed with a 0 value, the CNC will display the corresponding error message.

[D5.5] Reference plane

Defines the distance between the reference plane and the surface of the part where the pocket is to be made.

During the first deepening operation this amount will be added to incremental depth "B". If not programmed, a value of 0 is assumed.

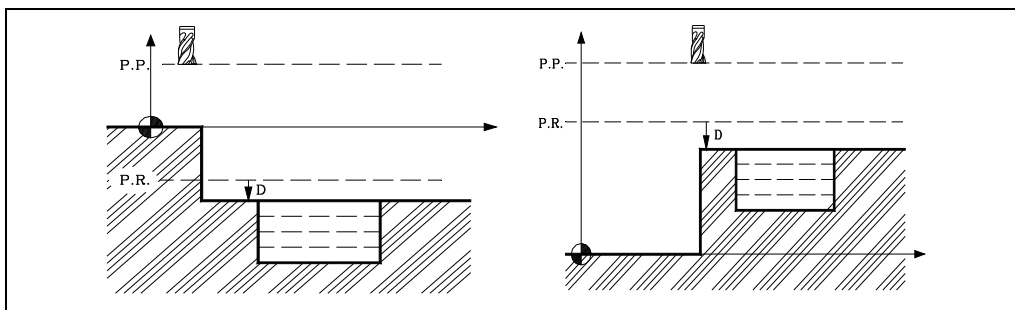

[H.5.5] Feedrate for the finishing pass

Defines the working feedrate during the finishing pass.

If not programmed or programmed with a 0 value, it assumes the value of the machining feedrate.

9.

CANNED CYCLES

G87. Rectangular pocket canned cycle.



CNC 8035


·M· MODEL
(SOFT V15.3x)

[L±5.5] Finishing stock.

Defines the value of the finishing pass, along the main plane.

If the value is positive, the finishing pass is made on a square corner (G07).

If the value is negative, the finishing pass is made on a rounded corner (G05).

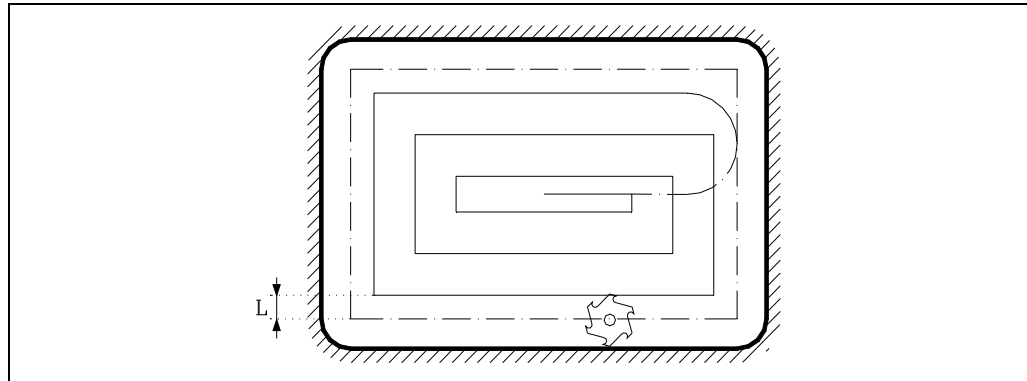

If not programmed or programmed with a 0 value, it does not run the finishing pass.

[V.5.5] Tool penetrating feedrate.

Defines the tool penetrating feedrate.

If not programmed or programmed with a 0 value, it assumes 50% of the feedrate in the plane (F).


9.

CANNED CYCLES


G87. Rectangular pocket canned cycle.

9.13.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement (G0) of the longitudinal axis from the starting plane to the reference plane.
3. First penetrating operation. Movement of longitudinal axis at the feedrate indicated by "V" to the incremental depth programmed in "B+D".
4. Milling of the pocket surface at work feedrate in the passes defined by "C" up to a distance "L" (finishing pass) from the pocket wall.
5. Finishing pass milling, "L" at the work feedrate defined by "H".
6. Once the finishing pass has been completed, the tool withdraws at the rapid feedrate (G00) to the center of the pocket, the longitudinal axis being separated 1 mm (0.040 inch) from the machined surface.

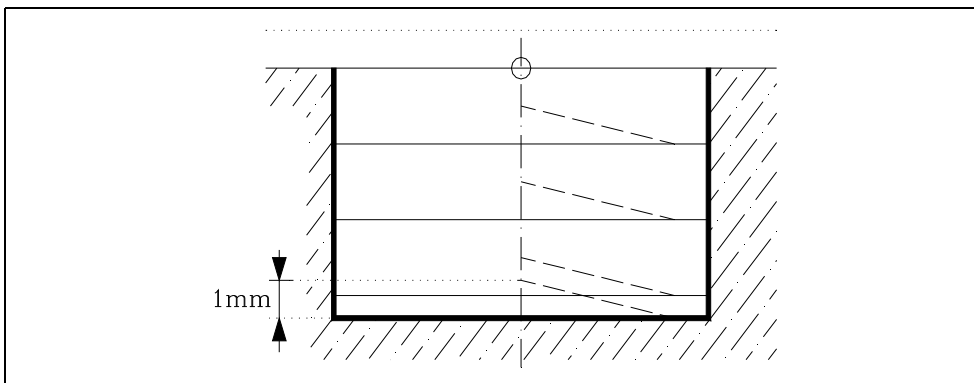

7. New milling surfaces until reaching the total depth of the pocket.
 - 1- Movement of the longitudinal axis at the feedrate indicated by "V", up to a distance "B" from the previous surface.
 - 2- Milling of the new surface following the steps indicated in points 4, 5 and 6.
8. Withdrawal at rapid feedrate (G00) of the longitudinal axis to the initial or reference plane, depending on whether G98 or G99 has been programmed.

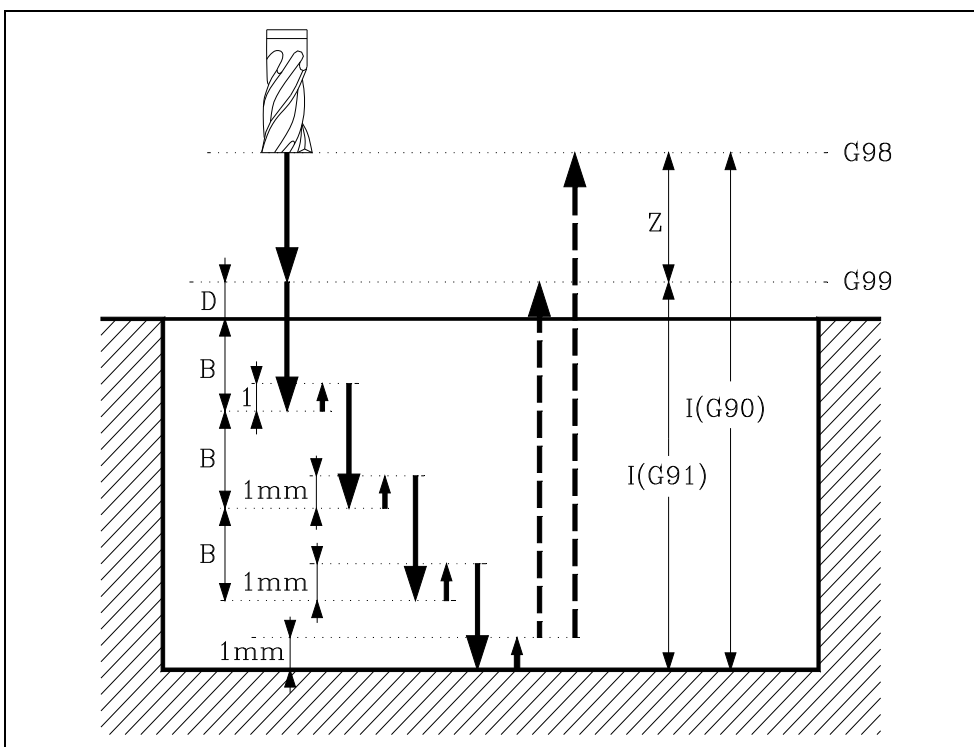

9.

CANNED CYCLES

G87. Rectangular pocket canned cycle.

FAGOR 

CNC 8035


-M- MODEL
(SOFT V15.3x)

Programming example ·1·

Let us suppose a work plane formed by the X and Y axis, Z being the longitudinal axis and the starting point X0 Y0 Z0.

9.

CANNED CYCLES
G87. Rectangular pocket canned cycle.

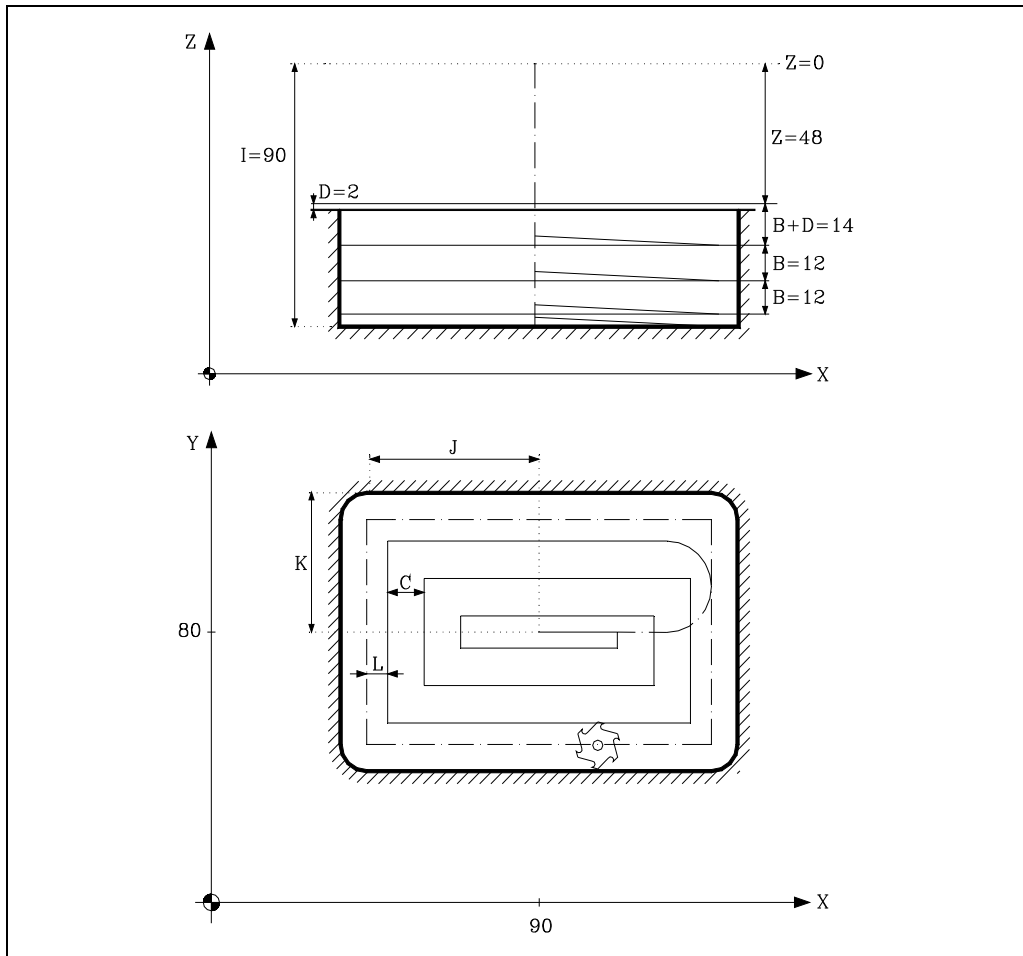

```

; Tool selection.
(TOR1=6, TOI1=0)
T1 D1
M6

; Starting point
G0 G90 X0 Y0 Z0

; Canned cycle definition
G87 G98 X90 Y60 Z-48 I-90 J52.5 K37.5 B12 C10 D2 H100 L5 V100 F300 S1000
M03

; Cancels the canned cycle
G80

; Positioning
G90 X0 Y0

; End of program
M30
    
```




CNC 8035

·M· MODEL
(SOFT V15.3x)

Programming example -2-

Let us suppose a work plane formed by the X and Y axis, Z being the longitudinal axis and the starting point X0 Y0 Z0.

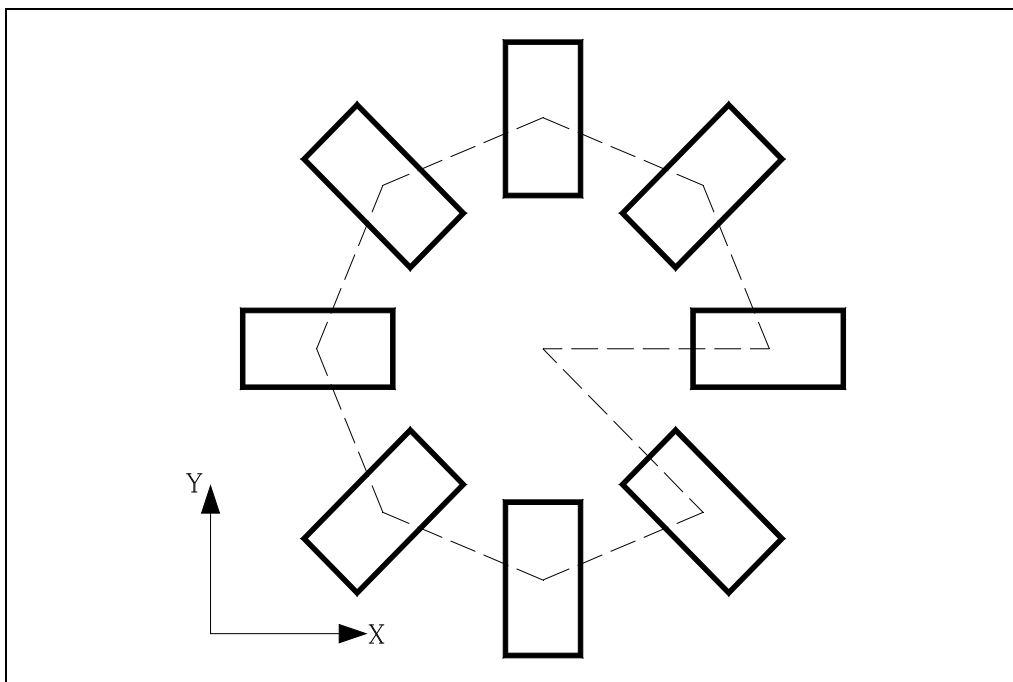

```

; Tool selection.
(TOR1=6, TOI1=0)
T1 D1
M6

; Starting point
G0 G90 X0 Y0 Z0

; Work plane.
G18

; Canned cycle definition
N10 G87 G98 X200 Y-48 Z0 I-90 J52.5 K37.5 B12 C10 D2 H100 L5 V50 F300

; Coordinate rotation
N20 G73 Q45

; Repeats the select blocks 7 times.
(RPT N10,N20) N7

; Cancels the canned cycle.
G80

; Positioning
G90 X0 Y0

; End of program
M30
    
```

9.

CANNED CYCLES

G87. Rectangular pocket canned cycle.



CNC 8035

·M· MODEL
(SOFT V15.3x)


9.14 G88. Circular pocket canned cycle

This cycle executes a circular pocket at the point indicated until the final programmed coordinate is reached.

It is possible to program, in addition to milling pass and feedrate, a final finishing step with its corresponding milling feedrate.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G88 G98/G99 X Y Z I J B C D H L V

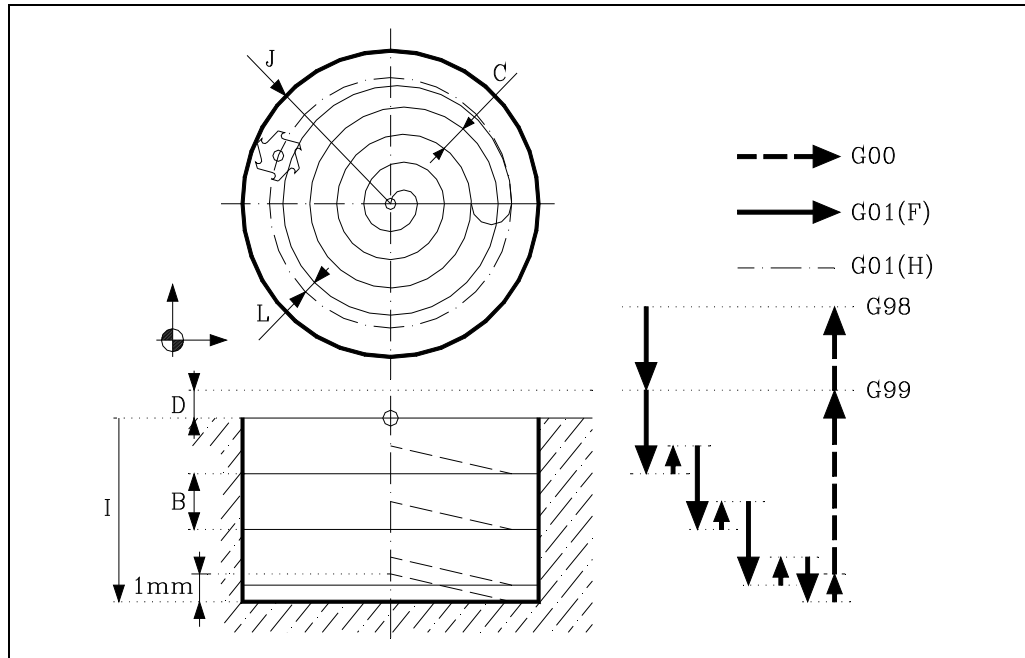

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the pocket has been made.

G99 The tool withdraws to the Reference Plane, once the pocket has been made.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate.

It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the starting plane. If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Machining depth.

Defines the machining depth. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the reference plane.

9.

CANNED CYCLES
G88. Circular pocket canned cycle




CNC 8035

·M· MODEL
(SOFT V15.3x)

[J±5.5] Pocket radius


Defines the radius of the pocket. The sign indicates the pocket machining direction.

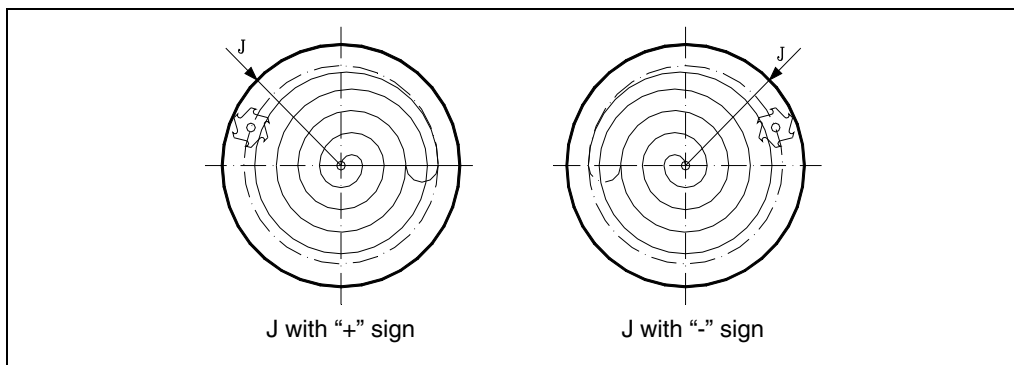

[B±5.5] Penetration step

Defines the cutting pass along the longitudinal axis to the main plane.

- If this value is positive, the entire cycle will be executed with the same machining pass, this being equal to or less than that programmed.
- If the value is negative, the entire pocket will be executed with the given step, except for the last step which will machine whatever remains.

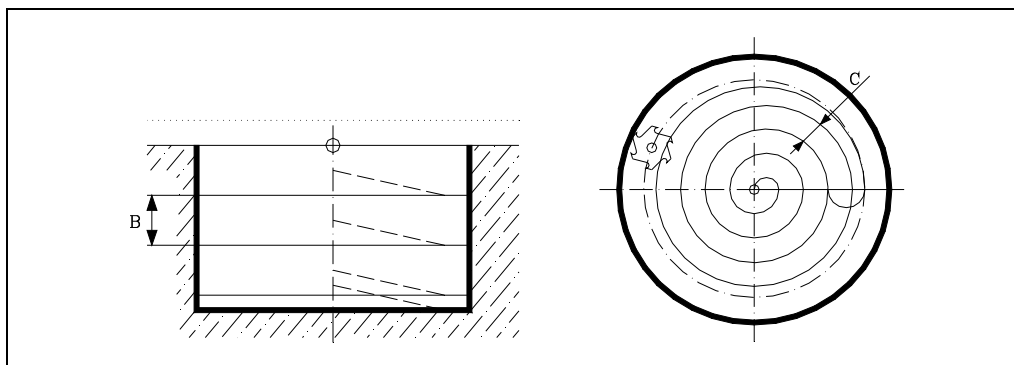

[C±5.5] Milling pass

Defines the milling pass along the main plane.

- If the value is positive, the entire cycle will be executed with the same milling step, this being equal to or less than that programmed.
- If the value is negative, the entire pocket will be executed with the given step, except for the last step which will machine whatever remains.

If not programmed, it assumes a value of 3/4 of the diameter of the selected tool.

If programmed with a value greater than the tool diameter, the CNC issues the relevant error message.

If programmed with a 0 value, the CNC will display the corresponding error message.

9.

CANNED CYCLES
G88. Circular pocket canned cycle




CNC 8035

·M· MODEL
(SOFT V15.3x)

[D5.5] Reference plane

Defines the distance between the reference plane and the surface of the part where the pocket is to be made.

During the first deepening operation this amount will be added to incremental depth "B". If not programmed, a value of 0 is assumed.

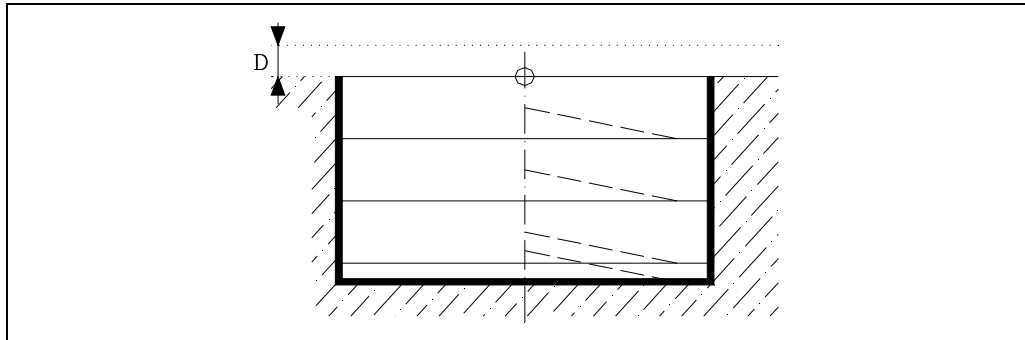

[H5.5] Feedrate for the finishing pass


Defines the working feedrate during the finishing pass.

If not programmed or programmed with a 0 value, it assumes the value of the machining feedrate.

[L5.5] Finishing stock.

Defines the value of the finishing pass, along the main plane.

If not programmed or programmed with a 0 value, it does not run the finishing pass.

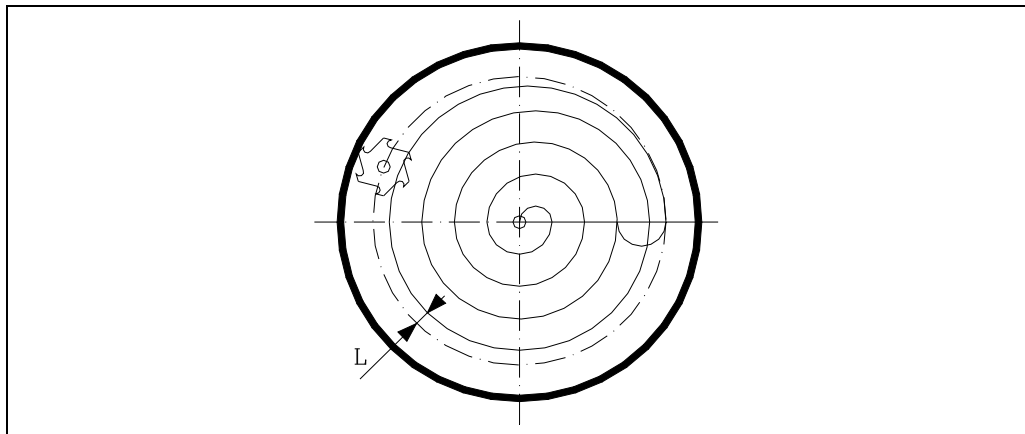

9.

CANNED CYCLES
G88. Circular pocket canned cycle




CNC 8035

·M· MODEL
(SOFT V15.3x)

[V.5.5] Tool penetrating feedrate.

Defines the tool penetrating feedrate.

If not programmed or programmed with a 0 value, it assumes 50% of the feedrate in the plane (F).

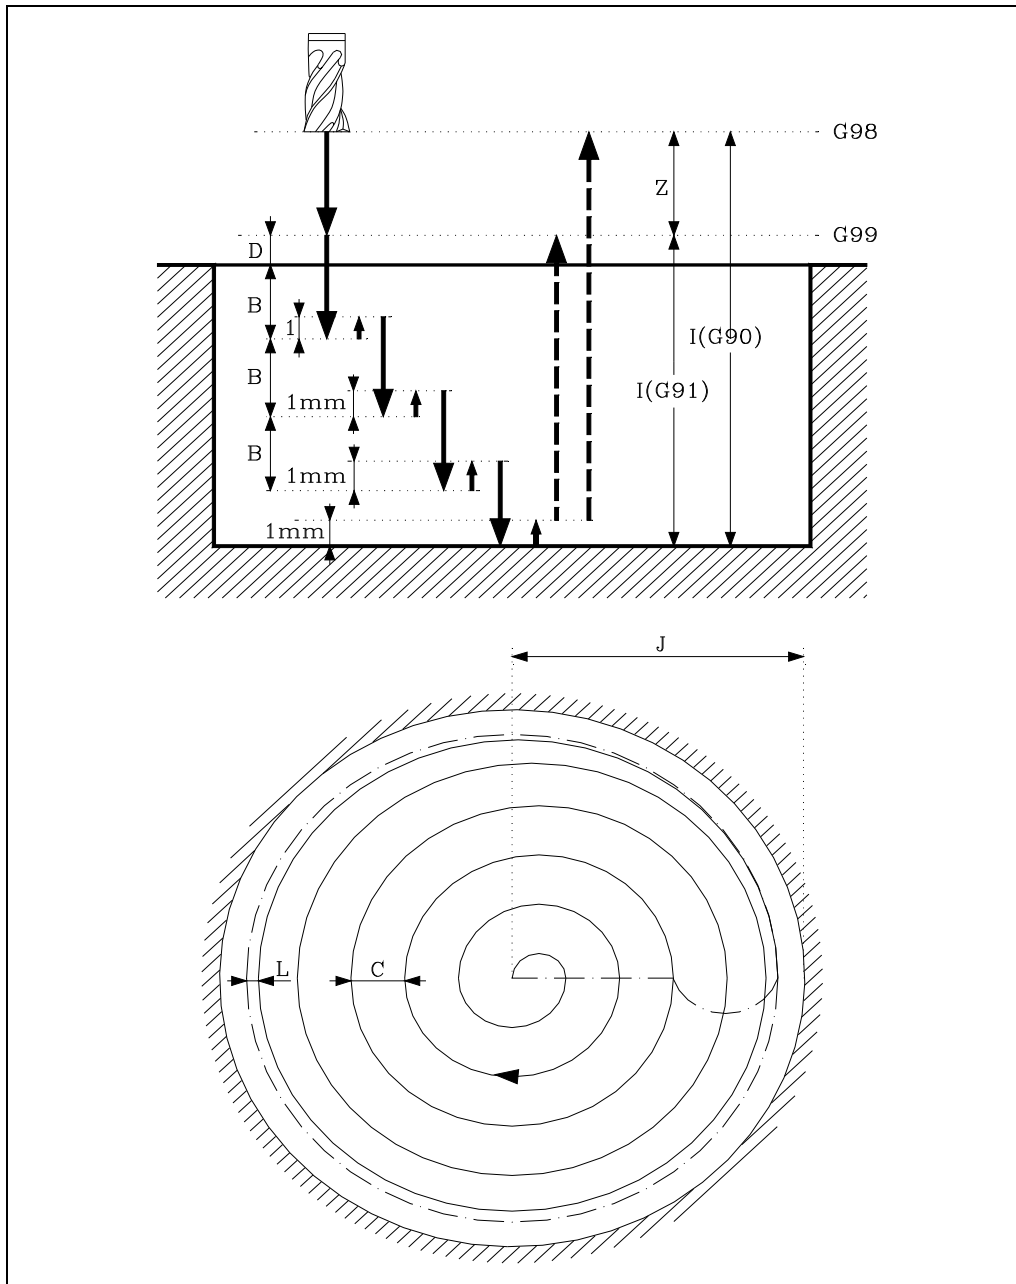


9.

CANNED CYCLES
G88. Circular pocket canned cycle

9.14.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction.
If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement (G0) of the longitudinal axis from the starting plane to the reference plane.
3. First penetrating operation. Movement of longitudinal axis at the feedrate indicated by "V" to the incremental depth programmed in "B+D".
4. Milling of the pocket surface at work feedrate in the passes defined by "C" up to a distance "L" (finishing pass) from the pocket wall.
5. Finishing pass milling, "L" at the work feedrate defined by "H".
6. Once the finishing pass has been completed, the tool withdraws at the rapid feedrate (G00) to the center of the pocket, the longitudinal axis being separated 1 mm (0.040 inch) from the machined surface.

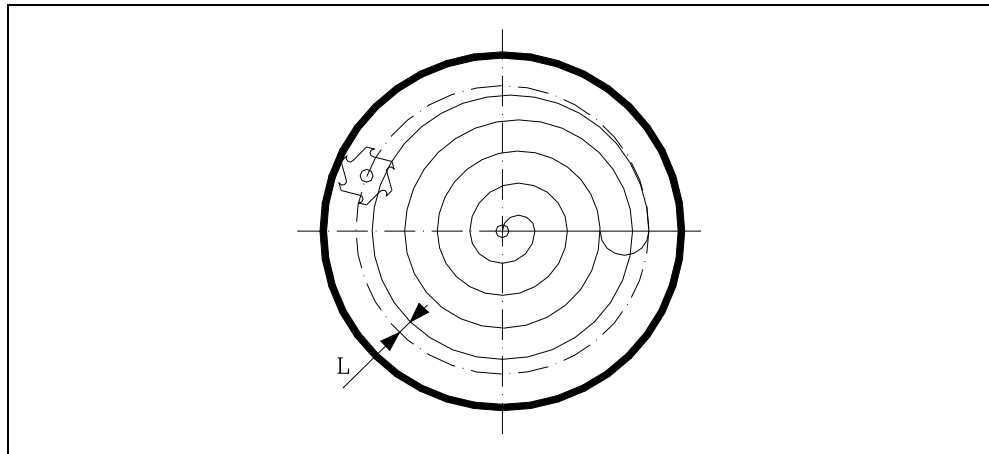

7. New milling surfaces until reaching the total depth of the pocket.
 - Movement of the longitudinal axis at the feedrate indicated by "V", up to a distance "B" from the previous surface.
 - Milling of the new surface following the steps indicated in points 4, 5 and 6.
8. Withdrawal at rapid feedrate (G00) of the longitudinal axis to the initial or reference plane, depending on whether G98 or G99 has been programmed.

9.

CANNED CYCLES
G88. Circular pocket canned cycle




CNC 8035

·M· MODEL
(SOFT V15.3x)

Programming example ·1·

Let us suppose a work plane formed by the X and Y axis, Z being the longitudinal axis and the starting point X0 Y0 Z0.

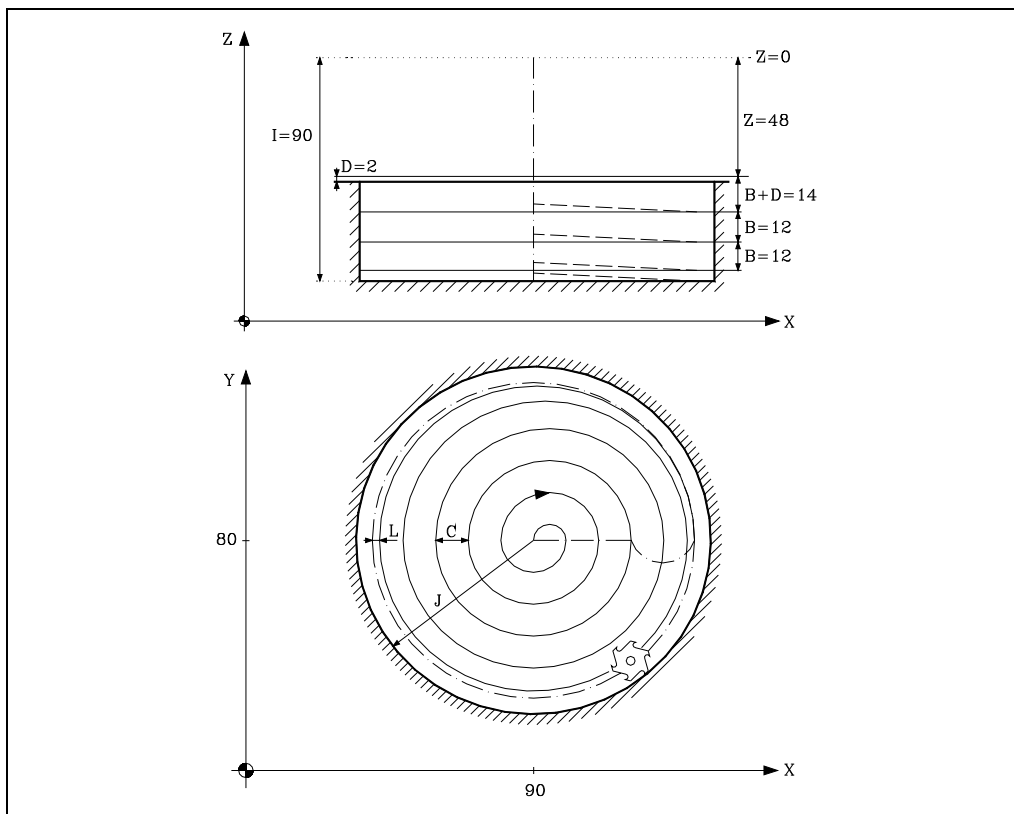

```

; Tool selection.
(TOR1=6, TOI1=0)
T1 D1
M6

; Starting point
G0 G90 X0 Y0 Z0

; Canned cycle definition
G88 G98 G00 G90 X90 Y80 Z-48 I-90 J70 B12 C10 D2 H100 L5 V100 F300 S1000 M03

; Cancels the canned cycle.
G80

; Positioning
G90 X0 Y0

; End of program
M30
    
```

9.

CANNED CYCLES
G88. Circular pocket canned cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)


9.15 G89. Boring cycle with withdrawal at work feedrate (G01)

This cycle bores at the point indicated until the final programmed coordinate is reached.

It is possible to program a dwell at the bottom of the machined hole.

Working in Cartesian coordinates, the basic structure of the block is as follows:

```
G89 G98/G99 X Y Z I K
```

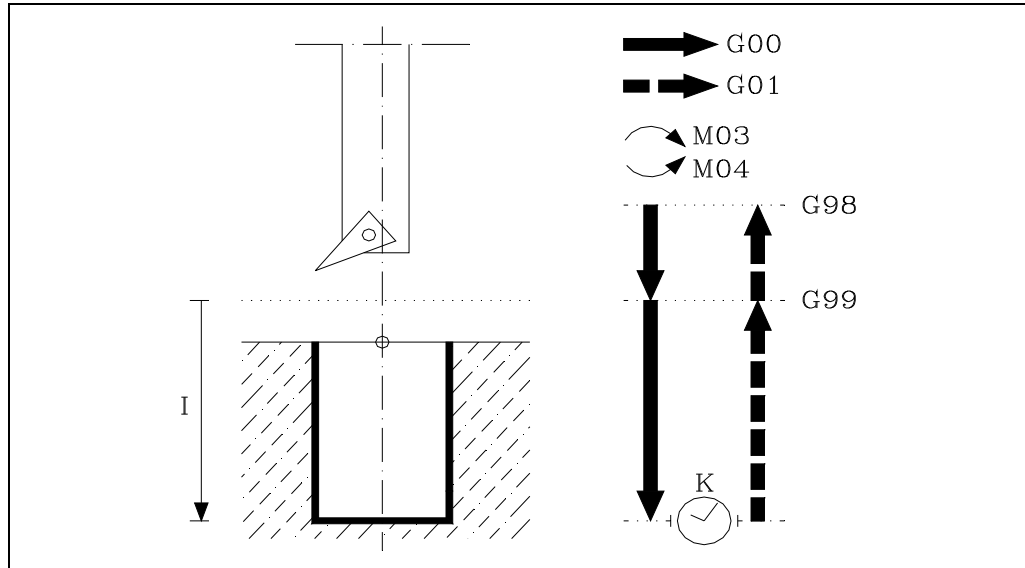

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been bored.

G99 The tool withdraws to the Reference Plane, once the hole has been bored.

[X/Y±5.5] Machining coordinates

These are optional and define the movement of the axes of the main plane to position the tool at the machining point.

This point can be programmed in Cartesian coordinates or in polar coordinates, and the coordinates may be absolute or incremental, according to whether the machine is operating in G90 or G91.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It can be programmed in absolute coordinates or incremental coordinates, in which case it will be referred to the initial plane.

If not programmed, it assumes as reference plane the current position of the tool.

[I±5.5] Machining depth.

Defines boring depth. It can be programmed in absolute coordinates or incremental coordinates and in this case will be referred to the reference plane.

[K5] Dwell

Defines the dwell, in hundredths of a second, after boring until the withdrawal begins. If not programmed, the CNC will take the value of "K0".

9.

CANNED CYCLES
G89. Boring cycle with withdrawal at work feedrate (G01)



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.15.1 Basic operation

1. If the spindle was previously running, it maintains the turning direction. If it was not in movement, it will start by turning clockwise (M03).
2. Rapid movement of the longitudinal axis from the initial plane to the reference plane.
3. Movement at the working feedrate (G01) of the longitudinal axis to the bottom of the machined hole, and boring.
4. Dwell, if parameter "K" has been programmed.
5. Withdrawal at working feedrate, of the longitudinal axis as far as the reference plane.
6. Withdrawal, at rapid feedrate (G00), of the longitudinal axis as far as the initial plane if G98 has been programmed.

Programming example ·1·

Let us suppose a work plane formed by the X and Y axis, Z being the longitudinal axis and the starting point X0 Y0 Z0.

```

; Tool selection.
T1 D1
M6

; Starting point
G0 G90 X0 Y0 Z0

; Canned cycle definition
G89 G98 G91 X250 Y350 Z-98 I-22 K20 F100 S500

; Cancels the canned cycle.
G80

; Positioning
G90 X0 Y0

; End of program
M30
    
```

9.

CANNED CYCLES

G89. Boring cycle with withdrawal at work feedrate (G01)

FAGOR 

CNC 8035


·M· MODEL
(SOFT V15.3x)

9.16 G210. Bore milling canned cycle

This cycle may be used to increase the diameter of a hole through a helical movement of the tool. Besides this, if the tool allows it, it is also possible to mill a hole without having to drill it first.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G210 G98/G99 X Y Z D I J K B

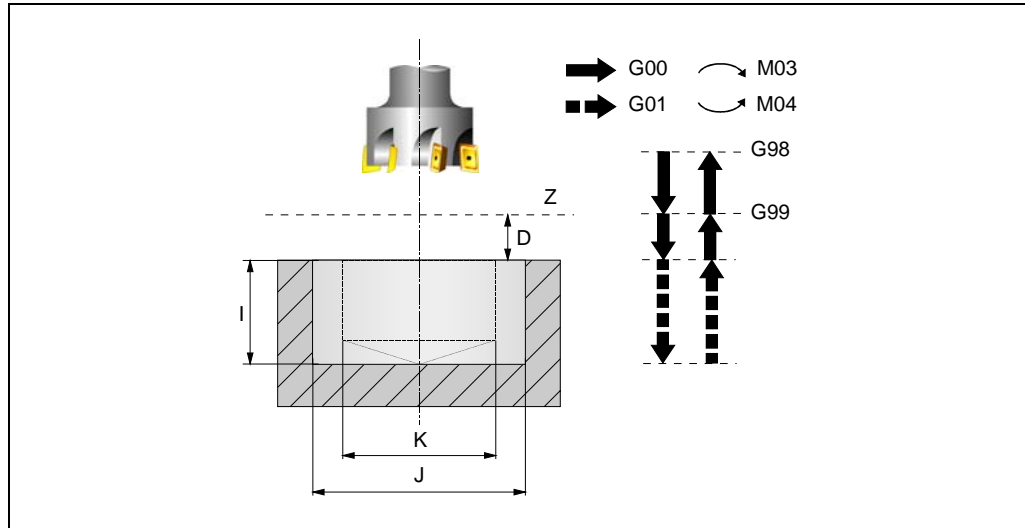

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been milled.

G99 The tool withdraws to the Reference Plane, once the hole has been milled.

[X±5.5] Hole center coordinate along the abscissa axis.

It defines the hole center coordinate along the X axis. If not programmed, it will assume the current tool position on that axis.

[Y±5.5] Hole center coordinate along the ordinate axis.

It defines the hole center coordinate along the Y axis. If not programmed, it will assume the current tool position on that axis.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the starting plane.

If not programmed, it assumes as reference plane the current position of the tool.

[D5] Safety distance

Defines the distance between the reference plane and the surface of the part where the milling is to be done. If not programmed, it assumes 0.

[I±5.5] Machining depth.

Defines the machining depth. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the reference plane.

If not programmed, the CNC issues the corresponding error.

[J±5.5] Hole diameter.

Defines the nominal diameter of the hole. The sign indicates the direction of the helical path associated with the machining of the hole (positive if clockwise and negative if counterclockwise).

9.

CANNED CYCLES
G210. Bore milling canned cycle

If not programmed or programmed with a value smaller than the diameter of the active tool, the CNC issues the relevant error message.

[K5.5] Pre-drilling diameter

Starting with a hole previously drilled, this parameter defines the diameter of that hole. If not programmed or programmed with a 0 value, it means that no hole has been previously drilled.

The tool must meet the following conditions:

- The tool radius must be smaller than $J/2$.
- The tool radius must be equal to or greater than $(J-K)/4$.

If these two conditions are not met, the CNC issues the corresponding error message.

[B±5.5] Penetration step

It defines the penetration step when machining the hole.

- With a positive sign, it will mill the bottom of the hole.
- With a negative sign, it will not mill the bottom of the hole.

If not programmed or programmed with a 0 value, the CNC will display the corresponding error message.

9.

CANNED CYCLES
G210. Bore milling canned cycle

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

9.16.1 Basic operation

1. Rapid movement to the center of the hole (X, Y).
2. Rapid movement to the reference plane (Z).
3. Rapid movement to the tangential entry coordinate along the longitudinal axis.
4. Tangential entry to the helical path of the drilling.
5. Helical movement, with the pitch given by parameter B and in the direction given by parameter J, down to the bottom of the hole.
6. Milling of the bottom of the hole (this step is only carried out if parameter B has a positive sign).
7. Tangential exit movement to the helical path of the drilling to the center of the hole.
8. Rapid movement to the reference plane (G99) or to the starting plane (G98).

9.

CANNED CYCLES
G210. Bore milling canned cycle



CNC 8035


·M· MODEL
(SOFT V15.3x)

9.17 G211. Inside thread milling cycle

This cycle may be used to make an inside thread through a helical movement of the tool.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G211 G98/G99 X Y Z D I J K B C L A E Q

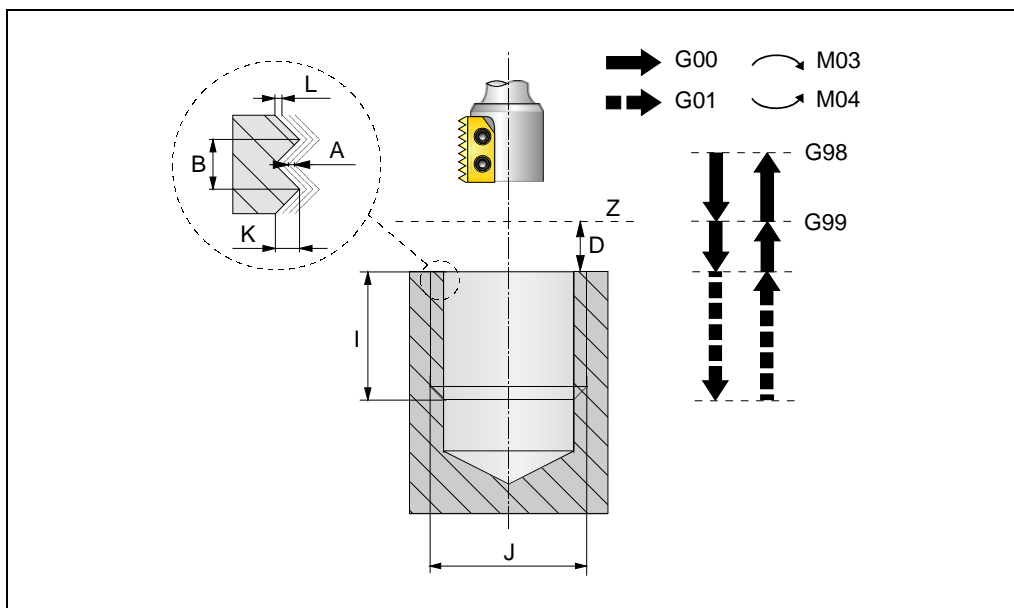

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been milled.

G99 The tool withdraws to the Reference Plane, once the hole has been milled.

[X±5.5] Hole center coordinate along the abscissa axis.

It defines the hole center coordinate along the X axis. If not programmed, it will assume the current tool position on that axis.

[Y±5.5] Hole center coordinate along the ordinate axis.

It defines the hole center coordinate along the Y axis. If not programmed, it will assume the current tool position on that axis.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the starting plane.

If not programmed, it assumes as reference plane the current position of the tool.

[D5] Safety distance

Defines the distance between the reference plane and the surface of the part where the milling is to be done. If not programmed, it assumes 0.

[I±5.5] Machining depth.

Defines the threading depth. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the reference plane.

If not programmed, the CNC issues the corresponding error.

[J±5.5] Thread diameter

Defines the nominal diameter of the thread. The sign indicates the machining direction of the thread (positive if clockwise and negative if counterclockwise).

9.

CANNED CYCLES
G211. Inside thread milling cycle

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

If not programmed, the CNC issues the corresponding error.

[K5.5] Thread depth

It defines the distance between the crest and the root of the thread. If not programmed, the CNC issues the corresponding error.

[B±5.5] Thread pitch

Defines the thread pitch.

- With a positive sign, the direction of the thread pitch is from the surface of the part to the bottom.
- With a negative sign, the direction of the thread pitch is from the bottom to the surface of the part.


If not programmed or programmed with a 0 value, the CNC will display the corresponding error message.

[C1] Type of tapping

Defines the type of tapping to be carried out. This parameter depends on the type of tool being used.

- When programming C= 0, the threading will be done in a single pass.
- When programming C=1, it will make one thread per each pass (single-edge cutter).
- When programming C=n (where n is the number of cutting edges of the cutter), it will make n threads per each pass.

If not programmed, a value of C=1 is assumed.

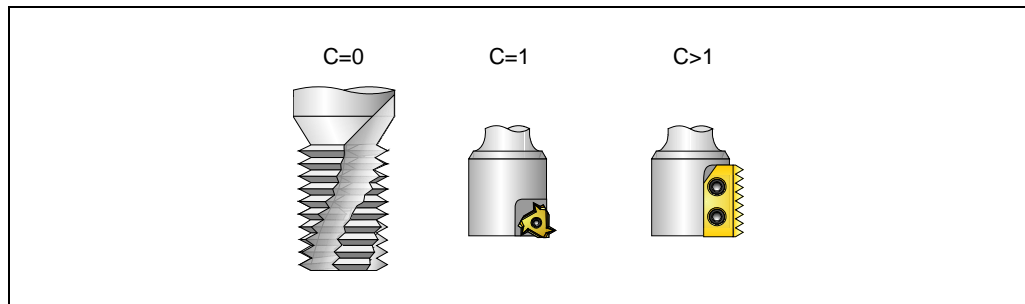

[L5.5] Finishing stock.

It defines the finishing stock at the bottom of the thread. If not programmed, a value of 0 is assumed.

[A5.5] Maximum penetration step

Defines the maximum penetrating pass of the thread. If not programmed or programmed with a 0 value, it will run a single pass up to the finishing stock.

[E5.5] Approach distance

Approach distance to the thread entry. If not programmed, it will enter the thread from the center of the hole.

[Q±5.5] Thread entry angle

Angle (in degrees) of the segment formed by the center of the hole and the thread entry point with respect to the abscissa axis. If not programmed, a value of 0 is assumed.

9.

CANNED CYCLES
G211. Inside thread milling cycle



CNC 8035

·M· MODEL
(SOFT V15.3x)

9.17.1 Basic operation

1. Rapid movement to the center of the hole (X, Y).
2. Rapid movement to the reference plane (Z).
3. Rapid movement of the plane axes to the thread entry point (it only makes this movement if parameter E has been programmed).
4. Rapid movement to the thread entry point coordinate along the longitudinal axis.
5. Thread entry with a helical movement tangent to the first helical threading path.
6. Making the thread according to the value of parameter C.
 - If C=0:
 - 1-Helical movement, in the direction indicated in parameter J, to the bottom of the thread (the movement will only be one revolution).
 - 2-Helical thread exiting movement, tangent to the previous helical path. If parameter E has not been programmed, the exit point will correspond with the coordinates of the hole center.

It must be borne in mind that in the exit tangent to the helical path, the exit point will exceed the coordinate of the bottom of the thread along the longitudinal axis.
 - If C=1:
 - 1-Helical movement, with the pitch and direction given in parameter J, to the bottom of the thread.
 - 2-Helical thread exiting movement, tangent to the previous helical path. If parameter E has not been programmed, the exit point will correspond with the coordinates of the hole center.

It must be borne in mind that in the exit tangent to the helical path, the exit point will exceed the coordinate of the bottom of the thread along the longitudinal axis.
 - If C=n:
 - 1-Helical movement, with the pitch and direction given in parameter J, (the movement will be one revolution).
 - 2-Helical thread exiting movement, tangent to the previous helical path. If parameter E has not been programmed, the exit point will correspond with the coordinates of the hole center.
 - 3-Rapid movement to the thread entry point of the next threading path.
 - 4-Rapid movement to the Z coordinate of the thread entry point of the next threading path.
 - 5-Repetition of the previous 3 steps until reaching the bottom of the thread. It must be borne in mind that in the last helical exit, the exit point will exceed the coordinate of the bottom of the thread along the longitudinal axis.
7. Rapid movement to the center of the hole (X, Y).
8. Rapid movement to the thread entry coordinate along the longitudinal axis.
9. Repetition of steps 3 to 8 until reaching the depth of the finishing stock.
- 10.Repetition of steps 3 to 8 until reaching the bottom of the thread.
- 11.Rapid movement to the reference plane (G99) or to the starting plane (G98).

9.

CANNED CYCLES
G211. Inside thread milling cycle

FAGOR 

CNC 8035


·M· MODEL
(SOFT V15.3x)

9.18 G212. Outside thread milling cycle

This cycle may be used to make an outside thread through a helical movement of the tool.

Working in Cartesian coordinates, the basic structure of the block is as follows:

G212 G98/G99 X Y Z D I J K B C L A E Q

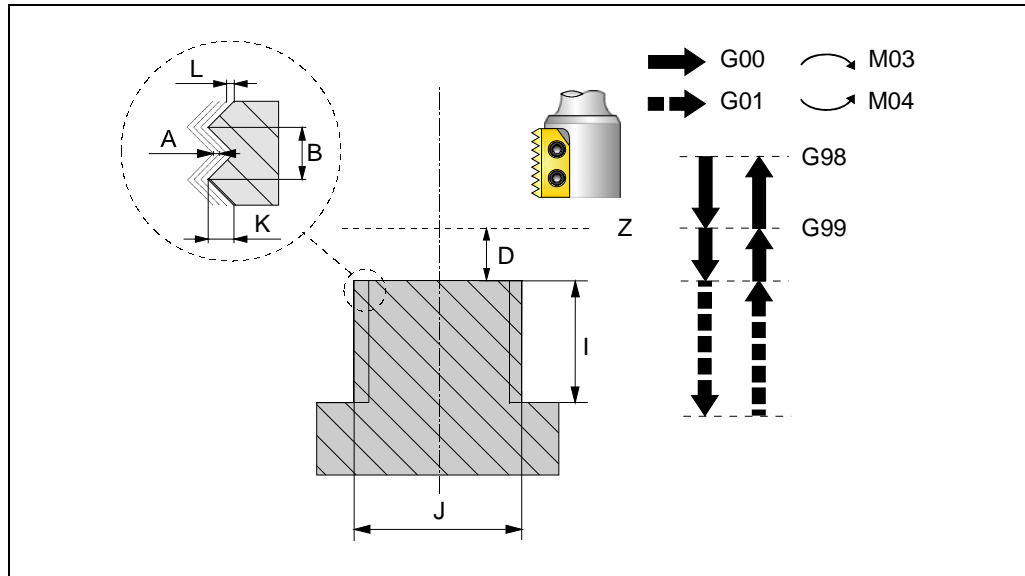

[G98/G99] Withdrawal plane

G98 The tool withdraws to the Initial Plane, once the hole has been milled.

G99 The tool withdraws to the Reference Plane, once the hole has been milled.

[X±5.5] Boss center coordinate along the abscissa axis.

It defines the boss center coordinate along the X axis. If not programmed, it will assume the current tool position on that axis.

[Y±5.5] Boss center coordinate along the ordinate axis.

It defines the boss center coordinate along the Y axis. If not programmed, it will assume the current tool position on that axis.

[Z±5.5] Reference plane

Defines the reference plane coordinate. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the starting plane.

If not programmed, it assumes as reference plane the current position of the tool.

[D5] Safety distance

Defines the distance between the reference plane and the surface of the part where the milling is to be done. If not programmed, it assumes 0.

[I±5.5] Machining depth.

Defines the threading depth. It may be programmed either in absolute or incremental coordinates, in which case it will be referred to the reference plane.

If not programmed, the CNC issues the corresponding error.

[J±5.5] Thread diameter

Defines the nominal diameter of the thread. The sign indicates the machining direction of the thread (positive if clockwise and negative if counterclockwise).

If not programmed, the CNC issues the corresponding error.

9.

CANNED CYCLES
G212. Outside thread milling cycle



CNC 8035

-M- MODEL
(SOFT V15.3x)

[K5.5] Thread depth

It defines the distance between the crest and the root of the thread. If not programmed, the CNC issues the corresponding error.

[B±5.5] Thread pitch

Defines the thread pitch.

- With a positive sign, the direction of the thread pitch is from the surface of the part to the bottom.
- With a negative sign, the direction of the thread pitch is from the bottom to the surface of the part.


If not programmed or programmed with a 0 value, the CNC will display the corresponding error message.

[C1] Type of tapping

Defines the type of tapping to be carried out. This parameter depends on the type of tool being used.

- When programming C= 0, the threading will be done in a single pass.
- When programming C=1, it will make one thread per each pass (single-edge cutter).
- When programming C=n (where n is the number of cutting edges of the cutter), it will make n threads per each pass.

If not programmed, a value of C=1 is assumed.

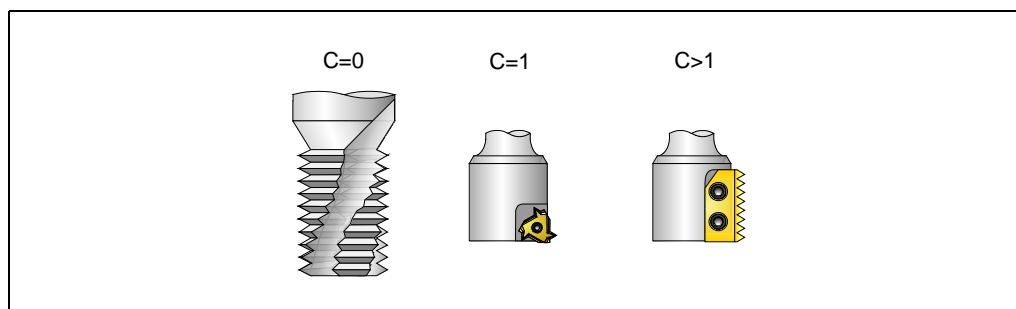

[L5.5] Finishing stock.

It defines the finishing stock at the bottom of the thread. If not programmed, a value of 0 is assumed.

[A5.5] Maximum penetration step

Defines the maximum penetrating pass of the thread. If not programmed or programmed with a 0 value, it will run a single pass up to the finishing stock.

[E5.5] Approach distance

Approach distance to the thread entry. If not programmed or programmed with a 0 value, the CNC will display the corresponding error message.

[Q±5.5] Thread entry angle

Angle (in degrees) of the segment formed by the center of the hole and the thread entry point with respect to the abscissa axis. If not programmed, a value of 0 is assumed.

9.18.1 Basic operation

9.

CANNED CYCLES
G212. Outside thread milling cycle

1. Rapid movement to the center of the hole (X, Y).
2. Rapid movement to the reference plane (Z).
3. Rapid movement of the plane axes to the thread entry point (it only makes this movement if parameter E has been programmed).
4. Rapid movement to the thread entry point coordinate along the longitudinal axis.
5. Rapid movement to the thread entry point (movement interpolated in 3 axes).
6. Thread entry with a helical movement tangent to the first helical threading path.
7. Making the thread according to the value of parameter C.
 - If C=0:
 - 1-Helical movement, in the direction indicated in parameter J, to the bottom of the thread (the movement will only be one revolution).
 - 2-Helical thread exiting movement, tangent to the previous helical path.
It must be borne in mind that in the exit tangent to the helical path, the exit point will exceed the coordinate of the bottom of the thread along the longitudinal axis.
 - If C=1:
 - 1-Helical movement, with the pitch and direction given in parameter J, to the bottom of the thread.
 - 2-Helical thread exiting movement, tangent to the previous helical path.
It must be borne in mind that in the exit tangent to the helical path, the exit point will exceed the coordinate of the bottom of the thread along the longitudinal axis.
 - If C=n:
 - 1-Helical movement, with the pitch and direction given in parameter J, (the movement will be one revolution).
 - 2-Helical thread exiting movement, tangent to the previous helical path to the thread entry point.
 - 3-Rapid movement to the Z coordinate of the thread entry point of the next threading path.
 - 4-Repetition of the previous 3 steps until reaching the bottom of the thread. It must be borne in mind that in the last helical exit, the exit point will exceed the coordinate of the bottom of the thread along the longitudinal axis.
8. Rapid movement to the reference plane (G99).
9. Repetition of steps 3 to 8 until reaching the depth of the finishing stock.
10. Repetition of steps 3 to 8 until reaching the bottom of the thread.
11. Rapid movement to the reference plane (G99) or to the starting plane (G98).
12. Rapid movement to the center of the hole (X, Y).



CNC 8035

·M· MODEL
(SOFT V15.3x)

Multiple machining is defined as a series of functions which allow a machining operation to be repeated along a given path.

The programmer will select the type of machining, which can be a canned cycle or a subroutine (which must be programmed as a modal subroutine) defined by the user.

Machining paths are defined by the following functions:

- G60: Multiple machining in a straight line
- G61: Multiple machining in a rectangular pattern.
- G62: Multiple machining in a grid pattern.
- G63: Multiple machining in a circular pattern.
- G64: Multiple machining in an arc
- G65: Machining programmed with an arc-chord

These functions can be performed on any work plane and must be defined every time they are used, as they are not modal.

It is absolutely essential for the machining which it is required to repeat to be active. In other words, these functions will only make sense if they are under the influence of a canned cycle or under the influence of a modal subroutine.

To perform multiple machining, follow these steps:

1. Move the tool to the first point of the multiple machining operation.
2. Define the canned cycle or modal subroutine to be repeated at all the points.
3. Define the multiple operation to be performed.

All machining operations programmed with these functions will be done under the same working conditions (T,D,F,S) which were selected when defining the canned cycle or modal subroutine.

Once the multiple machining operation has been performed, the program will recover the history it had before starting this machining, even when the canned cycle or modal subroutine will remain active. Now feedrate F corresponds to the feedrate programmed for the canned cycle or modal subroutine.

Likewise, the tool will be positioned at the last point where the programmed machining operation was done.


If multiple machining of a modal subroutine is performed in the Single Block mode, this subroutine will be performed complete (not block by block) after each programmed movement.

A detailed explanation is given on the next page of multiple machining operations, assuming in each case, that the work plane is formed by X and Y axes.

10.1 G60: Multiple machining in a straight line

The programming format is as follows:

```
G60 A X I P Q R S T U V
      X K
      I K
```

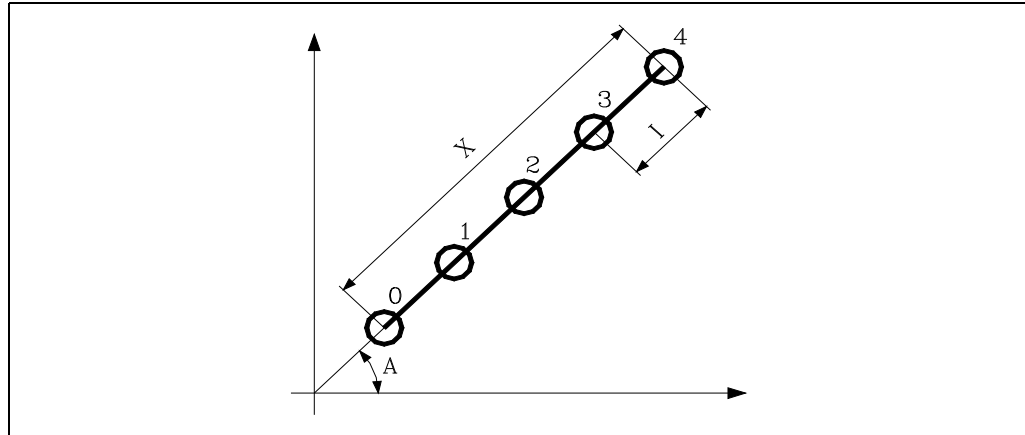

A (±5.5) Angle of the path

Defines the angle that forms the machining path with the abscissa axis. It is expressed in degrees and if not programmed, the value $A=0$ will be taken.

X (±5.5) Length of the path

Defines the length of the machining path.

I (5.5) Machining pass

Defines the pass between machining operations.

K (5) Number of machining operations

Defines the number of total machining operations in the section, including the machining definition point.

Due to the fact that machining may be defined with any two points of the X I K group, the CNC allows the following definition combinations: XI, XK, IK.

Nevertheless, if format XI is defined, care should be taken to ensure that the number of machining operations is an integer number, otherwise the CNC will show the corresponding error code.

P Q R S T U V Points where no drilling takes place

These parameters are optional and are used to indicate at which points or between which of those programmed points it is not required to machine.

Thus, programming P7 indicates that it is not required to do machining at point 7, and programming Q10.013 indicates that machining is not required from point 10 to 13, or expressed in another way, that no machining is required at points 10, 11, 12 and 13.

When it is required to define a group of points (Q10.013), care should be taken to define the final point with three digits, as if Q10.13 is programmed, multiple machining understands Q10.130.

The programming order for these parameters is P Q R S T U V, it also being necessary to maintain the order in which the points assigned to these are numbered, i.e., the numbering order of the points assigned to Q must be greater than that assigned to P and less than that assigned to R.

10.

MULTIPLE MACHINING
G60: Multiple machining in a straight line



CNC 8035

·M· MODEL
(SOFT V15.3x)

Example:

Proper programming P5.006 Q12.015 R20.022

Correct programming P5.006 Q12.015 R20.022

If these parameters are not programmed, the CNC understands that it must perform machining at all the points along the programmed path.

10.

MULTIPLE MACHINING

G60: Multiple machining in a straight line

FAGOR 


CNC 8035

·M· MODEL
(SOFT V15.3x)

10.1.1 Basic operation

1. Multiple machining calculates the next point of those programmed where it is wished to machine.
 2. Rapid traverse (G00) to this point.
 3. Multiple machining will perform the canned cycle or modal subroutine selected after this movement.
 4. The CNC will repeat steps 1-2-3 until the programmed path has been completed.
- After completing multiple machining, the tool will be positioned at the last point along the programmed path where machining was performed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

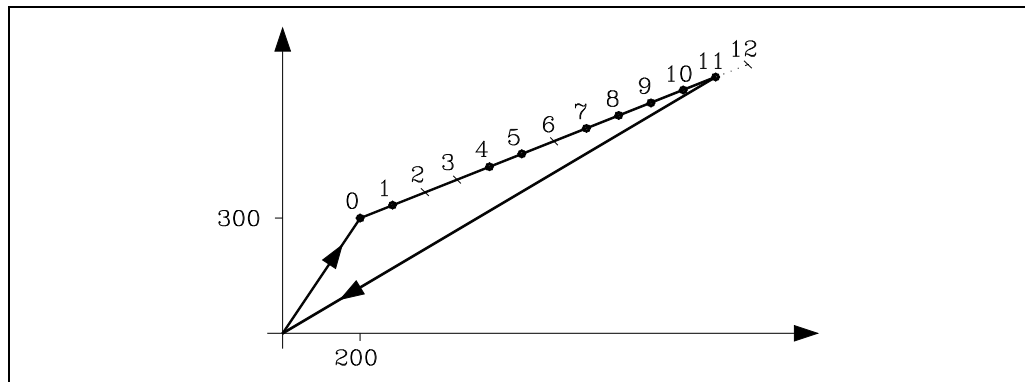

; Canned cycle positioning and definition.

```
G81 G98 G00 G91 X200 Y300 Z-8 I-22 F100 S500
```

; Defines multiple machining.

```
G60 A30 X1200 I100 P2.003 Q6 R12
```

; Cancels the canned cycle.

```
G80
```

; Positioning.

```
G90 X0 Y0
```

; End of program.

```
M30
```

It is also possible to write the multiple machining definition block in the following ways:

```
G60 A30 X1200 K13 P2.003 Q6 R12
```

```
G60 A30 I100 K13 P2.003 Q6 R12
```

10.

MULTIPLE MACHINING

G60: Multiple machining in a straight line




CNC 8035

-M- MODEL
(SOFT V15.3x)

10.2 G61: Multiple machining in a rectangular pattern

The programming format is as follows:

```
G61 A B X I Y J P Q R S T U V
      X K Y D
      I K J D
```

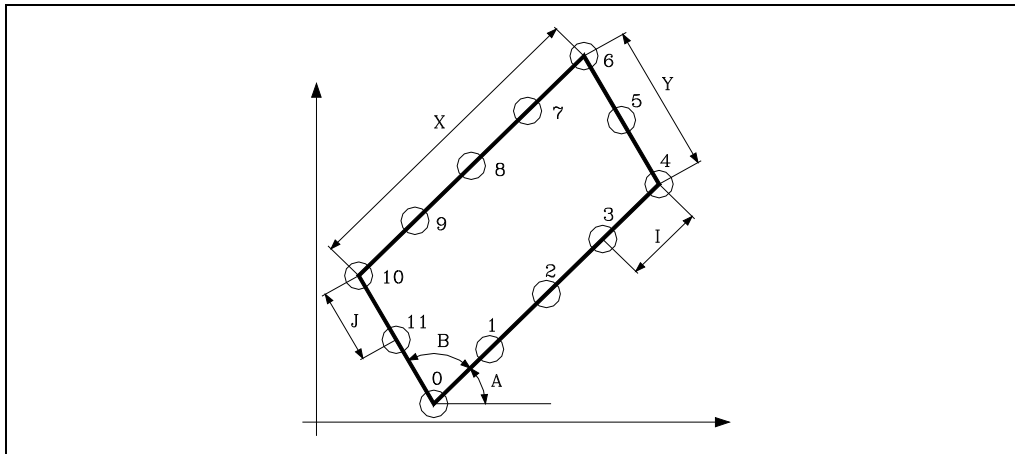

A (±5.5) Angle of the path with respect to the abscissa axis

Defines the angle that forms the machining path with the abscissa axis. It is expressed in degrees and if not programmed, the value A=0 will be taken.

B (±5.5) Angle between paths

Defines the angle formed by the two machining paths. It is expressed in degrees and if not programmed, the value B=90 will be taken.

X (5.5) Length of the path along the abscissa axis

Defines the length of the machining path according to the abscissa axis.

I (5.5) Machining pass along the abscissa axis

Defines the pass between machining operations along the abscissa axis.

K (5) Number of machining operations along the abscissa axis

Defines the total number of machining operations in the abscissa axis, including the machining definition point.

Due to the fact that machining may be defined according to the abscissa axis with any two points of the X I K group, the CNC allows the following definition combinations: XI, XK, IK.

Nevertheless, if format XI is defined, care should be taken to ensure that the number of machining operations is an integer number, otherwise the CNC will show the corresponding error code.

Y (5.5) Length of the path along the ordinate axis

Defines the length of the machining path according to the ordinate axis.

J (5.5) Machining pass along the ordinate axis

Defines the pass between machining operations according to the ordinate axis.

10.

MULTIPLE MACHINING
G61: Multiple machining in a rectangular pattern

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

D (5) Number of machining operations along the ordinate axis

Defines the total number of machining operations in the ordinate axis, including the machining definition point.

Due to the fact that machining may be defined according to the ordinate axis with any two points of the Y J D group, the CNC allows the following definition combinations: YJ, YD, JD.

Nevertheless, if format YJ is defined, care should be taken to ensure that the number of machining operations is an integer number, otherwise the CNC will show the corresponding error code.

P Q R S T U V Points where no drilling takes place

These parameters are optional and are used to indicate at which points or between which of those programmed points it is not required to machine.

Thus, programming P7 indicates that it is not required to do machining at point 7, and programming Q10.013 indicates that machining is not required from point 10 to 13, or expressed in another way, that no machining is required at points 10, 11, 12 and 13.

When it is required to define a group of points (Q10.013), care should be taken to define the final point with three digits, as if Q10.13 is programmed, multiple machining understands Q10.130.

The programming order for these parameters is P Q R S T U V, it also being necessary to maintain the order in which the points assigned to these are numbered, i.e., the numbering order of the points assigned to Q must be greater than that assigned to P and less than that assigned to R.

Example:

Proper programming P5.006 Q12.015 R20.022

Correct programming P5.006 Q12.015 R20.022

If these parameters are not programmed, the CNC understands that it must perform machining at all the points along the programmed path.

10.

MULTIPLE MACHINING
 G61: Multiple machining in a rectangular pattern



CNC 8035


·M· MODEL
(SOFT V15.3x)

10.2.1 Basic operation

1. Multiple machining calculates the next point of those programmed where it is wished to machine.
2. Rapid traverse (G00) to this point.
3. Multiple machining will perform the canned cycle or modal subroutine selected after this movement.
4. The CNC will repeat steps 1-2-3 until the programmed path has been completed.

After completing multiple machining, the tool will be positioned at the last point along the programmed path where machining was performed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

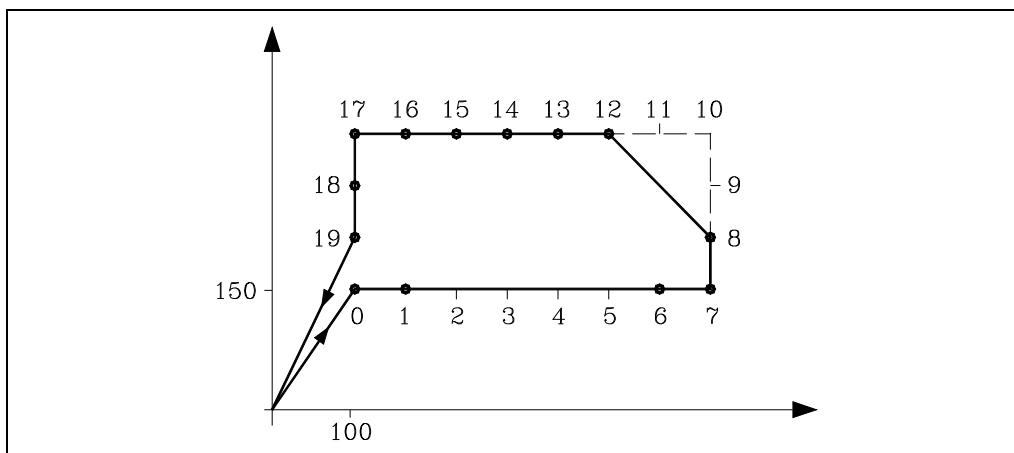

```

; Canned cycle positioning and definition.
G81 G98 G00 G91 X100 Y150 Z-8 I-22 F100 S500

; Defines multiple machining.
G61 X700 I100 Y180 J60 P2.005 Q9.011

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

It is also possible to write the multiple machining definition block in the following ways:

```

G61 X700 K8 J60 D4 P2.005 Q9.011
G61 I100 K8 Y180 D4 P2.005 Q9.011
    
```


10.

MULTIPLE MACHINING
G61: Multiple machining in a rectangular pattern

10.3 G62: Multiple machining in a grid pattern.

The programming format is as follows:

```
G62 A B X I Y J P Q R S T U V
      X K Y D
      I K J D
```

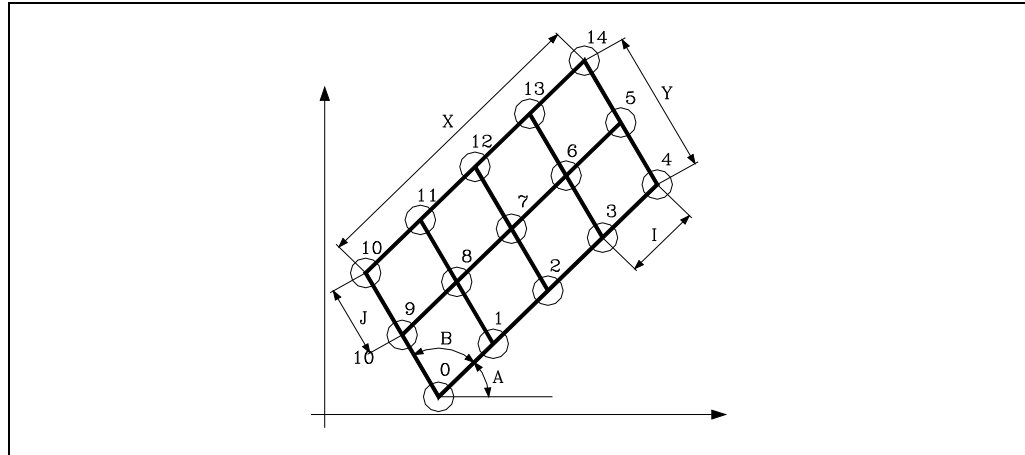

A (±5.5) Angle of the path with respect to the abscissa axis

Defines the angle that forms the machining path with the abscissa axis. It is expressed in degrees and if not programmed, the value A=0 will be taken.

B (±5.5) Angle between paths

Defines the angle formed by the two machining paths. It is expressed in degrees and if not programmed, the value B=90 will be taken.

X (5.5) Length of the path along the abscissa axis

Defines the length of the machining path according to the abscissa axis.

I (5.5) Machining pass along the abscissa axis

Defines the pass between machining operations along the abscissa axis.

K (5) Number of machining operations along the abscissa axis

Defines the total number of machining operations in the abscissa axis, including the machining definition point.

Due to the fact that machining may be defined according to the abscissa axis with any two points of the X I K group, the CNC allows the following definition combinations: XI, XK, IK.

Nevertheless, if format XI is defined, care should be taken to ensure that the number of machining operations is an integer number, otherwise the CNC will show the corresponding error code.

Y (5.5) Length of the path along the ordinate axis

Defines the length of the machining path according to the ordinate axis.

J (5.5) Machining pass along the ordinate axis

Defines the pass between machining operations according to the ordinate axis.

10.

MULTIPLE MACHINING

G62: Multiple machining in a grid pattern.

D (5) Number of machining operations along the ordinate axis

Defines the total number of machining operations in the ordinate axis, including the machining definition point.

Due to the fact that machining may be defined according to the ordinate axis with any two points of the Y J D group, the CNC allows the following definition combinations: YJ, YD, JD.

Nevertheless, if format YJ is defined, care should be taken to ensure that the number of machining operations is an integer number, otherwise the CNC will show the corresponding error code.

P Q R S T U V Points where no drilling takes place

These parameters are optional and are used to indicate at which points or between which of those programmed points it is not required to machine.

Thus, programming P7 indicates that it is not required to do machining at point 7, and programming Q10.013 indicates that machining is not required from point 10 to 13, or expressed in another way, that no machining is required at points 10, 11, 12 and 13.

When it is required to define a group of points (Q10.013), care should be taken to define the final point with three digits, as if Q10.13 is programmed, multiple machining understands Q10.130.

The programming order for these parameters is P Q R S T U V, it also being necessary to maintain the order in which the points assigned to these are numbered, i.e., the numbering order of the points assigned to Q must be greater than that assigned to P and less than that assigned to R.

Example:

Proper programming	P5.006 Q12.015 R20.022
Correct programming	P5.006 Q12.015 R20.022

If these parameters are not programmed, the CNC understands that it must perform machining at all the points along the programmed path.

10.

MULTIPLE MACHINING

G62: Multiple machining in a grid pattern.



CNC 8035

·M· MODEL
(SOFT V15.3x)


10.3.1 Basic operation

1. Multiple machining calculates the next point of those programmed where it is wished to machine.
 2. Rapid traverse (G00) to this point.
 3. Multiple machining will perform the canned cycle or modal subroutine selected after this movement.
 4. The CNC will repeat steps 1-2-3 until the programmed path has been completed.
- After completing multiple machining, the tool will be positioned at the last point along the programmed path where machining was performed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

10.

MULTIPLE MACHINING
G62: Multiple machining in a grid pattern.

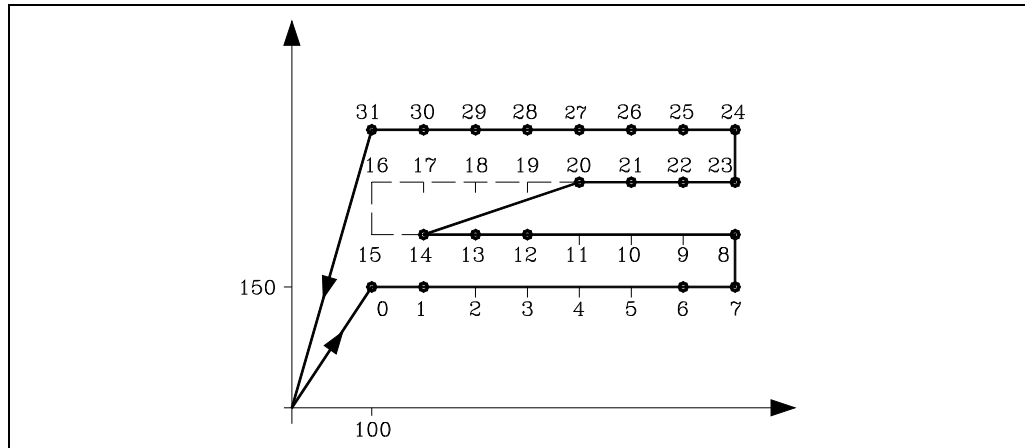

```

; Canned cycle positioning and definition.
G81 G98 G00 G91 X100 Y150 Z-8 I-22 F100 S500

; Defines multiple machining.
G62 X700 I100 Y180 J60 P2.005 Q9.011 R15.019

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

It is also possible to write the multiple machining definition block in the following ways:

```

G62 X700 K8 J60 D4 P2.005 Q9.011 R15.019
G62 I100 K8 Y180 D4 P2.005 Q9.011 R15.019
    
```




CNC 8035

·M· MODEL
(SOFT V15.3x)

10.4 G63: Multiple machining in a circular pattern

The programming format is as follows:

```
G63 X Y I C F P Q R S T U V
      K
```

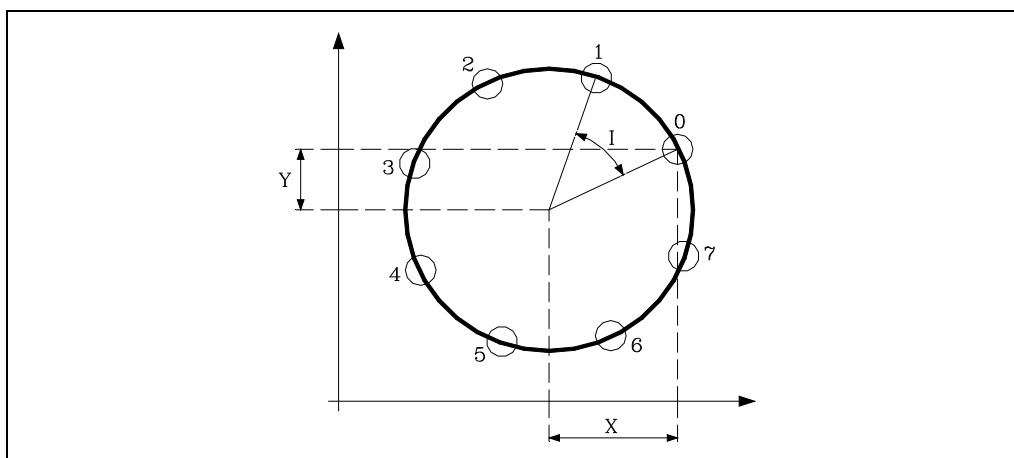

X (±5.5) Distance from the first machining point to the center along the abscissa axis

Defines the distance from the starting point to the center along the abscissa axis.

Y (±5.5) Distance from the first machining point to the center along the ordinate axis

Defines the distance from the starting point to the center along the ordinate axis.

With parameters X and Y the center of the circle is defined in the same way that I and J do this in circular interpolations (G02, G03).

I (±5.5) Angular pass between machining operations

Defines the angular pass between machining operations. When moving from point to point in G00 or G01, the sign indicates the direction, “+” counterclockwise, “-” clockwise.

K (5) Total number of machining operations

Defines the total number of machining operations along the circle, including the machining definition point.

It will be enough to program I or K in the multiple machining definition block. Nevertheless, if K is programmed in a multiple machining operation in which movement between points is made in G00 or G01, machining will be done counterclockwise.

C (0/1/2/3) Type of move from point to point.

Indicates how movement is made between machining points. If it is not programmed, the value C=0 will be taken.

- C=0: Movement is made in rapid feedrate (G00).
- C=1: Movement is made in linear interpolation (G01).
- C=2: Movement is made in clockwise circular interpolation (G02)
- C=3: Movement is made in counterclockwise circular interpolation (G03)

F (5.5) Feedrate to move from point to point

Defines the feedrate that is used for moving from point to point. Obviously, it will only apply for “C” values other than zero. If it is not programmed, the value F0 will be taken, maximum feedrate selected by the “MAXFEED” axis machine parameter.

10.

MULTIPLE MACHINING
G63: Multiple machining in a circular pattern

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

P Q R S T U V Points where no drilling takes place

These parameters are optional and are used to indicate at which points or between which of those programmed points it is not required to machine.

Thus, programming P7 indicates that it is not required to do machining at point 7, and programming Q10.013 indicates that machining is not required from point 10 to 13, or expressed in another way, that no machining is required at points 10, 11, 12 and 13.

When it is required to define a group of points (Q10.013), care should be taken to define the final point with three digits, as if Q10.13 is programmed, multiple machining understands Q10.130.

The programming order for these parameters is P Q R S T U V, it also being necessary to maintain the order in which the points assigned to these are numbered, i.e., the numbering order of the points assigned to Q must be greater than that assigned to P and less than that assigned to R.

Example:

Proper programming	P5.006 Q12.015 R20.022
Correct programming	P5.006 Q12.015 R20.022

If these parameters are not programmed, the CNC understands that it must perform machining at all the points along the programmed path.

10.

MULTIPLE MACHINING

G63: Multiple machining in a circular pattern



CNC 8035


·M· MODEL
(SOFT V15.3x)

10.4.1 Basic operation

1. Multiple machining calculates the next point of those programmed where it is wished to machine.
2. Movement at the feedrate programmed by "C" (G00,G01,G02 or G03) to this point.
3. Multiple machining will perform the canned cycle or modal subroutine selected after this movement.
4. The CNC will repeat steps 1-2-3 until the programmed path has been completed.

After completing multiple machining, the tool will be positioned at the last point along the programmed path where machining was performed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

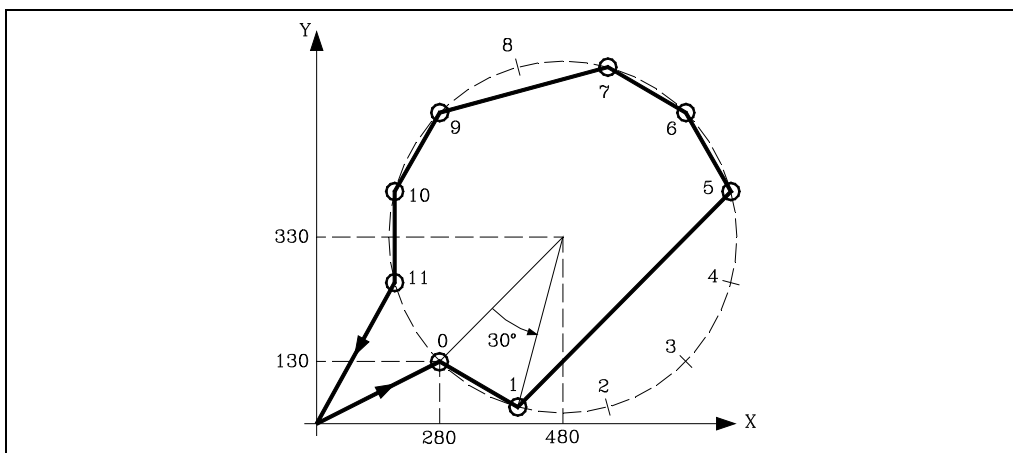

```

; Canned cycle positioning and definition.
G81 G98 G01 G91 X280 Y130 Z-8 I-22 F100 S500

; Defines multiple machining.
G63 X200 Y200 I30 C1 F200 P2.004 Q8

; Cancels the canned cycle.
G80

; Positioning.
G90 X0 Y0

; End of program.
M30
    
```

It is also possible to write the multiple machining definition block in the following ways:

```
G63 X200 Y200 K12 C1 F200 P2.004 Q8
```

10.

MULTIPLE MACHINING
G63: Multiple machining in a circular pattern




CNC 8035

·M· MODEL
(SOFT V15.3x)

10.5 G64: Multiple machining in an arc

The programming format is as follows:

G64 X Y B I C F P Q R S T U V
K

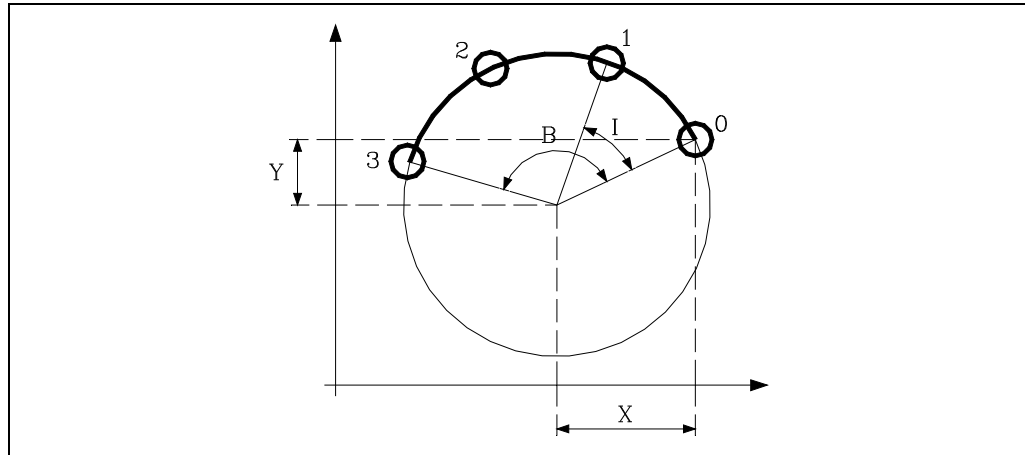

X (± 5.5) **Distance from the first machining point to the center along the abscissa axis**

Defines the distance from the starting point to the center along the abscissa axis.

Y (± 5.5) **Distance from the first machining point to the center along the ordinate axis**

Defines the distance from the starting point to the center along the ordinate axis.

With parameters X and Y the center of the circle is defined in the same way that I and J do this in circular interpolations (G02, G03).

B (5.5) **Angular path**

Defines the angular stroke of the machining path and is expressed in degrees.

I (± 5.5) **Angular pass between machining operations**

Defines the angular pass between machining operations. When moving from point to point in G00 or G01, the sign indicates the direction, "+" counterclockwise, "-" clockwise.

K (5) **Total number of machining operations**

Defines the total number of machining operations along the circle, including the machining definition point.

It will be enough to program I or K in the multiple machining definition block. Nevertheless, if K is programmed in a multiple machining operation in which movement between points is made in G00 or G01, machining will be done counterclockwise.

C (0/1/2/3) **Type of move from point to point.**

Indicates how movement is made between machining points. If it is not programmed, the value C=0 will be taken.

C=0: Movement is made in rapid feedrate (G00).

C=1: Movement is made in linear interpolation (G01).

C=2: Movement is made in clockwise circular interpolation (G02)

C=3: Movement is made in counterclockwise circular interpolation (G03)

10.

MULTIPLE MACHINING
G64: Multiple machining in an arc



CNC 8035

-M- MODEL
(SOFT V15.3x)

F (5.5) Feedrate to move from point to point

Defines the feedrate that is used for moving from point to point. Obviously, it will only apply for “C” values other than zero. If it is not programmed, the value F0 will be taken, maximum feedrate selected by the “MAXFEED” axis machine parameter.

P Q R S T U V Points where no drilling takes place

These parameters are optional and are used to indicate at which points or between which of those programmed points it is not required to machine.

Thus, programming P7 indicates that it is not required to do machining at point 7, and programming Q10.013 indicates that machining is not required from point 10 to 13, or expressed in another way, that no machining is required at points 10, 11, 12 and 13.

When it is required to define a group of points (Q10.013), care should be taken to define the final point with three digits, as if Q10.13 is programmed, multiple machining understands Q10.130.

The programming order for these parameters is P Q R S T U V, it also being necessary to maintain the order in which the points assigned to these are numbered, i.e., the numbering order of the points assigned to Q must be greater than that assigned to P and less than that assigned to R.

Example:

Proper programming	P5.006 Q12.015 R20.022
Correct programming	P5.006 Q12.015 R20.022

If these parameters are not programmed, the CNC understands that it must perform machining at all the points along the programmed path.

10.

MULTIPLE MACHINING
G64: Multiple machining in an arc



CNC 8035


·M· MODEL
(SOFT V15.3x)

10.5.1 Basic operation

1. Multiple machining calculates the next point of those programmed where it is wished to machine.
2. Movement at the feedrate programmed by "C" (G00,G01,G02 or G03) to this point.
3. Multiple machining will perform the canned cycle or modal subroutine selected after this movement.
4. The CNC will repeat steps 1-2-3 until the programmed path has been completed.

After completing multiple machining, the tool will be positioned at the last point along the programmed path where machining was performed.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

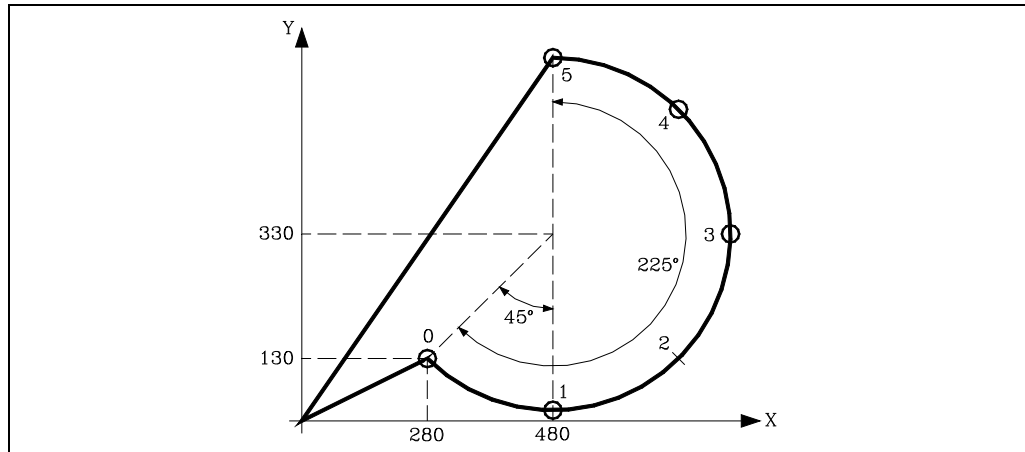

; Canned cycle positioning and definition.

```
G81 G98 G01 G91 X280 Y130 Z-8 I-22 F100 S500
```

; Defines multiple machining.

```
G64 X200 Y200 B225 I45 C3 F200 P2
```

; Cancels the canned cycle.

```
G80
```

; Positioning.

```
G90 X0 Y0
```

; End of program.

```
M30
```

It is also possible to write the multiple machining definition block in the following ways:

```
G64 X200 Y200 B225 K6 C3 F200 P2
```


10.

MULTIPLE MACHINING
G64: Multiple machining in an arc

10.6 G65: Machining programmed with an arc-chord

This function allows activated machining to be performed at a point programmed by means of an arc chord. Only one machining operation will be performed, its programming format being:

```
G65 X Y A C F
      I
```

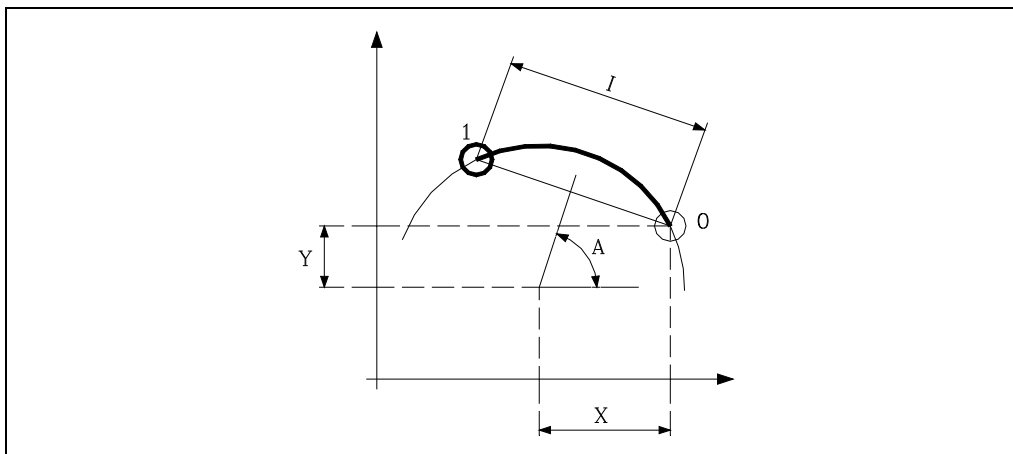

X (±5.5) Distance from the first machining point to the center along the abscissa axis

Defines the distance from the starting point to the center along the abscissa axis.

Y (±5.5) Distance from the first machining point to the center along the ordinate axis

Defines the distance from the starting point to the center along the ordinate axis.

With parameters X and Y the center of the circle is defined in the same way that I and J do this in circular interpolations (G02, G03).

A (±5.5) Angle of the chord

Defines the angle formed by the perpendicular bisector of the chord with the abscissa axis and is expressed in degrees.

I (±5.5) Angular pass between machining operations

Defines the chord length. When moving from point to point in G00 or G01, the sign indicates the direction, "+" counterclockwise, "-" clockwise.

C (0/1/2/3) Type of move from point to point.

Indicates how movement is made between machining points. If it is not programmed, the value C=0 will be taken.

- C=0: Movement is made in rapid feedrate (G00).
- C=1: Movement is made in linear interpolation (G01).
- C=2: Movement is made in clockwise circular interpolation (G02)
- C=3: Movement is made in counterclockwise circular interpolation (G03)

F (5.5) Feedrate to move from point to point

Defines the feedrate that is used for moving from point to point. Obviously, it will only apply for "C" values other than zero. If it is not programmed, the value F0 will be taken, maximum feedrate selected by the "MAXFEED" axis machine parameter.

10.

MULTIPLE MACHINING

G65: Machining programmed with an arc-chord

FAGOR 

CNC 8035


·M· MODEL
(SOFT V15.3x)

10.6.1 Basic operation

1. Multiple machining calculates the next point of those programmed where it is wished to machine.
2. Movement at the feedrate programmed by "C" (G00,G01,G02 or G03) to this point.
3. Multiple machining will perform the canned cycle or modal subroutine selected after this movement.

After completing multiple machining, the tool will be positioned at the programmed point.

Programming example assuming that the work plane is formed by the X and Y axes, that the Z axis is the longitudinal axis and that the starting point is X0 Y0 Z0:

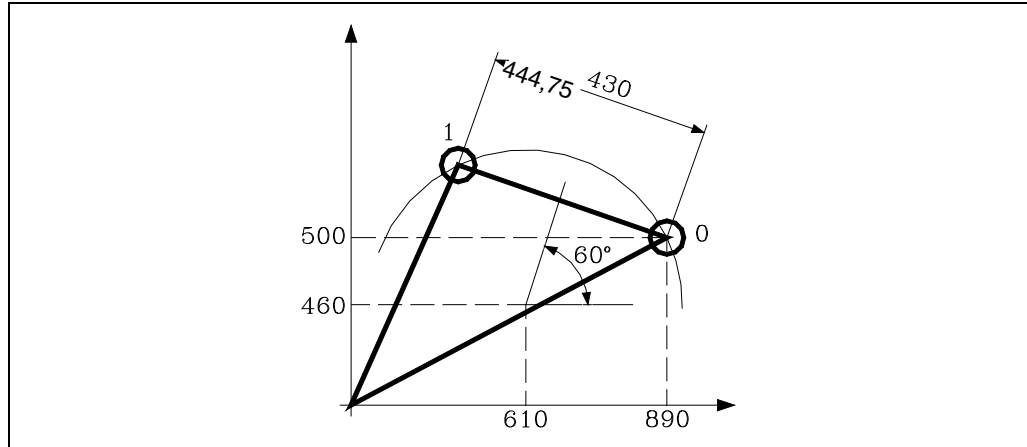

; Canned cycle positioning and definition.

```
G81 G98 G01 G91 X890 Y500 Z-8 I-22 F100 S500
```

; Defines multiple machining.

```
G65 X-280 Y-40 A60 C1 F200
```

; Cancels the canned cycle.

```
G80
```

; Positioning.

```
G90 X0 Y0
```

; End of program.

```
M30
```

It is also possible to write the multiple machining definition block in the following ways:

```
G65 X-280 Y-40 I444.75 C1 F200
```

10.

MULTIPLE MACHINING

G65: Machining programmed with an arc-chord

The CNC has two probe inputs, one for TTL-type 5Vdc signals and another for 24 Vdc signals.

The connection of the different types of probes to these inputs are explained in the appendix to the Installation manual.

11.1 Probing (G75, G76)

The G75 function allows movements to be programmed that will end after the CNC receives the signal from the measuring probe used.

The G76 function allows movements to be programmed that will end after the CNC no longer receives the signal from the measuring probe used.

Their definition format is:

```
G75 X..C ±5.5
```

```
G76 X..C ±5.5
```

After G75 or G76, the required axis or axes will be programmed, as well as the coordinates of these axes that will define the end point of the programmed movement.

The machine will move according to the programmed path until it receives the signal from the probe (G75) or until it no longer receives the probe signal (G76). At this time, the CNC will consider the block finished, taking as the theoretical position of the axes the real position they have at that time.

If the axes reach the programmed position before receiving or while receiving the external signal from the probe, the CNC will stop the movement of the axes.

This type of movement with probing blocks are very useful when it is required to generate measurement or verification programs for tools and parts.

Functions G75 and G76 are not modal and, therefore, must be programmed whenever it is wished to probe.

Functions G75 and G76 are incompatible with each other and with G00, G02, G03, G33, G34, G41 and G42 functions. In addition, once this has been performed, the CNC will assume functions G01 and G40.

During G75 or G76 moves, the operation of the feedrate override switch depends on the setting of OEM machine parameter FOVRG75.

11.

PROBING
Probing (G75, G76)



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.1 Lexical description

All the words that make up the high-level language of the numerical control must be written in capital letters except for associated texts which may be written in upper and lower case letters.

The following elements are available for high-level programming:

- Reserved words.
- Numerical constants.
- Symbols.

Reserved words

Reserved words are those that the CNC uses in high-level programming for naming system variables, operators, control instructions, etc.

All the letters of the alphabet A-Z are also reserved words, as they can make up a high-level language word when used alone.

Numerical constants

Blocks programmed in high-level language admit numbers in decimal format and in hexadecimal format.

- The numbers in decimal format must not exceed the ± 6.5 format (6 digits to the left of the decimal point and 5 decimals).
- The numbers in hexadecimal format must be preceded by the \$ symbol and they must not have more than 8 digits.

A constant higher than the format ± 6.5 must be assigned to a variable by means of arithmetic parameters by means of arithmetic expressions or by means of constants in hexadecimal format.

To assign the value 100000000 to the variable "TIMER", It can be done in one of the following ways:

```
(TIMER = $5F5E100)
(TIMER = 10000 * 10000)
(P100 = 10000 * 10000)
(TIMER = P100)
```

If the CNC operates in the metric system (millimeters), the resolution is a tenth of a micron and the figures will be programmed in the ± 5.4 format (positive or negative with 5 digits to the left of the decimal point and 4 decimals).

If the CNC operates in inches, the resolution is a hundred-thousandths of an inch (ten millionths of an inch) and the figures will be programmed in the ± 4.5 format (positive or negative with 4 digits to the left of the decimal point and 5 decimals).

For the convenience of the programmer, this control always allows the format ± 5.5 (positive or negative, with 5 integers and 5 decimals), adjusting each number appropriately to the working units every time they are used.

Symbols

The symbols used in high-level language are:

() " = + - * / ,

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Lexical description



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2 Variables

The CNC has a number of internal variables that may be accessed from the user program, from the PLC program or via DNC. Depending on how they are used, these variables may be read-only or read-write.

These variables may be accessed from the user program using high-level commands. Each one of these variables is referred to by its mnemonic that must be written in upper-case (capital) letters.

- Mnemonics ending in (X-C) indicate a set of 9 elements formed by the corresponding root followed by X, Y, Z, U, V, W, A, B and C.

```
ORG(X-C) -> ORGX      ORGY      ORGZ
              ORGU      ORGV      ORGW
              ORGA      ORGB      ORGC
```

- Mnemonics ending in n indicate that the variables are grouped in tables. To access an element of any of these tables, indicate the field of the desired table using the relevant mnemonic followed by the desired element.

```
TORn ->   TOR1      TOR3      TOR11
```


The variables and block preparation

The variables that access the real values of the CNC interrupt block preparation. The CNC waits for that command to be executed before resuming block preparation. Thus, precaution must be taken when using this type of variable, because if they are inserted between machining blocks that are working with compensation, undesired profiles may be obtained.

Example: Reading a variable that interrupts block preparation.

The following program blocks are performed in a section with G41 compensation.

```
...
N10 X50 Y80
N15 (P100 = POSX); Assigns the value of the real coordinate in X to parameter P100
N20 X50 Y50
N30 X80 Y50
...
```

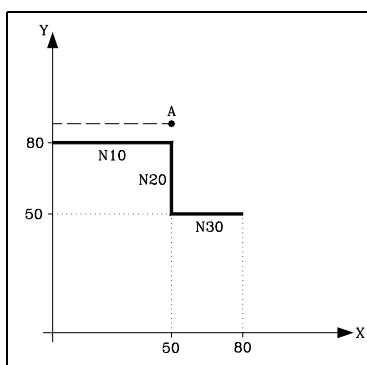


Block N15 interrupts block preparation and the execution of block N10 will finish at point A.

Once the execution of block N15 has ended, the CNC will resume block preparation from block N20 on.

12.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables

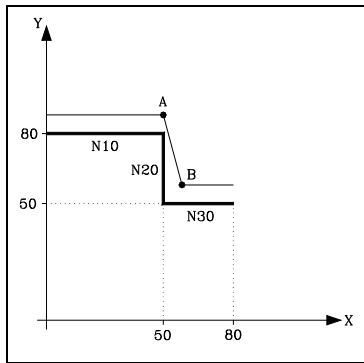

As the next point corresponding to the compensated path is point "B", the CNC will move the tool to this point, executing path "A-B".

As can be observed, the resulting path is not the desired one, and therefore it is recommended to avoid the use of this type of variable in sections having tool compensation active.



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.1 General purpose parameters or variables

General purpose variables are referred to with the letter "P" followed by an integer number. The CNC has four types of general purpose variables.

Parameter type	Range
Local parameters	P0-P25
Global parameters	P100-P299
User parameters	P1000-P1255
OEM (manufacturer's) parameters	P2000 - P2255

Blocks programmed in ISO code allow associating parameters to the G F S T D M fields and coordinates of the axes. The block label number must be defined with a numeric value. If parameters are used in blocks programmed in high-level language, they can be programmed within any expression.

Programmers may use general purpose variables when editing their own programs. Later on, during execution, the CNC will replace these variables with the values assigned to them at the time.

When programming...	When executing...
GP0 XP1 Z100	G1 X-12.5 Z100
(IF (P100 * P101 EQ P102) GOTO N100)	(IF (2 * 5 EQ 12) GOTO N100)

Using these general purpose variables will depend on the type of block in which they are programmed and the channel of execution. Programs that are executed in the user channel may contain any global, OEM or user parameter, but may not use local parameters.

Types of arithmetic parameters

Local parameters

Local parameters can only be accessed from the program or subroutine where they have been programmed. There are seven groups of parameters.

Local parameters used in high-level language may be defined either using the above format or by using the letter A-Z, except for Ñ, so that A is equal to P0 and Z to P25.

The following example shows these two methods of definition:

```
( IF ((P0+P1)* P2/P3 EQ P4) GOTO N100 )
( IF ((A+B)* C/D EQ E) GOTO N100 )
```

When using a parameter name (letter) for assigning a value to it (A instead of P0, for example), if the arithmetic expression is a constant, the instruction can be abbreviated as follows:

```
(P0=13.7) ==> (A=13.7) ==> (A13.7)
```

Be careful when using parenthesis since M30 is not the same as (M30). The CNC interprets (M30) as a high level instruction meaning (P12 = 30) and not the execution of the miscellaneous M30 function.

Global parameters

Global parameters can be accessed from any program and subroutine called from a program.

Global parameters may be used by the user, by the OEM or by the CNC cycles.

User parameters

These parameters are an expansion of the global parameters but they are not used by the CNC cycles.

12.

OEM (manufacturer's) parameters

OEM parameters and subroutines with OEM parameters can only be used in OEM programs; those defined with the [O] attribute. Modifying one of these parameters in the tables requires an OEM password.

Using arithmetic parameters by the cycles

Multiple machining cycles (G60 through G65) and the machining canned cycles (G69, G81 to G89) use the sixth nesting level of local parameters when they are active.

Machining canned cycles use the global parameter P299 for internal calculations and probing canned cycles use global parameters P294 to P299.

Updating arithmetic parameter tables

The CNC will update the parameter table after processing the operations indicated in the block that is in preparation. This operation is always done before executing the block and for this reason, the values shown in the table do not necessarily have to correspond to the block being executed.

If the execution mode is abandoned after interrupting the execution of the program, the CNC will update the parameter tables with values corresponding to the block that was being executed.

When accessing the local parameter and global parameter table, the value assigned to each parameter may be expressed in decimal notation (4127.423) or in scientific notation (0.23476 E-3).

Arithmetic parameters in the subroutines

This CNC has high level instructions that allow the definition and use of subroutines that can be called from the main program, or from another subroutine, it also being possible to call a second subroutine, from the second to a third, etc. The CNC limits these calls to a maximum of 15 nesting levels.

Up to 26 (P0-P25) local parameters may be assigned to a subroutine. These parameters, that will be unknown for blocks outside the subroutine, may be referred to by the blocks that make up the subroutine.

Local parameters may be assigned to more than one subroutine up to 6 parameter nesting levels within the 15 subroutine nesting levels.



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.2 Variables associated with tools.

These variables are associated with the tool offset table, tool table and tool magazine table, so the values which are assigned to or read from these fields will comply with the formats established for these tables.

Tool Offset table

The radius (R), length (L) and wear offset (I, K) values of the tool are given in the active units.

If G70, in inches (within ±3937.00787).

If G71, in millimeters (within ±99999.9999).

If rotary axis in degrees (within ±99999.9999).

Tool table

The tool offset number is an integer between 0 and 255. The maximum number of tool offsets is limited by g.m.p. NTOFFSET.

The family code is a number between 0 and 255.

0 to 199 if it is a normal tool.

200 to 255 if it is a special tool.

The nominal life is given either in minutes or in operations (0..65535).

The real (actual) life is given either in hundredths of a minute (0..9999999) or in operations (0..999999).

Tool magazine table

Each magazine position is represented as follows:

1..255 Tool number.

0 The magazine position is empty.

-1 The magazine position has been canceled.

The tool position in the magazine is represented as follows:

1..255 Position number.

0 The tool is in the spindle.

-1 Tool not found.

-2 The tool is in the change position.

Read-only variables

TOOL

Returns the number of the active tool.

```
(P100=TOOL)
```

Assigns the number of the active tool to parameter P100.

TOD

Returns the number of the active tool offset.

NXTOOL

Returns the next tool number, which is selected but is awaiting the execution of M06 to be active.

NXTOD

Returns the number of the tool offset corresponding to the next tool, which is selected but is awaiting the execution of M06 to be active.

TMZPn

Returns the position occupied in the tool magazine by the indicated tool (n).

Read-and-write variables

TORn

This variable allows the value assigned to the radius of the indicated tool offset (n) in the tool offset table to be read or modified.

```
( P110=TOR3 )
    Assigns the radius value of tool offset -3- to parameter P110.
(TOR3=P111 )
    Assigns the value indicated in parameter P111 to the radius of tool offset 3.
```

TOLn

This variable allows the value assigned to the length of the indicated tool offset (n) to be read or modified in the tool offset table.

TOIn

This variable allows the value assigned to the wear in radius (I) of the indicated tool offset (n) to be read or modified in the tool offset table.

TOKn

This variable allows the value assigned to the wear in length (K) of the indicated tool offset (n) to be read or modified in the tool offset table.

TLFDn

This variable allows the tool offset number of the indicated tool (n) to be read or modified in the tool table.

TLFFn

This variable allows the family code of the indicated tool (n) to be read or modified in the tool table.

TLFNn

This variable allows the value assigned as the nominal life of the indicated tool (n) to be read or modified in the tool table.

TLFRn

This variable allows the value corresponding to the real life of the indicated tool (n) to be read or modified in the tool table.

TMZTn

This variable allows the contents of the indicated position (n) to be read or modified in the tool magazine table.

HTOR

The HTOR variable indicates the tool radius being used by the CNC to do the calculations.

Being a variable that can be read and written by the CNC and read-only from the PLC and DNC, its value may be different from the one assigned in the table (TOR).

On power-up, after a T function, after a RESET or after an M30 function, it assumes the value of the table (TOR).

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables



CNC 8035

-M- MODEL
(SOFT V15.3x)

Application example

To machine a profile with a residual stock of 0.5 mm running 0.1 mm-passes with a tool whose radius is 10 mm.

Assign to the tool radius the value of:

10.5 mm in the table and execute the profile.

10,4 mm in the table and execute the profile.

10,3 mm in the table and execute the profile.

10,2 mm in the table and execute the profile.

10,1 mm in the table and execute the profile.

10,0 mm in the table and execute the profile.

However, if while machining, the program is interrupted or a reset occurs, the table assumes the radius value assigned in that instant (e.g.: 10.2 mm). Its value has changed.

To avoid this, instead of modifying the tool radius in the (TOR) table, use the variable (HTOR) to change the tool radius value used by the CNC to calculate.

Now, if the program is interrupted, the tool radius value initially assigned in the (TOR) table will be correct because it has not changed.

12.**HIGH-LEVEL LANGUAGE PROGRAMMING**
Variables**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

12.2.3 Variables associated with zero offsets.

These variables are associated with the zero offsets and may correspond to the table values or to those currently preset either by means of function G92 or manually in the JOG mode.

The possible zero offsets in addition to the additive offset indicated by the PLC, are G54, G55, G56, G57, G58 and G59.

The values for each axis are given in the active units:

If G70, in inches (within ± 3937.00787).

If G71, in millimeters (within ± 99999.9999).

If rotary axis in degrees (within ± 99999.9999).

Although there are variables which refer to each axis, the CNC only allows those referring to the axes selected at the CNC. Thus, if the CNC controls the X and Z axes, it only allows the variables ORGX and ORGZ in the case of ORG(X-C).

Read-only variables

ORG(X-C)

Returns the value of the active zero offset in the selected axis. The value of the additive offset indicated by the PLC or by the additive handwheel is not included in this value.

```
(P100=ORGX)
```

It assigns to P100 the X value of the part zero active for the X axis. This value could have been set either manually, by means of function G92 or by the variable "ORG(X-C)n".

PORGF

Returns the abscissa value of the polar coordinate origin with respect to the Cartesian origin.

PORGS

Returns the ordinate value of the polar coordinate origin with respect to the Cartesian origin.

ADIOF(X-C)

It returns the value of the zero offset generated by the additive handwheel in the selected axis.

Read-and-write variables

ORG(X-C)n

This variable allows the value of the selected axis to be read or modified in the table corresponding to the indicated zero offset (n).

```
(P110=ORGX 55)
```

Loads parameter P100 with the X value of G55 in the zero offset table.

```
(ORY 54=P111)
```

It assigns parameter P111 to the Y axis in the table for the G54 offset.

12.

PLCOF(X-C)

This variable allows the value of the selected axis to be read or modified in the table of additive offsets indicated by the PLC.

Accessing any of the PLCOF(X-C) variables interrupts block preparation and the CNC waits for that command to be executed before resuming block preparation.

12.**HIGH-LEVEL LANGUAGE PROGRAMMING**
Variables**CNC 8035**·M· MODEL
(SOFT V15.3x)

12.2.4 Variables associated with machine parameters

These variables associated with machine parameters are read-only variables. These variables may be read and written when executed inside an OEM program or subroutine.

Refer to the installation and start-up manual to know the format of the values returned. The values of 1/0 correspond to the parameters that are set as YES/NO, +/- or ON/OFF.

The coordinate and feedrate values are given in the active units:

If G70, in inches (within ± 3937.00787).

If G71, in millimeters (within ± 99999.9999).

If rotary axis in degrees (within ± 99999.9999).

Modify the machine parameters from an OEM program or subroutine.

These variables may be read and written when executed inside an OEM program or subroutine. In this case, these variables can be used to modify the value of certain machine parameters. Refer to the installation manual for the list of machine parameters that may be modified.

In order to be able to modify these parameters via PLC, an OEM subroutine containing the relevant variables must be executed using the CNCEX command.

Read-only variables

MPGn

Returns the value assigned to general machine parameter (n).

```
( P110=MPG8 )
```

It assigns the value of the general machine parameter P8 "INCHES" to parameter P110, if millimeters P110=0 and if inches P110=1.

MP(X-C)n

Returns the value assigned to the machine parameter (n) of the indicated axis (X-C).

```
( P110=MPY 1 )
```

Assigns the value of Y axis machine parameter P1 "DFORMAT" to parameter P110.

MPSn

Returns the value assigned to the indicated machine parameter (n) of the main spindle.

MPLCn

Returns the value assigned to the indicated machine parameter (n) of the PLC.



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.5 Variables associated with work zones

Variables associated with work zones are read-only variables.

The values of the limits are given in the active units:

If G70, in inches (within ±3937.00787).

If G71, in millimeters (within ±99999.9999).

If rotary axis in degrees (within ±99999.9999).

The status of the work zones are defined according to the following code:

0 = Disabled.

1 = Enabled as no-entry zone.

2 = Enabled as no-exit zone.

Read-only variables

FZONE

It returns the status of work zone 1.

FZLO(X-C)

Lower limit of zone 1 along the selected axis (X-C).

FZUP(X-C)

Upper limit of zone 1 along the selected axis (X-C).

```
(P100=FZONE)      ; It assigns to parameter P100 the status of work zone 1.
(P101=FZOLOX)     ; It assigns the lower limit of zone 1 to parameter P101.
(P102=FZUPZ)      ; It assigns the upper limit of zone 1 to parameter P102.
```

SZONE

Status of work zone 2.

SZLO(X-C)

Lower limit of zone 2 along the selected axis (X-C).

SZUP(X-C)

Upper limit of zone 2 along the selected axis (X-C).

TZONE

Status of work zone 3.

TZLO(X-C)

Lower limit of zone 3 along the selected axis (X-C)

TZUP(X-C)

Upper limit of zone 3 along the selected axis (X-C).

FOZONE

Status of work zone 4.

FOZLO(X-C)

Lower limit of zone 4 along the selected axis (X-C).

FOZUP(X-C)

Upper limit of zone 4 along the selected axis (X-C).

FIZONE

Status of work zone 5.

FIZLO(X-C)

Lower limit of zone 5 along the selected axis (X-C).

FIZUP(X-C)

Upper limit of zone 5 along the selected axis (X-C).

12.



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.6 Variables associated with feedrates

Read-only variables associated with the real (actual) feedrate

FREAL

It returns the CNC's real feedrate. In mm/minute or inches/minute.

```
( P100=FREAL )
```

It assigns the real feedrate value of the CNC to parameter P100.

FREAL(X-C)

It returns the actual (real) CNC feedrate of the selected axis.

FTEO(X-C)

It returns the theoretical CNC feedrate of the selected axis.

Read-only variables associated with function G94

FEED

It returns the feedrate selected at the CNC by function G94. In mm/minute or inches/minute.

This feedrate may be indicated by program, by PLC or by DNC; the CNC selects one of them, the one indicated by DNC has the highest priority and the one indicated by program has the lowest priority.

DNCF

It returns the feedrate, in mm/minute or inches/minute selected by DNC. If it has a value of 0 it means that it is not selected.

PLCF

It returns the feedrate, in mm/minute or inches/minute selected by PLC. If it has a value of 0 it means that it is not selected.

PRGF

It returns the feedrate, in mm/minute or inches/minute selected by program.

Read-only variables associated with function G95

FPREV

It returns the feedrate selected at the CNC by function G95. In mm/turn or inches/turn.

This feedrate may be indicated by program, by PLC or by DNC; the CNC selects one of them, the one indicated by DNC has the highest priority and the one indicated by program has the lowest priority.

DNCFPR

It returns the feedrate, in mm/turn or inches/turn selected by DNC. If it has a value of 0 it means that it is not selected.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

12.

PLCFPR

It returns the feedrate, in mm/turn or inches/turn selected by PLC. If it has a value of 0 it means that it is not selected.

PRGFPR

It returns the feedrate, in mm/turn or inches/turn selected by program.

Read-only variables associated with function G32

PRGFIN

It returns the feedrate selected by program, in 1/min.

Likewise, the CNC variable FEED, associated with G94, indicates the resulting feedrate in mm/min or inches/min.

Read-only variables associated with the override

FRO

It returns the feedrate override (%) currently selected at the CNC. It is given in integer values between 0 and "MAXFOVR" (maximum 255).

This feedrate percentage may be indicated by program, by PLC, by DNC or by the front panel; the CNC selects one of them and the priority (from the highest to the lowest) is: by program, by DNC, by PLC and from the front panel switch.

DNCFRO

It returns the feedrate override % currently selected by the DNC. If it has a value of 0 it means that it is not selected.

PLCFRO

It returns the feedrate override % currently selected by the PLC. If it has a value of 0 it means that it is not selected.

CNCFRO

It returns the feedrate override % currently selected by the switch.

PLCCFR

It returns the feedrate percentage currently selected by the PLC's execution channel.

Read-write variables associated with the override

PRGFRO

This variable may be used to read or modify the feedrate override percentage currently selected by program. It is given in integer values between 0 and "MAXFOVR" (maximum 255). If it has a value of 0 it means that it is not selected.

```
( P110=PRGFRO )
```

It assigns to P110 the % of feedrate override selected by program.

```
( PRGFRO=P111 )
```

It sets the feedrate override % selected by program to the value of P111.

12.2.7 Variables associated with coordinates

The coordinate values for each axis are given in the active units:

If G70, in inches (within ±3937.00787).

If G71, in millimeters (within ±99999.9999).

If rotary axis in degrees (within ±99999.9999).

Read-only variables

Accessing any of the variables POS(X-C), TPOS(X-C), APOS(X-C), ATPOS(X-C), DPOS(X-C) or FLWE(X-C) interrupts block preparation and the CNC waits for that command to be executed before resuming block preparation.

PPOS(X-C)

Returns the programmed theoretical coordinate of the selected axis.

```
( P110=PPOSX )
```

It assigns to P100 the programmed theoretical position of the X axis.

POS(X-C)

It returns the real tool base position value referred to machine reference zero (home).

On limit-less rotary axes, this variable takes into account the value of the active zero offset. The values of the variable are between the active zero offset and ±360° (ORG* ± 360°).

If ORG* = 20° it displays between 20° and 380° / displays between -340° and 20°.

If ORG* = -60° it displays between -60° and 300° / displays between -420 and -60°

TPOS(X-C)

It returns the theoretical position value (real coordinate + following error) of the tool base referred to machine reference zero (home).

On limit-less rotary axes, this variable takes into account the value of the active zero offset. The values of the variable are between the active zero offset and ±360° (ORG* ± 360°).

If ORG* = 20° it displays between 20° and 380° / displays between -340° and 20°.

If ORG* = -60° it displays between -60° and 300° / displays between -420 and -60°

APOS(X-C)

It returns the real tool base position value, referred to part zero, of the selected axis.

ATPOS(X-C)


It returns the theoretical position value (real coordinate + following error) of the tool base referred to part zero.

DPOS(X-C)

The CNC updates this variable when probing, functions G75 and G76.

When the digital probe communicates with the CNC via infrared beams, there could be some delay (milliseconds) from the time the probe touches the part to the instant the CNC receives the probe signal.

12.

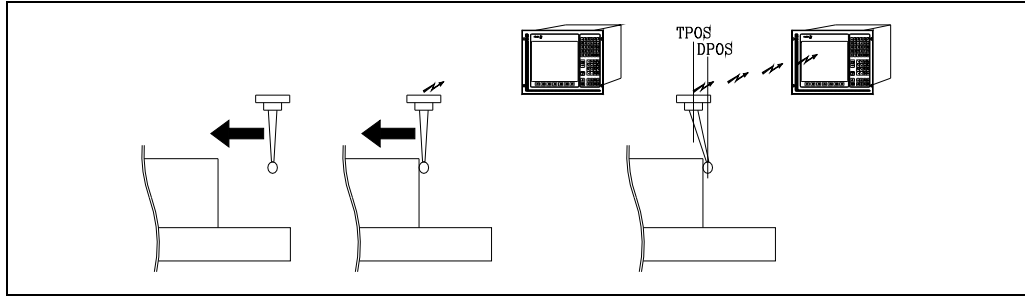

Although the probe keeps moving until the CNC receives the probing signal, the CNC takes into account the value assigned to general machine parameter PRODEL and provides the following information in the variables TPOS(X-C) and DPOS(X-C).

TPOS(X-C) Actual position of the probe when the CNC receives the probe signal.

DPOS(X-C) Theoretical position of the probe when the probe touched the part.

FLWE(X-C)

It returns the following error of the selected axis.

DPLY(X-C)

It returns the position value (coordinate) shown on the screen for the selected axis.

GPOS(X-C)n p

Programmed coordinate for a particular axis in the indicated (n) block of the (p) program.

```
(P80=GPOSX N99 P100)
```

It assigns to parameter P88 the value of the coordinate programmed for the X axis in the block having the label N99 and located in program P100.

Only programs located in the CNC's RAM memory may be consulted.

If the defined program or block does not exist, it shows the relevant error message. If the indicated block does not contain the requested axis, it returns the value 100000.0000.

Read-and-write variables

DIST(X-C)

These variables may be used to read or modify the distance traveled by the selected axis. This value is accumulative and is very useful when it is required to perform an operation which depends on the distance traveled by the axes, their lubrication for example.

```
(P110=DISTX)
```

It assigns to P110 the distance traveled by the X axis

```
(DISTX=P111)
```

It presets the variable indicating the distance traveled by the Z axis with the value of arithmetic parameter P111.

Accessing any of the DIST(X-C) variables interrupts block preparation and the CNC waits for that command to be executed before resuming block preparation.

LIMPL(X-C)**LIMMI(X-C)**

With these variables, it is possible to set a second travel limit for each axis: LIMPL for the upper limit and LIMMI for the lower one.

Since the second limits are activated or deactivated from the PLC, through general logic input ACTLIM2 (M5052), besides setting the limits, an auxiliary M code must be executed to let it know.

It is also recommended to execute function G4 after the change so the CNC executes the following blocks with the new limits.

The second travel limit will be taken into account if the first one has been set using axis machine parameters LIMIT+ (P5) and LIMIT- (P6).

12.

12.2.8 Variables associated with electronic handwheels

Read-only variables

HANPF

HANPS

HANPT

HANPFO

They return the pulses of the first (HANPF), second (HANPS), third (HANPT) or fourth (HANPFO) handwheel received since the CNC was turned on.

HANDSE

For handwheels with axis selector button, it indicates whether that button has been pressed or not. A value of ·0· means that it has not been pressed.

HANFCT

It returns the multiplying factor set by PLC for each handwheel.

It must be used when using several electronic handwheels or when using a single handwheel but different multiplying factors (x1, x10, x100) are to be applied to each axis.

C			B			A			W			V			U			Z			Y			X		
c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a

Once the switch has been turned to one of the handwheel positions, the CNC checks this variable and, depending on the values assigned to each axis bit (c, b, a) it applies the multiplying factor selected for each one of them.

c	b	a	
0	0	0	The value indicated at the front panel or keyboard switch.
0	0	1	x1 factor
0	1	0	x10 factor
1	0	0	x100 factor

If there are more than one bit set to "1" for an axis, the least significant bit will be considered. Thus:

c	b	a	
1	1	1	x1 factor
1	1	0	x10 factor



The screen always shows the value selected at the switch.

HBEVAR

It must be used when having a Fagor HBE handwheel.

It indicates whether the HBE handwheel is enabled or not, the axis to be jogged and the multiplying factor to be applied (x1, x10, x100).

			C			B			A			W			V			U			Z			Y			X		
*	^		c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a	c	b	a

(*) Indicates whether the HBE handwheel pulses will be taken into account or not in jog mode.

0 = They are ignored.

1 = They are taken into account.

(^) When the machine has a general handwheel and individual handwheels (associated with an axis), it indicates which handwheel has priority when both are turned at the same time.

0 = The individual handwheel has priority. The relevant axis ignores the pulses from the general handwheel, the rest of the axes don't.

12.

1 = The general handwheel has priority. It ignores the pulses from the individual handwheel.

(a, b, c) Indicate the axis to be moved and the selected multiplying factor.

c	b	a	
0	0	0	The value indicated at the front panel or keyboard switch.
0	0	1	x1 factor
0	1	0	x10 factor
1	0	0	x100 factor

If several axes are selected, the following order of priority is applied: X, Y, Z, U, V, W, A, B, C.

If there are more than one bit set to "1" for an axis, the least significant bit will be considered. Thus:

c	b	a	
1	1	1	x1 factor
1	1	0	x10 factor


The HBE handwheel has priority. That is, regardless of the mode selected at the CNC switch (continuous or incremental JOG, handwheel), HBEVAR is set to other than "0", the CNC goes into handwheel mode.

It shows the selected axis in reverse video and the multiplying factor selected by the PLC. When the HBEVAR variable is set to "0", it shows the mode selected by the switch again.

Read-and-write variables

MASLAN

It must be used when the path-handwheel or the path-jog is selected.

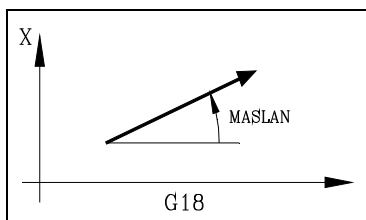


Indicates the angle of the linear path.

MASCFI

MASCSE

They must be used when the path-handwheel or the path-jog is selected.

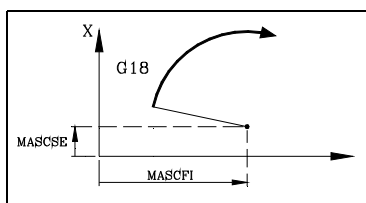

On circular paths (arcs), they indicate the center coordinates.

12.2.9 Variables associated with feedback

ASIN(X-C)

"A" signal of the CNC's sinusoidal feedback for the X-C axis.

BSIN(X-C)

"B" signal of the CNC's sinusoidal feedback for the X-C axis.

ASINS

"A" signal of the CNC's sinusoidal feedback for the spindle.

BSINS

"B" signal of the CNC's sinusoidal feedback for the spindle.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.10 Variables associated with the main spindle

In these variables associated with the spindle, their values are given in revolutions per minute and the main spindle override values are given in integers from 0 to 255.

Certain variables interrupt block preparation (it is indicated in each one) and the CNC waits for that command to be executed before resuming block preparation.

Read-only variables

SREAL

Returns the real main spindle turning speed in revolutions per minute. It interrupts block preparation.

```
(P100=SREAL)
```

It assigns to P100 the real turning speed of the main spindle.

FTEOS

It returns the theoretical turning speed of the main spindle.

SPEED

Returns, in revolutions per minute, the main spindle speed selected at the CNC.

This turning speed may be indicated by program, by PLC or by DNC; the CNC selects one of them, the one indicated by DNC has the highest priority and the one indicated by program has the lowest priority.

DNCS

Returns the turning speed in revolutions per minute, selected by DNC. If it has a value of 0 it means that it is not selected.

PLCS

Returns the turning speed in revolutions per minute selected by PLC. If it has a value of 0 it means that it is not selected.

PRGS

Returns the turning speed in revolutions per minute, selected by program.

SSO

It returns the turning speed override (%) of the main spindle currently selected at the CNC. It is given in integer values between 0 and "MAXFOVR" (maximum 255).

This turning speed percentage of the main spindle may be indicated by program, by PLC, by DNC or by the front panel; the CNC selects one of them and the priority (from the highest to the lowest) is: by program, by DNC, by PLC and from the front panel.

DNCSO

It returns the turning speed override % of the main spindle currently selected via DNC. If it has a value of 0 it means that it is not selected.

PLCSO

It returns the turning speed override % of the main spindle currently selected by PLC. If it has a value of 0 it means that it is not selected.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

12.

CNCSSO

It returns the turning speed override % of the main spindle currently selected from the front panel.

SLIMIT

It returns the value set in rpm at the CNC for the turning speed limit of the main spindle.

This limit may be indicated by program, by PLC or by DNC; the CNC selects one of them, the one indicated by DNC has the highest priority and the one indicated by program has the lowest priority.

DNCSL

It returns the speed limit of the main spindle in rpm currently selected via DNC. If it has a value of 0 it means that it is not selected.

PLCSL

It returns the speed limit of the main spindle in rpm currently selected by PLC. If it has a value of 0 it means that it is not selected.

PRGSL

It returns the speed limit of the main spindle in rpm currently selected by program.

MDISL

Maximum machining spindle speed. This variable is also updated (refreshed) when programming function G92 via MDI.

POSS

It returns the real position of the main spindle. Its value may be within $\pm 99999.9999^\circ$. It interrupts block preparation.

RPOSS

It returns the real position of the main spindle in 360° module. Its value may be between 0 and 360° . It interrupts block preparation.

TPOSS

It returns the theoretical position of the main spindle (real position + lag). Its value may be within $\pm 99999.9999^\circ$. It interrupts block preparation.

RTPOSS

It returns the theoretical position of the main spindle (real position + lag) in 360° module. Its value may be between 0 and 360° . It interrupts block preparation.

PRGSP

Position programmed in M19 via program for the main spindle. This variable may be read from the CNC, from the PLC and from DNC.

FLWES

It returns the main spindle's following error in degrees (within ± 99999.9999). It interrupts block preparation.

Read-and-write variables

PRGSSO

This variable may be used to read or modify the speed override percentage of the main spindle currently selected by program. It is given in integer values between 0 and "MAXFOVR" (maximum 255). If it has a value of 0 it means that it is not selected.

```
( P110=PRGSSO )
```

It assigns to P110 the % of the main spindle speed selected by program.

```
( PRGSSO=P111 )
```

It sets the value indicating the main spindle speed % selected by program to the value of arithmetic parameter P111.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.11 PLC related variables

It should be borne in mind that the PLC has the following resources:

(I1 thru I256)	Inputs.
(O1 thru O256)	Outputs.
M1 thru M5957)	Marks.
(R1 thru R499)	32-bit registers.
(T1 thru T256)	Timers with a timing count in 32 bits.
(C1 thru C256)	Counters with a count in 32 bits.

If any variable is accessed which allows the status of a PLC variable to be read or modified (I,O,M,R,T,C), block preparation is interrupted and the CNC waits for this command to be executed in order to restart block preparation.

Read-only variables

PLCMSG

Returns the number of the active PLC message with the highest priority and will coincide with the number displayed on screen (1..128). If there is none, it returns 0.

(P110=PLCMSG)

It assigns to P100 the number of the active PLC message with the highest priority.

Read-and-write variables

PLCIn

This variable allows 32 PLC inputs to be read or modified starting with the one indicated (n).

The value of the inputs which are used by the electrical cabinet cannot be modified as their values are determined by it. Nevertheless, the status of the remaining inputs can be modified.

PLCO n

This variable allows 32 PLC outputs to be read or modified starting from the one indicated (n).

(P110=PLCO 22)

It assigns to parameter P110 the value of outputs O22 through O53 (32 outputs) of the PLC.

(PLCO 22=\$F)

It sets outputs O22 through O25 to "1" and outputs O26 through O53 to "0".

Bit	31	30	29	28	27	26	25	24	23	22	...	5	4	3	2	1	0
	0	0	0	0	0	0	0	0	0	0	...	0	0	1	1	1	1
Output	53	52	51	50	49	48	47	46	45	44	...	27	26	25	24	23	22

PLCMn

This variable allows 32 PLC marks to be read or modified starting from the one indicated (n).

PLCRn

This variable allows the status of 32 register bits to be read or modified starting from the one indicated (n).

PLCTn

This variable allows the timer count to be read or modified starting from the one indicated (n).

12.

PLCCn

This variable allows the counter count to be read or modified starting from the one indicated (n).

PLCMMn

This variable permits reading or modifying the PLC mark (n).

```
( PLMM4=1 )
```

It sets mark M4 to ·1· and leaves the rest untouched.

```
( PLCM4=1 )
```

It sets mark M4 to ·1· and the following 31 marks (M5, through M35) to ·0·

12.

12.2.12 Variables associated with local parameters

The CNC allows 26 local parameters (P0-P25) to be assigned to a subroutine, by using mnemonics PCALL and MCALL. In addition to performing the required subroutine these mnemonics allow local parameters to be initialized.

Read-only variables

12.

CALLP

Allows us to know which local parameters have been defined and which have not, in the call to the subroutine by means of the PCALL or MCALL mnemonic.

The information will be given in the 26 least significant bits (bits 0-25), each of these corresponding to the local parameter of the same number; thus bit 12 corresponds to P12.

Each bit will indicate whether the corresponding local parameter has been defined (=1) or not (0).

Bit	31	30	29	28	27	26	25	24	23	22	...	5	4	3	2	1	0
	0	0	0	0	0	0	*	*	*	*	...	*	*	*	*	*	*

Example:

```

;Call to subroutine 20.
(PCALL 20, P0=20, P2=3, P3=5)
...
...
;Beginning of subroutine 20.
( SUB 20)
(P100 = CALLP)
...
...
    
```

In parameter P100 the following will be obtained:

0000	0000	0000	0000	0000	0000	0000	0000	1101	LSB
------	------	------	------	------	------	------	------	------	-----



CNC 8035

-M- MODEL
(SOFT V15.3x)

12.2.13 Operating-mode related variables

Read-only variables related to the standard mode

OPMODE

It returns the code corresponding to the selected operating mode.

0 = Main menu.

10 = Automatic execution.

11 = Single block execution.

12 = MDI in EXECUTION.

13 = Tool inspection.

14 = Repositioning.

15 = Block search executing G.

16 = Block search executing G, M, S, T.

20 = Theoretical path simulation.

21 = G function simulation.

22 = G, M, S and T function simulation.

23 = Simulation with movement in the main plane.

24 = Simulation with rapid movement.

25 = Rapid simulation with S=0.

30 = Normal editing.

31 = User editing.

32 = TEACH-IN editing.

33 = Interactive editor.

40 = Movement in continuous JOG.

41 = Movement in incremental JOG.

42 = Movement with electronic handwheel.

43 = HOME search in JOG.

44 = Position preset in JOG.

45 = Tool calibration.

46 = MDI in JOG.

47 = User JOG operation.

50 = Zero offset table.

51 = Tool offset table.

52 = Tool table.

53 = Tool magazine table.

54 = Global parameter table.

55 = Local parameter table.

56 = User parameter table.

57 = OEM parameter table.

60 = Utilities.

70 = DNC status.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

12.

HIGH-LEVEL LANGUAGE PROGRAMMING
Variables

71 = CNC status.

80 = PLC file editing.

81 = PLC program compilation.

82 = PLC monitoring.

83 = Active PLC messages.

84 = Active PLC pages.

85 = Save PLC program.

86 = Restore PLC program.

87 = PLC usage maps.

88 = PLC statistics.

90 = Customizing.

100 = General machine parameter table.

101 = Axis machine parameter tables.

102 = Spindle machine parameter table.

103 = Serial line related machine parameter tables.

104 = PLC machine parameter table.

105 = M function table.

106 = Leadscrew error compensation tables and cross compensation tables.

110 = Diagnosis: configuration.

111 = Diagnosis: hardware test.

112 = Diagnosis: RAM memory test.

113 = Diagnosis: Flash memory test.

114 = User diagnosis.



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.2.14 Other variables

Read-only variables

NBTOOL

Indicates the tool number being managed. This variable can only be used within the tool change subroutine.

Example: There is a manual tool changer. Tool T1 is currently selected and the operator requests tool T5.

The subroutine associated with the tools may contain the following instructions:

```
(P103 = NBTOOL)
(MSG "SELECT T?P103 AND PRESS CYCLE START")
```

Instruction (P103 = NBTOOL) assigns the number of the tool currently being managed to parameter P103. Therefore, P103=5.

The message displayed by the CNC will be ""SELECT T5 AND PRESS CYCLE START".

PRGN

Returns the program number being executed. Should none be selected, a value of -1 is returned.

BLKN

It returns the label number of the last executed block.

GSn

Returns the status of the G function indicated (n). 1 if it is active and 0 if not.

```
(P120=GS17)
It assigns the value 1 to parameter P120 if the G17 function is active and 0 if not.
```

MSn

Returns the status of the M function indicated (n). 1 if it is active and 0 if not.

These functions are M00, M01, M02, M03, M04, M05, M06, M08, M09, M19, M30, M41, M42, M43 and M44.


12.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING Variables

PLANE

Returns data on the abscissa axis (bits 4 to 7) and the ordinate axis (bits 0 to 3) of the active plane in 32 bits and in binary.

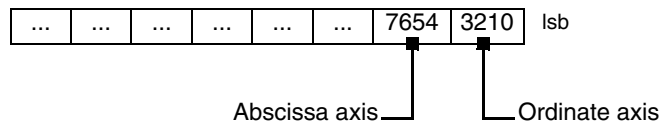

The axes are coded in 4 bits and indicate the axis number according to the programming order.

Example: If the CNC controls the X, Y and Z axes and the ZX plane (G18) is selected.

(P122 = PLANE) assigns the value of \$31 to parameter P122.

0000	0000	0000	0000	0000	0000	0011	0001	LSB
------	------	------	------	------	------	------	------	-----

Abscissa axis = 3 (0011) => Z axis

Ordinate axis = 1 (0001) => X axis

LONGAX

It returns the number according to the programming order corresponding to the longitudinal axis. This will be the one selected with the G15 function and by default the axis perpendicular to the active plane, if this is XY, ZX or YZ.

Example:

If the CNC controls the X, Y and Z axes and the Z axis is selected.

(P122 = LONGAX) assigns the value 3 to parameter P122.

MIRROR

Returns in the least significant bits of the 32-bit group, the status of the mirror image of each axis, 1 in the case of being active and 0 if not.

Bit 8	Bit 7	Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	LSB
						Axis 3	Axis 2	Axis 1	

The axis name corresponds to the number according to the programming order for them.

Example: If the CNC controls the X, Y and Z axes, axis1=X, axis2 = Y, axis 3=Z.

SCALE

It returns the general scaling factor being applied.

SCALE(X-C)

Returns the specific scaling factor of the indicated axis (X-C).

ORGROT

It returns the rotation angle of the coordinate system currently selected with G73. Its value is given in degrees (within ±99999.9999).

ROTPF

Returns the abscissa value of the rotation center with respect to the Cartesian coordinate origin. It is given in the active units:

If G70, in inches (within ±3937.00787).

If G71, in millimeters (within ±99999.9999).

ROTPS

Returns the ordinate value of the rotation center with respect to the Cartesian coordinate origin. It is given in the active units:



CNC 8035

·M· MODEL (SOFT V15.3x)

If G70, in inches (within ±3937.00787).
 If G71, in millimeters (within ±99999.9999).

PRBST

Returns probe status.

- 0 = the probe is not touching the part.
- 1 = the probe is touching the part.

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

CLOCK

Returns the time in seconds indicated by the system clock. Possible values 0..4294967295.

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

TIME

Returns the time in hours-minutes-seconds format.

```
(P150=TIME)
Loads P150 with hh-mm-ss. For example if the time is: 34sec. P150 = 182234.
```

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

DATE

Returns the date in year-month-day format.

```
(P151=DATE)
It assigns to P151 the year-month-day. For example if the date is April 25th 1992, P151 = 920425.
```

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

CYTIME

It returns the amount of time (in hundredths of a second) elapsed executing the part. It ignores the time the execution has been interrupted. Possible values 0..4294967295.

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

FIRST

Indicates whether it is the first time that a program has been run or not. It returns a value of 1 if it is the first time and 0 if not.

A first-time execution is considered as being one which is done:

- After turning on the CNC.
- After pressing [SHIFT]+[RESET].
- Every time a new program is selected.

ANAI_n

Returns in volts and in ±1.4 format (values ±5 Volts), the status of the analog input indicated (n), it being possible to select one among eight (1..8) analog inputs.

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.



CNC 8035

·M· MODEL
 (SOFT V15.3x)

TIMEG

It shows the timing status of the timer programmed with G4 K in the CNC channel. This variable, returns the time remaining to end the timing block in hundredths of a second.

RIP

Linear theoretical feedrate resulting from the next loop (in mm/min).

The calculation of the resulting feedrate ignores the rotary axes, slave axes (gantry, coupled and synchronized) as well as DRO axes.

Read-and-write variables

TIMER

This variable allows reading or modifying the time, in seconds, indicated by the clock enabled by the PLC. Possible values 0..4294967295.

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

PARTC

The CNC has a part counter whose count increases, in all modes except simulation, every time M30 or M02 is executed and this variable allows its value to be read or modified. This value will be between 0 and 4294967295

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

KEY

Returns the code of the last key accepted.

This variable may be used as a write variable only inside a customizing program (user channel).

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

KEYSRC

This variable allows reading or modifying the source of keystrokes, possible values being:

- 0 = Keyboard.
- 1 = PLC.
- 2 = DNC.

The CNC only allows modification of this variable if this is at 0.

ANAOn

This variable allows the required analog output (n) to be read or modified. The value assigned will be expressed in volts and in the ± 2.4 format (± 10 V).

The analog outputs which are free among the eight (1 through 8) available at the CNC may be modified, the corresponding error being displayed if an attempt is made to write in one which is occupied.

If this variable is accessed, block preparation is interrupted and the CNC waits for this command to be executed to resume block preparation.

SELPRO

When having two probe inputs, it allows selecting the active input.

On power-up, it assumes the value of ·1· thus selecting the first probe input. To select the second probe input, set it to a value of ·2·.

Accessing this variable from the CNC interrupts block preparation.

DIAM

It changes the programming mode for X axis coordinates between radius and diameter. When changing the value of this variable, the CNC assumes the new way to program the following blocks.

When the variable is set to ·1·, the programmed coordinates are assumed in diameter; when is set to ·0·, the programmed coordinates are assumed in radius.

This variable affects the display of the real value of the X axis in the coordinate system of the part and the reading of variables PPOSX, TPOSX and POSX.

On power-up, after executing an M02 or M30 and after an emergency or a reset, the variable is initialized according to the value of the DFORMAT parameter of the X axis. If this parameter has a value equal to or greater than 4, the variable takes a value of 1; otherwise, it takes the value of ·0·.

PRBMOD

It indicates whether a probing error is to issued or not in the following cases, even if general machine parameter PROBERR (P119) =YES.

- When a G75 probing move finishes before the probe has touched part.
- When a G76 probing move finishes but the probe is still touching the part.

The PRBMOD variable takes the following values.

Value	Meaning
0	An error message is issued.
1	No error message is issued.

Default value 0.

The PRBMOD variable can be read and written from the CNC and the PLC an read from the DNC.

12.3 Constants

Constants are defined as being all those fixed values which cannot be altered by a program. The following are considered as constants:

- Numbers expressed in the decimal system.
- Hexadecimal numbers.
- PI constant.
- Read-only tables and variables as their value cannot be altered with a program.

12.**HIGH-LEVEL LANGUAGE PROGRAMMING**
Constants**CNC 8035**-M- MODEL
(SOFT V15.3x)

12.4 Operators

An operator is a symbol that indicates the mathematical or logic operations to carry out. The CNC has arithmetic, relational, logic, binary, trigonometric operators and special operators.

Arithmetic operators.

+	add.	P1=3 + 4	P1=7
-	subtraction, also a negative value.	P2=5 - 2 P3= -(2 * 3)	P2=3 P3=-6
*	multiplication.	P4=2 * 3	P4=6
/	division.	P5=9 / 2	P5=4.5
MOD	Module or remainder of the division.	P6=7 MOD 4	P6=3
EXP	exponential.	P7=2 EXP 3	P7=8

Relational operators.

EQ	equal.
NE	different.
GT	greater than.
GE	greater than or equal to.
LT	Less than.
LE	Less than or equal to.

Logic and binary operators.

NOT, OR, AND, XOR: The act as logic operators between conditions and as binary operators between variables and constants.

```
IF (FIRST AND GS1 EQ 1) GOTO N100
P5 = (P1 AND (NOT P2 OR P3))
```

Trigonometric functions.

SIN	sine.	P1=SIN 30	P1=0.5
COS	cosine.	P2=COS 30	P2=0.8660
TAN	tangent.	P3=TAN 30	P3=0.5773
ASIN	arc sine.	P4=ASIN 1	P4=90
ACOS	arc cosine.	P5=ACOS 1	P5=0
ATAN	arc tangent.	P6=ATAN 1	P6=45
ARG	ARG(x,y) arctangent y/x.	P7=ARG(-1,-2)	P7=243.4349

There are two functions for calculating the arc tangent ATAN which returns the result between ±90° and ARG given between 0 and 360°.

12.

Other functions.

ABS	absolute value.	P1=ABS -8	P1=8
LOG	decimal logarithm.	P2=LOG 100	P2=2
SQRT	square root.	P3=SQRT 16	P3=4
ROUND	rounding up an integer number.	P4=ROUND 5.83	P4=6
FIX	Integer.	P5=FIX 5.423	P5=5
FUP	if integer takes integer. if not, takes entire part + 1.	P6=FUP 7 P6=FUP 5.423	P6=7 P6=6
BCD	converts given number to BCD.	P7=BCD 234	P7=564

0010	0011	0100
------	------	------

BIN	converts given number to binary.	P8=BIN \$AB	P8=171
-----	----------------------------------	-------------	--------

1010	1011
------	------

Conversions to binary and BCD are made in 32 bits, it being possible to represent the number 156 in the following formats:

decimal	156
Hexadecimal	9C
Binary	0000 0000 0000 0000 0000 0000 1001 1100
BCD	0000 0000 0000 0000 0000 0001 0101 0110

12.

HIGH-LEVEL LANGUAGE PROGRAMMING Operators



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.5 Expressions

An expression is any valid combination of operators, constants, parameters and variables.

All expressions must be placed between brackets, but if the expression is reduced to an integer, the brackets can be removed.

12.**HIGH-LEVEL LANGUAGE PROGRAMMING**
Expressions**FAGOR** **CNC 8035**·M· MODEL
(SOFT V15.3x)

12.5.1 Arithmetic expressions

These are formed by combining functions and arithmetic, binary and trigonometric operators with the constants and variables of the language.

The priorities of the operators and the way they can be associated determine how these expressions are calculated:

Priority from highest to lowest	To be associated
NOT, functions, - (negative)	from right to left.
EXP, MOD	from left to right.
*, /	from left to right.
+,- (add, subtract)	from left to right.
Relational operators	from left to right.
AND, XOR	from left to right.
OR	from left to right.

Brackets should be used in order to clarify the order in which the expression is to be evaluated.

$(P3 = P4/P5 - P6 * P7 - P8/P9)$

$(P3 = (P4/P5) - (P6 * P7) - (P8/P9))$

Using redundant or additional brackets will neither cause errors nor slow down the execution.

In functions, brackets must be used except when these are applied to a numerical constant, in which case they are optional.

$(\text{SIN } 45)$ $(\text{SIN } (45))$ they're both valid and equivalent.

$(\text{SIN } 10+5)$ the same as $((\text{SIN } 10)+5)$.

Expressions can be used also to reference parameters and tables:

$(P100 = P9)$

$(P100 = P(P7))$

$(P100 = P(P8 + \text{SIN}(P8 * 20)))$

$(P100 = \text{ORGX } 55)$

$(P100 = \text{ORGX } (12+P9))$

$(\text{PLCM}5008 = \text{PLCM}5008 \text{ OR } 1)$

; Selects single block execution mode (M5008=1)

$(\text{PLCM}5010 = \text{PLCM}5010 \text{ AND } \$\text{FFFFFFFE})$

; Frees feedrate override (M5010=0)

12.



CNC 8035

·M· MODEL
(SOFT V15.3x)

12.5.2 Relational expressions

These are arithmetic expressions joined by relational operators.

(IF (P8 EQ 12.8)

; It checks if the value of P8 is equal to 12.8.

(IF (ABS(SIN(P24)) GT SPEED)

;Analyzes if the sine is greater than the spindle speed.

(IF (CLOCK LT (P9 * 10.99))

; Analyzes if the clock count is less than (P9 * 10.99)

At the same time these conditions can be joined by means of logic operators.

(IF ((P8 EQ 12.8) OR (ABS(SIN(P24)) GT SPEED)) AND (CLOCK LT (P9 * 10.99)) ...

The result of these expressions is either true or false.

12.

12.

HIGH-LEVEL LANGUAGE PROGRAMMING Expressions



CNC 8035

·M· MODEL
(SOFT V15.3x)

The control instructions available to high-level programming can be grouped as follows:

- Assignment instructions.
- Display instructions.
- Enable-disable instructions.
- Flow control instructions.
- Subroutine instructions.
- Interruption-subroutine instructions.
- Program instructions.
- Screen customizing instructions.

Only one instruction can be programmed in each block, and no other additional information may be programmed in this block.

13.1 Assignment instructions

This is the simplest type of instruction and can be defined as:

(target = arithmetic expression)

A local or global parameter or a read-write variable may be selected as target. The arithmetic expression may be as complex as required or a simple numerical constant.

(P102 = FZLOY)

(ORGY 55 = (ORGY 54 + P100))

In the specific case of designating a local parameter using its name (A instead of P0, for example) and the arithmetic expression being a numerical constant, the instruction can be abbreviated as follows:

(P0=13.7) ==> (A=13.7) ==> (A13.7)

Within a single block, up to 26 assignments can be made to different targets, a single assignment being interpreted as the set of assignments made to the same target.

(P1=P1+P2, P1=P1+P3, P1=P1*P4, P1=P1/P5)

It is the same as saying:

(P1=(P1+P2+P3)*P4/P5).

The different assignments which are made in the same block will be separated by commas ",".

13.

13.2 Display instructions

(ERROR integer, "error text")

This instruction stops the execution of the program and displays the indicated error, it being possible to select this error in the following ways:

(ERROR integer)

This will display the error number indicated and the text associated to this number according to the CNC error code (should there be one).

(ERROR integer, "error text")

This will display the number and the error text indicated, it being necessary to write the text between quote marks "".

(ERROR "error text").

This will display the error text only.

The error number may be defined by means of a numerical constant or an arithmetic parameter. When using a local parameter, its numeric format must be used (P0 thru P25 instead of A thru Z).

Programming examples:

(ERROR 5)

(ERROR P100)

(ERROR "User error")

(ERROR 3, "User error")

(ERROR P120, "User error")

(MSG "message")

This instruction will display the message indicated between quote marks.

The CNC screen is provided with an area for displaying DNC or user program messages, and always displays the last message received irrespective of where it has come from.

Example: (MSG "Check tool")

(DGWZ expression 1, expression 2, expression 3, expression 4, expression 5, expression 6)

The DGWZ instruction (Define Graphic Work Zone) defines the graphics area.

Each expression forming the instruction syntax correspond to one of the limits and they must be defined in millimeters or inches.

expression 1	X minimum
expression 2	X maximum
expression 3	Y minimum
expression 4	Y maximum
expression 5	Z minimum
expression 6	Z maximum

13.

13.3 Enable-disable instructions

(ESBLK and DSBLK)

After executing the mnemonic ESBLK, the CNC executes all the blocks that come after as if it were dealing with a single block.

This single block treatment is kept active until it is cancelled by executing the mnemonic DSBLK.

In this way, should the program be executed in the SINGLE BLOCK operating mode, the group of blocks which are found between the mnemonics ESBLK and DSBLK will be executed in a continuous cycle, i.e., execution will not be stopped at the end of a block but will continue by executing the following one.

```
G01 X10 Y10 F8000 T1 D1
(ESBLK)                                ; Start of single block
G02 X20 Y20 I20 J-10
G01 X40 Y20
G01 X40 Y40 F10000
G01 X20 Y40 F8000
(DSBLK)                                ; Cancellation of single block
G01 X10 Y10
M30
```

(ESTOP and DSTOP)

After executing the mnemonic DSTOP, the CNC enables the Stop key, as well as the Stop signal from the PLC.

It will remain disabled until it is enabled once again by means of the mnemonic ESTOP.

(EFHOLD and DFHOLD)

After executing the mnemonic DFHOLD, the CNC enables the Feed-Hold input from the PLC.

It will remain disabled until it is enabled once again by means of the mnemonic EFHOLD.

13.

13.4 Flow control instructions

The GOTO and RPT instructions cannot be used in programs that are executed from a PC connected through the serial lines.

(GOTO N(expression))

The mnemonic GOTO causes a jump within the same program, to the block defined by the label N(expression). The execution of the program will continue after the jump, from the indicated block.

The jump label can be addressed by means of a number or by any expression which results in a number.

```

G00 X0 Y0 Z0 T2 D4
X10
(GOTO N22) ; Jump instruction
X15 Y20 ; It is not executed
Y22 Z50 ; It is not executed
N22 G01 X30 Y40 Z40 F1000 ; Continues execution in this block
G02 X20 Y40 I-5 J-5
...
    
```

(RPT N(expression), N(expression), P(expression))

The mnemonic RPT executes the part of the program between the blocks defined by means of the labels N(expression). The blocks to be executed may be in the execution program or in a RAM memory program.

The label P(expression) indicates the number of the program containing the blocks to be executed. If not defined, the CNC interprets that the portion to be repeated is located in the same program.

All the labels can be indicated by means of a number or by any expression which results in a number. The part of the program selected by means of the two labels must belong to the same program, by first defining the initial block and then the final block.

The execution of the program will continue in the block following the one in which the mnemonic RPT was programmed, once the selected part of the program has been executed.

```

N10 G00 X10
Z20
G01 X5
G00 Z0
N20 X0
N30 (RPT N10, N20) N3
N40 G01 X20
M30
    
```

When reaching block N30, the program will execute section N10-N20 three times. Once this has been completed, the program will continue execution in block N40.



Since the RPT instruction does not interrupt block preparation or tool compensation, it may be used when using the EXEC instruction and while needing to maintain tool compensation active.

13.

PROGRAM CONTROL INSTRUCTIONS
Flow control instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)

13.

(IF condition <action1> ELSE <action2>)

This instruction analyzes the given condition that must be a relational expression. If the condition is true (result equal to 1), <action1> will be executed, otherwise (result equal to 0) <action2> will be executed.

Example:

```
(IF (P8 EQ 12.8) CALL 3 ELSE PCALL 5, A2, B5, D8)
```

If P8 = 12.8 executes the mnemonic (CALL3)

If P8 <> 12.8 executes the mnemonic (PCALL 5, A2, B5, D8)

The instruction can lack the ELSE part, i.e., it will be enough to program IF condition <action1>.

Example:

```
(IF (P8 EQ 12.8) CALL 3)
```

Both <action1> and <action2> can be expressions or instructions, except for mnemonics IF and SUB.

Due to the fact that in a high level block local parameters can be named by means of letters, expressions of this type can be obtained:

```
(IF (E EQ 10) M10)
```

If the condition of parameter P5 (E) having a value of 10 is met, the miscellaneous function M10 will not be executed, since a high level block cannot have ISO code commands. In this case M10 represents the assignment of value 10 to parameter P12, i.e., one can program either:

```
(IF (E EQ 10) M10) or (IF (P5 EQ 10) P12=10)
```


13.5 Subroutine instructions

A subroutine is a part of a program which, being properly identified, can be called from any position of a program to be executed.

A subroutine can be kept in the memory of the CNC as an independent part of a program and be called one or several times, from different positions of a program or different programs.

Only subroutines stored in the CNC's RAM memory can be executed. Therefore, to execute a subroutine stored in a PC connected through one of the serial lines, copy it first into the CNC's RAM memory.

If the subroutine is too large to be copied into RAM, it must be converted into a program and then the EXEC instruction must be used.

(SUB integer)

The SUB instruction defines as subroutine the set of program blocks programmed next until reaching the RET subroutine. The subroutine is identified with an integer which also defines the type of subroutine; either general or OEM.

Range of general subroutines	SUB 0000 - SUB 9999
Range of OEM (manufacturer's) subroutines	SUB 10000 - SUB 20000

The OEM subroutines are treated like the general ones, but with the following restrictions:

- They can only be defined in OEM programs, having the [O] attribute. Otherwise, the CNC will display the corresponding error.
Error 63 : Program subroutine number 1 thru 9999.
- To execute an OEM subroutine using CALL, PCALL or MCALL, it must be inside an OEM program. Otherwise, the CNC will display the corresponding error.
Error 1255 : Subroutine restricted to an OEM program.

There can not be two subroutines with the same identification number in the CNC memory, even when they belong to different programs.

(RET)

The mnemonic RET indicates that the subroutine which was defined by the mnemonic SUB, finishes in this block.

```
( SUB 12) ; Definition of subroutine 12
G91 G01 XP0 F5000
YP1
X-P0
Y-P1
(RET) ; End of subroutine
```

13.

PROGRAM CONTROL INSTRUCTIONS
Subroutine instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)


(CALL (expression))

The mnemonic CALL makes a call to the subroutine indicated by means of a number or by means of any expression that results in a number.


As a subroutine may be called from a main program, or a subroutine, from this subroutine to a second one, from the second to a third, etc..., the CNC limits these calls to a maximum of 15 nesting levels, it being possible to repeat each of the levels 9999 times.

13.

PROGRAM CONTROL INSTRUCTIONS
Subroutine instructions

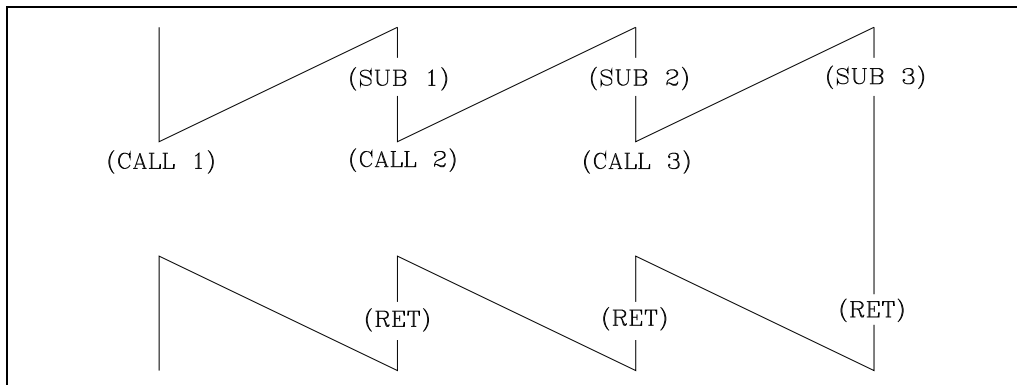

Programming example.

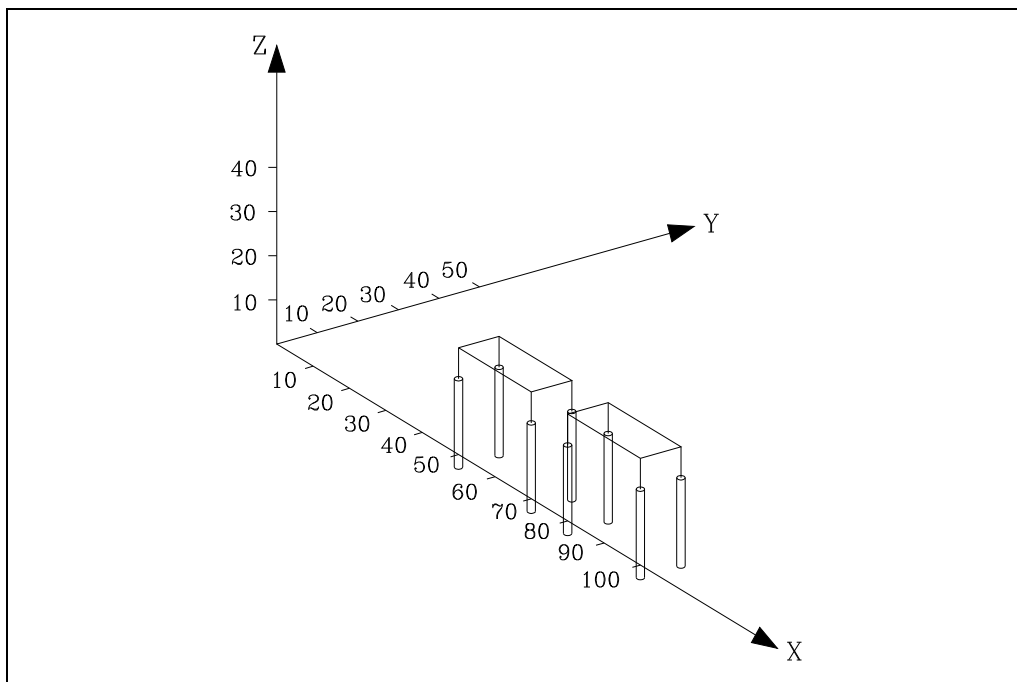

```
G90 G00 X30 Y20 Z10
(CALL 10)
G90 G00 X60 Y20 Z10
(CALL 10)
M30

( SUB 10)
G91 G01 X20 F5000
(CALL 11) ; Drilling and threading
G91 G01 Y10
(CALL 11) ; Drilling and threading
G91 G01 X-20
(CALL 11) ; Drilling and threading
G91 G01 Y-10
(CALL 11) ; Drilling and threading
(RET)
```



CNC 8035

·M· MODEL
(SOFT V15.3x)

```
( SUB 11)
G81 G98 G91 Z-8 I-22 F1000 S5000 T1 D1
; Drilling canned cycle
G84 Z-8 I-22 K15 F500 S2000 T2 D2
; Threading canned cycle

G80
(RET)
```

(PCALL (expression), (assignment instruction), (assignment instruction),...)

The mnemonic PCALL calls the subroutine indicated by means of a number or any expression that results in a number. In addition, it allows up to a maximum of 26 local parameters of this subroutine to be initialized.


These local parameters are initialized by means of assignment instructions.

Example: (PCALL 52, A3, B5, C4, P10=20)

In this case, in addition to generating a new subroutine nesting level, a new local parameter nesting level will be generated, there being a maximum of 6 levels of local parameter nesting, within the 15 levels of subroutine nesting.

Both the main program and each subroutine that is found on a parameter nesting level, will have 26 local parameters (P0-P25).

Programming example.

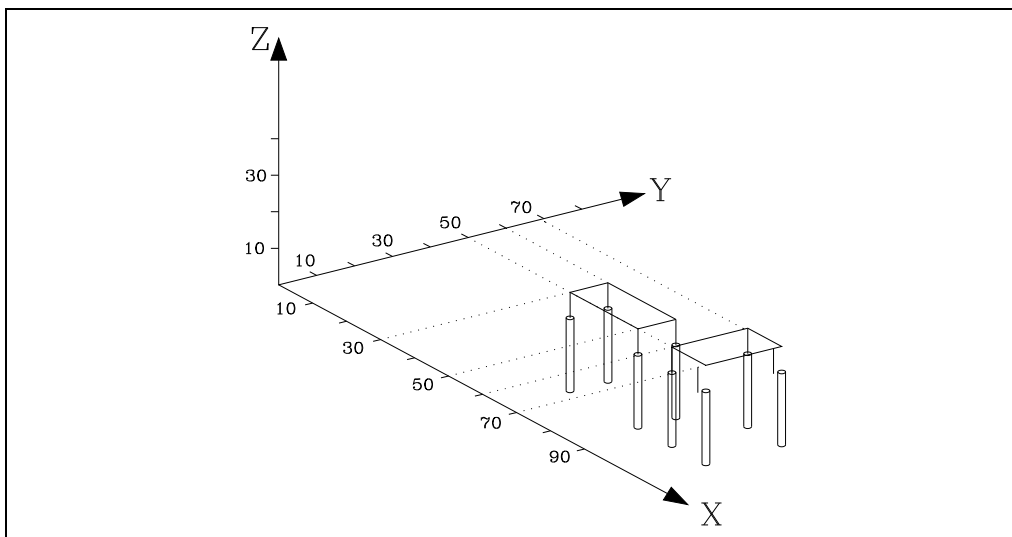

```
G90 G00 X30 Y50 Z0
(PCALL 10, P0=20, P1=10) ; Also (PCALL 10, A20, B10)
G90 G00 X60 Y50 Z0
(PCALL 10, P0=10, P1=20) ; Also (PCALL 10, A10, B20)
M30
( SUB 10)
G91 G01 XP0 F5000
(CALL 11)
G91 G01 YP1
(CALL 11)
G91 G01 X-P0
(CALL 11)
G91 G01 Y-P1
(CALL 11)
(RET)
( SUB 11)
```

13.

PROGRAM CONTROL INSTRUCTIONS
Subroutine instructions



CNC 8035

.M- MODEL
(SOFT V15.3x)

```
G81 G98 G91 Z-8 I-22 F1000 S5000 T1 D1
; Drilling canned cycle
G84 Z-8 I-22 K15 F500 S2000 T2 D2
; Threading canned cycle
G80
(RET)
```

13.

PROGRAM CONTROL INSTRUCTIONS
Subroutine instructions

(MCALL (expression), (assignment instruction), (assignment instruction),...)

By means of the mnemonic MCALL, any user-defined subroutine (SUB integer) acquires the category of canned cycle.

The execution of this mnemonic is the same as the mnemonic PCALL, but the call is modal, i.e., if another block with axis movement is programmed at the end of this block, after this movement, the subroutine indicated will be executed and with the same call parameters.

If, when a modal subroutine is selected, a movement block with a number of repetitions is executed, for example X10 N3, the CNC will execute the movement only once (X10) and after the modal subroutine, as many times as the number of repetitions indicates.

Should block repetitions be chosen, the first execution of the modal subroutine will be made with updated call parameters, but not for the remaining times, which will be executed with the values which these parameters have at that time.

If, when a subroutine is selected as modal, a block containing the MCALL mnemonic is executed, the present subroutine will lose its modal quality and the new subroutine selected will be changed to modal.

(MDOFF)

The MDOFF instruction indicates that the mode assumed by a subroutine with the MCALL instruction or a part-program with MEXEC ends in that block.


The use of modal subroutines simplifies programming.



CNC 8035

·M· MODEL
(SOFT V15.3x)

Programming example.

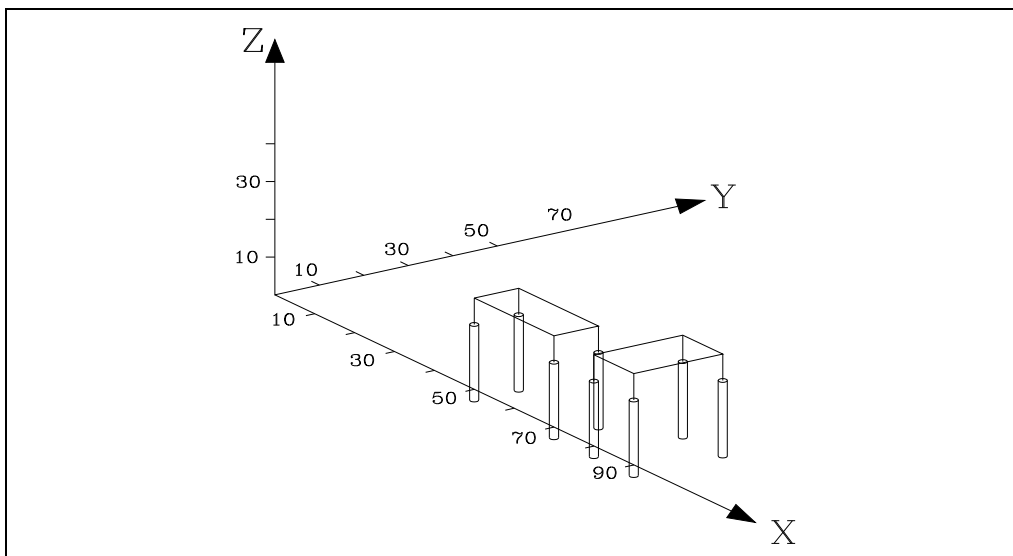

```

G90 G00 X30 Y50 Z0
(PCALL 10, P0=20, P1=10)
G90 G00 X60 Y50 Z0
(PCALL 10, P0=10, P1=20)
M30

( SUB 10)
G91 G01 XP0 F5000
(MCALL 11)
G91 G01 YP1
G91 G01 X-P0
G91 G01 Y-P1
(MDOFF)
(RET)
( SUB 11)
G81 G98 G91 Z-8 I-22 F1000 S5000 T1 D1
G84 Z-8 I-22 K15 F500 S2000 T2 D2
G80
(RET)
    
```

13.

PROGRAM CONTROL INSTRUCTIONS
Subroutine instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)

13.6 Interruption-subroutine instructions

Whenever one of the general interruption logic input is activated, "INT1" (M5024), "INT2" (M5025), "INT3" (M5026) or "INT4" (M5027), the CNC temporarily interrupts the execution of the program in progress and starts executing the interruption subroutine whose number is indicated by the corresponding general parameter.

With INT1 (M5024) the one indicated by machine parameter INT1SUB (P35)

With INT2 (M5025) the one indicated by machine parameter INT2SUB (P36)

With INT3 (M5026) the one indicated by machine parameter INT3SUB (P37)

With INT4 (M5027) the one indicated by machine parameter INT4SUB (P38)

The interruption subroutines are defined like any other subroutine by using the instructions: "(SUB integer)" and "(RET)".

These interruption subroutines do not change the nesting level of local parameters, thus only global parameters must be used in them.

Within an interruption subroutine, it is possible to use the "(REPOS X, Y, Z, ...)" instruction described next.

Once the execution of the subroutine is over, the CNC resumes the execution of the program which was interrupted.

(REPOS X, Y, Z, ...)

The REPOS instruction must always be used inside an interruption subroutine and facilitates the repositioning of the machine axes to the point of interruption.

When executing this instruction, the CNC moves the axes to the point where the program was interrupted.

Inside the REPOS instruction, indicate the order the axes must move to the point where the program was interrupted.

- The axes move one by one.
- It is not necessary to define all the axes, only those to be repositioned.
- The axes that make up the main plane of the machine move together. Both axes need not be defined because the CNC moves the first one. The movement is not repeated when defining the second one, it is ignored.

Example:

The main plane is formed by the XY axes, the Z axis is the longitudinal axis. To reposition first the X and Y axes and finally the Z axis.

This repositioning move may be defined in any of the following ways:

```
(REPOS X, Y, Z)(REPOS X, Z)(REPOS Y, Z)
```

If the REPOS instruction is detected while executing a subroutine not activated by an interruption input, the CNC will issue the corresponding error message.

13.

13.7 Program instructions

With this CNC, from a program in execution, it is possible to:

- Execute another program. Instruction (EXEC P.....)
- Execute another program in modal mode. Instruction (MEXEC P.....)
- Generate a new program. Instruction (OPEN P.....)
- Add blocks to an existing program. Instruction (WRITE P.....)

(EXEC P(expression), (directory))

The EXEC P instruction executes the part-program of the indicated directory

The part-program may be defined by a number or any expression resulting in a number.

By default, the CNC interprets that the part-program is in the CNC's RAM memory. If it is in another device, it must be indicated in (directory).

DNC in a PC connected through the serial line.

(MEXEC P(expression), (directory))

The MEXEC instruction executes the part-program of the indicated directory and it also becomes modal; i.e. if after this block, another one is programmed with axis movement; after this movement, it will execute the indicated program again.

The part-program may be defined with a number or with an expression whose result is a number.

By default, the CNC interprets that the part-program is in the CNC's RAM memory. If it is in another device, it must be so indicated in (directory):

DNC in a PC connected through the serial line.

If while the modal part-program is selected, a motion block is executed with a number of repetitions (for example X10 N3), the CNC ignores the number of repetitions and executes the movement and the modal part-program only once.

If while a part-program is selected as modal, a block containing the MEXEC instruction is executed from the main program, the current part-program stops being modal and the part-program called upon with MEXEC will then become modal.

If within the modal part-program, an attempt is made to execute a block using the MEXEC instruction, it will issue the relevant error message.

1064: The program cannot be executed.

(MDOFF)

The MDOFF instruction indicates that the mode assumed by a subroutine with the MCALL instruction or a part-program with MEXEC ends in that block.

13.

PROGRAM CONTROL INSTRUCTIONS
Program instructions

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

13.

(OPEN P(expression), (destination directory), A/D, "program comment")

The OPEN instruction begins editing a part-program. The part-program number may be indicated by a number or any expression resulting in a number.

By default, the new part-program edited will be stored in the CNC's RAM memory. To store it another device, it must be indicated in (destination directory).

DNC in a PC connected through the serial line.

Parameter A/D is used when the program to be edited already exists.

- A The CNC appends the new blocks after the ones already existing.
- D The CNC deletes the existing program and starts editing a new one.

A program comment may also be associated with it; this comment will later be displayed next to it in the program directory.

The OPEN instruction allows generating a program from a program already in execution. That generated program will depend on the values assumed by the program being executed.

To edit blocks, the WRITE instruction must be used as described next.

Notes:

If the program to be edited already exists and the A/D parameters are not defined, the CNC will display an error message when executing the block.

The program opened with the OPEN instruction is closed when executing an M30, or another OPEN instruction and after an Emergency or Reset.

From a PC, only programs located in RAM memory may be opened.

(WRITE <block text>)

The mnemonic WRITE adds, after the last block of the program which began to be edited by means of the mnemonic OPEN P, the information contained in <block text> as a new program block.

When it is an ISO coded parametric block, all the parameters (global and local) are replaced by the numeric value they have at the time.

(WRITE G1 XP100 YP101 F100) => G1 X10 Y20 F100

When it is a parametric block edited in high level, use the "?" character to indicate that the parameter is supposed to be replaced by the numeric value it has at the time.


(WRITE (SUB P102))	=>	(SUB P102)
(WRITE (SUB ?P102))	=>	(SUB 55)
(WRITE (ORGX54=P103))	=>	(ORGX54=P103)
(WRITE (ORGX54=?P103))	=>	(ORGX54=222)
(WRITE (PCALL P104))	=>	(PCALL P104)
(WRITE (PCALL ?P104))	=>	(PCALL 25)

If the mnemonic WRITE is programmed without having programmed the mnemonic OPEN previously, the CNC will display the corresponding error, except when editing a user customized program, in which case a new block is added to the program being edited.



CNC 8035

Example of the creation of a program which contains several points of a cardioid:

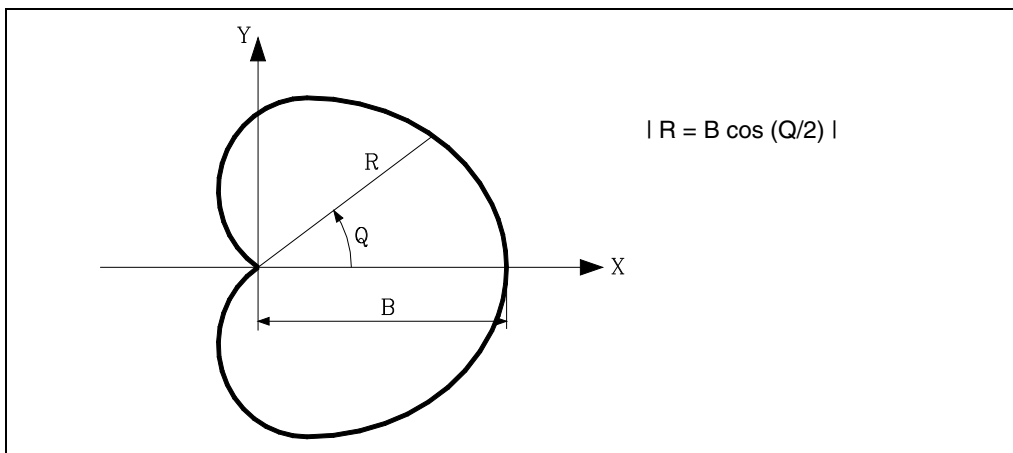

Subroutine number 2 is used, its parameters having the following meaning:

- A or P0 Value of angle Q.
- B or P1 Value of B.
- C or P2 Angular increment for calculation.
- D or P3 The maximum feedrate of the axes.

A way to use this example could be:

```
G00 X0 Y0
G93
(PCALL 2, A0, B30, C5, D500)
M30
```

Program generating subroutine.

```
( SUB 2 )
( OPEN P12345 ) ; Starts editing of program P12345
( WRITE FP3 ) ; Selects machining feedrate
N100 ( P10=P1 * (ABS(COS(P0/2))) ) ; Calculates R
( WRITE G01 G05 RP10 QP0 ) ; Movement block
( P0=P0+P2 ) ; New angle
( IF ( P0 LT 365 ) GOTO N100 ) ; If angle smaller than 365°, calculates new point
( WRITE M30 ) ; End of program block
( RET ) ; End of subroutine
```

13.

PROGRAM CONTROL INSTRUCTIONS
Program instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)

13.8 Screen customizing instructions

Customizing instructions may be used only when customizing programs made by the user.

These customizing programs must be stored in the CNC'S RAM memory and they may utilize the "Programming Instructions" and they will be executed in the special channel designed for this use; the program selected in each case will be indicated in the following general machine parameters.

In "USERDPLY" the program to be executed in the Execution Mode will be indicated.

In "USEREDIT" the program to be executed in the Editing Mode will be indicated.

In "USERMAN" the program to be executed in the Manual (JOG) Mode will be indicated.

In "USERDIAG" the program to be executed in the Diagnosis Mode will be indicated.

The customizing programs may have up to five nesting levels besides their current one. Also, the customizing instructions do not allow local parameters, nevertheless all global parameters may be used to define them.

(PAGE (expression))

The mnemonic PAGE displays the page number indicated by means of a number or by means of any expression resulting in a number.

User-defined pages will be from page 0 to page 255 and will be defined from the CNC keyboard in the Graphic Editor mode and as indicated in the Operating Manual.

System pages will be defined by a number greater than 1000. See the corresponding appendix.

(SYMBOL (expression 1), (expression 2), (expression 3))

The mnemonic SYMBOL displays the symbol whose number is indicated by means of the value of expression 1 once this has been evaluated.

Its position on screen is also defined by expression 2 (column) and by expression 3 (row).

Expression 1, expression 2 and expression 3 may contain a number or any expression resulting in a number.

The CNC allows displaying any user-defined symbol (0-255) defined at the CNC keyboard in the Graphic Editor mode such as is indicated in the Operating Manual.

In order to position it within the display area its pixels must be defined, 0-639 for columns (expression 2) and 0-335 for rows (expression 3).

13.

(IB (expression) = INPUT "text", format)

The CNC has 26 data entry variables (IB0-1B25)

The IB mnemonic displays the text indicated in the data input window and stores the data input by the user in the entry variable indicated by means of a number or by means of any expression resulting in a number.

The wait for data entry will only occur when programming the format of the requested data. This format may have a sign, integer part and decimal part.

If it bears the "-" sign, it will allow positive and negative values, and if it does not have a sign, it will only allow positive values.

The integer part indicates the maximum number of digits (0-6) desired to the left of the decimal point.

The decimal part indicates the maximum number of digits (0-5) desired to the right of the decimal point.

If the numerical format is not programmed; for example: (IB1 =INPUT "text"), the mnemonic will only display the indicated text without waiting for the data to be entered.

(ODW (expression 1), (expression 2), (expression 3))

The mnemonic ODW defines and draws a white window on the screen with fixed dimensions (1 row and 14 columns).

Each mnemonic has an associated number which is indicated by the value of expression 1 once this has been evaluated.

Likewise, its position on screen is defined by expression 2 (row) and by expression 3 (column).

Expression 1, expression 2 and expression 3 may contain a number or any expression resulting in a number.

The CNC allows 26 windows (0-25) to be defined and their positioning within the display area, providing 21 rows (0-20) and 80 columns (0-79).

(DW(expression 1) = (expression 2), DW (expression 3) = (expression 4), ...)

The instruction DW displays in the window indicated by the value for expression 1, expression 3, .. once they have been evaluated, the numerical data indicated by expression 2, expression 4, ...

Expression 1, expression 2, expression 3, may contain a number or any expression which may result in a number.

The following example shows a dynamic variable display:

```
(ODW 1, 6, 33)
    ; Defines data window 1
(ODW 2, 14, 33)
    ; Defines data window 2
N10 (DW1=DATE, DW2=TIME)
    ; Displays the date in window 1 and the time in 2
(GOTO N10)
```

13.

The CNC allows displaying the data in decimal, hexadecimal and binary format; the following instructions are available:

(DW1 = 100)

Decimal format. Value "100" displayed in window 1.

(DWH2 = 100)

Hexadecimal format. Value "64" displayed in window 2.

(DWB3 = 100)

Binary format. Value "01100100" displayed in window 3.

When using the binary format, the display is limited to 8 digits in such a way that a value of "11111111" will be displayed for values greater than 255 and the value of "10000000" for values more negative than -127.

Besides, the CNC allows the number stored in one of the 26 data input variables (IB0-IB25) to be displayed in the requested window.

The following example shows a request and later displays the axis feedrate:

```
(ODW 3, 4, 60)
; Defines data window 3.
(IB1=INPUT "Axis feed: ", 5.4)
; Axis feedrate request.
(DW3=IB1)
; Displays feedrate in window 3.
```

(SK (expression 1) = "text1" (expression 2) = "text 2",)

The instruction SK defines and displays the new softkey menu indicated.

Each of the expressions will indicate the softkey number which it is required to modify (1-7, starting from the left) and the texts which it is required to write in them.

Expression 1, expression 2, expression 3, may contain a number or any expression which may result in a number.

Each text will allow a maximum of 20 characters that will be shown in two lines of 10 characters each. If the text selected has less than 10 characters, the CNC will center it on the top line, but if it has more than 10 characters the programmer will center it.

Examples:

(SK 1="HELP", SK 2="MAXIMUN POINT")

HELP	MAXIMUN POINT
------	---------------

(SK 1="FEED", SK 2=" __MAXIMUN__ _POINT")

FEED	MAXIMUN POINT
------	---------------



If while a standard CNC softkey menu is active, one or more softkeys are selected via high level language instruction: "SK", the CNC will clear all existing softkeys and it will only show the selected ones.

If while a user softkey menu is active, one or more softkeys are selected via high level language instruction "SK", the CNC will only replace the selected softkeys leaving the others intact.

13.

PROGRAM CONTROL INSTRUCTIONS
Screen customizing instructions



CNC 8035

-M- MODEL
(SOFT V15.3x)

(WKEY)

The mnemonic WKEY stops execution of the program until the key is pressed.

The pressed key will be recorded in the KEY variable.

```

...
( WKEY ) ; Wait for key
(IF KEY EQ $FC00 GOTO N1000) ; If key F1 has been pressed, continue in N1000
...

```

(WBUF "text", (expression))

The WBUF instruction can only be used when editing a program in the user channel.

This instruction may be programmed in two ways:

- (WBUF "text", (expression))

It adds the text and value of the expression, once it has been evaluated, to the block that is being edited and within the data entry window.

(Expression) may contain a number or any expression resulting in a number.

It will be optional to program the expression, but it will be required to define the text. If no text is required, "" must be programmed.

Examples for P100=10:

```

(WBUF "X", P100) => X10
(WBUF "X P100") => X P100

```

- (WBUF)

Enters into memory, adding to the program being edited and after the cursor position, the block being edited by means of (WBUF "text", (expression)). It also clears the editing buffer in order to edit a new block.

This allows the user to edit a complete program without having to quit the user editing mode after each block and press ENTER to "enter" it into memory.

```

(WBUF "(PCALL 25, ")
; Adds "(PCALL 25, " to the block being edited.
(IB1=INPUT "Parameter A:",-5.4)
; Request of Parameter A.
(WBUF "A=", IB1)
; Adds "A=(value entered)" to the block being edited.
(IB2=INPUT "Parameter B: ", -5.4)
; Request of Parameter B.
(WBUF ", B=", IB2)
; Adds "B=(value entered)" to the block being edited.
(WBUF ")")
; Adds ")" to the block being edited.
( WBUF )
; Enters the edited block into memory.
...

```

After executing this program the block being edited contains:

```
(PCALL 25, A=23.5, B=-2.25)
```

(SYSTEM)

The mnemonic SYSTEM stops execution of the user customized program and returns to the corresponding standard menu of the CNC.

13.

PROGRAM CONTROL INSTRUCTIONS
Screen customizing instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)

Customizing program example:

The following customizing program must be selected as user program associated to the Editing Mode.

After selecting the Editing Mode and pressing the USER softkey, this program starts executing and it allows assisted editing of 2 user cycles. This editing process is carried out a cycle at a time and as often as desired.

13.

PROGRAM CONTROL INSTRUCTIONS
Screen customizing instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)

Displays the initial editing page (screen)

N0 (PAGE 10)

Sets the softkeys to access the various modes and requests a choice

(SK 1="CYCLE 1",SK 2="CYCLE 2",SK 7="EXIT")

N5 (WKEY) ; Request a key

(IF KEY EQ \$FC00 GOTO N10) ; Cycle 1

(IF KEY EQ \$FC01 GOTO N20) ; Cycle 2

(IF KEY EQ \$FC06 SYSTEM ELSE GOTO N5) ; Quit or request a key

CYCLE 1

; Displays page 11 and defines 2 data entry windows

N10 (PAGE 11)

(ODW 1,10,60)

(ODW 2,15,60)

;Editing

(WBUF "(PCALL 1, ") ; Adds "(PCALL 1," to the block being edited.

(IB 1=INPUT "X:",-6.5) ; Requests the value of X.

(DW 1=IB1) ; Data window 1 shows the entered value.

(WBUF "X",IB1) ; Adds X (entered value) to the block being edited.

(WBUF ",") ; Adds "," to the block being edited.

(IB 2=INPUT "Y:",-6.5) ; Requests the value of Y.

(DW 2=IB2) ; Data window 2 shows the entered value.

(WBUF "Y",IB2) ; Adds Y (entered value) to the block being edited.

(WBUF ")") ; Adds ")" to the block being edited.

(WBUF) ; Enters the edited block into memory.

; For example : (PCALL 1, X2, Y3)

(GOTO N0)

CYCLE 2

; Displays page 12 and defines 3 data entry windows

N20 (PAGE 12)

(ODW 1,10,60)

(ODW 2,13,60)

(ODW 3,16,60)

;Editing

(WBUF "(PCALL 2, ") ; Adds "(PCALL 2, " to the block being edited.

(IB 1=INPUT "A:",-6.5) ; Requests the value of A.

13.

PROGRAM CONTROL INSTRUCTIONS
Screen customizing instructions

(DW 1=IB1)	; Data window 1 shows the entered value.
(WBUF "A",IB1)	; Adds A (entered value) to the block being edited.
(WBUF ",")	; Adds "," to the block being edited.
(IB 2=INPUT "B:",-6.5)	; Requests the value of B.
(DW 2=IB2)	; Data window 2 shows the entered value.
(WBUF "B",IB2)	; Adds B (entered value) to the block being edited.
(WBUF ",")	; Adds "," to the block being edited.
(IB 3=INPUT "C:",-6.5)	; Requests the value of C.
(DW 3=IB3)	; Data window 3 shows the entered value.
(WBUF "C",IB3)	; Adds C (entered value) to the block being edited.
(WBUF ")")	; Adds ")") to the block being edited.
(WBUF)	; Enters the edited block into memory. For example: (PCALL 2, A3, B1, C3).
(GOTO N0)	



CNC 8035


·M· MODEL
(SOFT V15.3x)

ANGULAR TRANSFORMATION OF AN INCLINE AXIS

14

With the angular transformation of an incline axis, it is possible to make movements along an axis that is not perpendicular to another. The movements are programmed in the Cartesian system and to make the movements, they are transformed into movements on the real axes.

On certain machines, the axes are configured in a Cartesian way, they are not perpendicular to each other. A typical case is the X axis of a lathe that for sturdiness reasons is not perpendicular to the Z axis.

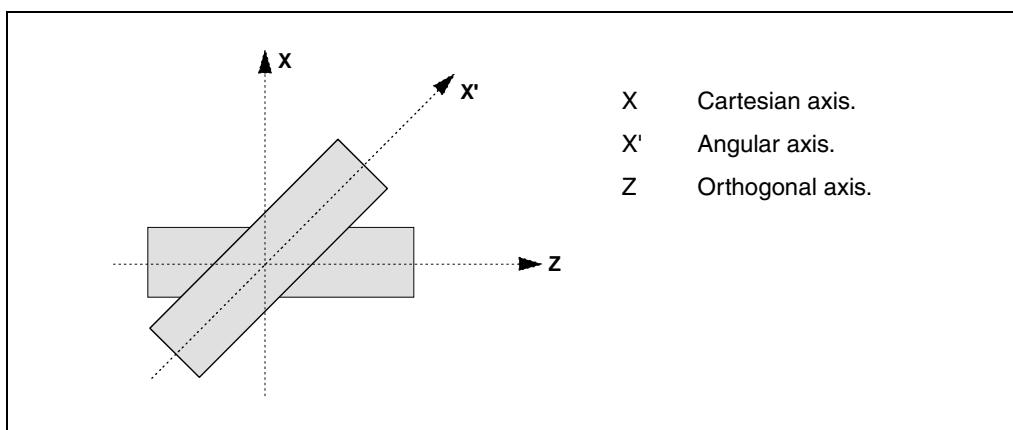

Programming in the Cartesian system (Z-X) requires activating an angular transformation of an inclined plane that converts the movements of the real (non-perpendicular) axes (Z-X'). This way, a movement programmed on the X axis is transformed into movements on the Z-X' axes; i.e. it then moves along the Z axis and the angular X' axis.

Turning angular transformation on and off.

The CNC assumes no transformation on power-up; the angular transformations are activated via part-program using the instruction G46.

The angular transformations are turned off via part-program using function G46. Optionally, a transformation may be "frozen" (suspended) to move angular axis by programming in Cartesian coordinates.

Influence of the reset, turning the CNC off and of the M30.

The angular transformation of an incline axis stays active after a RESET, M30 and even after turning the CNC off and back on.



CNC 8035

·M· MODEL
(SOFT V15.3x)

14.

ANGULAR TRANSFORMATION OF AN INCLINE AXIS

Considerations for the angular transformation of an incline axis.

The axes involved in an angular transformation must be linear. Both axes may have Gantry axes associated with them.

If the angular transformation is active, the coordinates displayed will be those of the Cartesian system. Otherwise, it will display the coordinates of the real axes.

The following operations are possible while the transformation is active:

- Zero offsets.
- Coordinate preset.
- Movements in continuous / incremental jog and handwheels.

The following operations are not possible while the transformation is active:

- Movement until making contact (against a hard stop).
- Coordinate rotation.
- Surface feedrate in milling.

Home search

Function G46 is canceled when homing an axis that is involved in the angular transformation (machine parameters ANGAXNA and ORTAXNA). When homing the axes that are not involved in the angular axis transformation, function G46 stays active.

While searching home, only the real axes move.

Jogging and handwheel movements.

Either the real or the Cartesian axes may be jogged depending on how they've been set by the manufacturer. It is selected via PLC (MACHMOVE) and it may be available, for example, from a user key.

14.1 Turning angular transformation on and off

Turn angular transformation on

When the transformation is on, the movements are programmed in the Cartesian system and to make the movements, the CNC transforms them into movements on the real axes. The coordinates displayed on the screen will be those of the Cartesian system.

The angular transformation is turned on using function G46 whose programming format is:

```
G46 S1
```

This instruction turns a "frozen" (suspended) transformation on again. See "[14.2 Freezing the angular transformation](#)" on page 296.

Turning the angular transformation off

If the transformation is off, the movements are programmed and executed in the system of the real axes. The coordinates displayed on the screen will be those of the real axes.

The angular transformation is turned off using function G46 whose programming format is:

```
G46 S0
```

```
G46
```

The angular transformation of an incline axis stays active after a RESET, M30 and even after turning the CNC off and back on.

14.

ANGULAR TRANSFORMATION OF AN INCLINE AXIS

Turning angular transformation on and off

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

14.2 Freezing the angular transformation

Freezing the angular transformation is a special way to make movements along the angular axis, but programming it in the Cartesian system. The angular transformation cannot be "frozen" (suspended) while jogging.

The angular transformation is "frozen" (suspended) using function G46 whose programming format is:

```
G46 S2
```

Programming movements after "freezing" the angular transformation.

If an angular transformation is "frozen" (suspended), only the coordinate of the angular axis must be programmed in the motion block. If the coordinate of the orthogonal axis is programmed, the movement is carried out according to the normal angular transformation.

Canceling the freezing of a transformation.

The "freezing" of an angular transformation is canceled after a reset or an M30. Turning the transformation on (G46 S1) also cancels the "freezing".

14.

ANGULAR TRANSFORMATION OF AN INCLINE AXIS
Freezing the angular transformation



CNC 8035

·M· MODEL
(SOFT V15.3x)

APPENDIX

A.	ISO code programming	299
B.	Program control instructions	301
C.	Summary of internal CNC variables.....	303
D.	Key codes.....	307
E.	Maintenance	309



CNC 8035

·M· MODEL
(SOFT V15.3x)

ISO CODE PROGRAMMING

Function	M	D	V	Meaning	Section
G00	*	?	*	Rapid traverse	6.1
G01	*	?	*	Linear interpolation	6.2
G02	*		*	Clockwise circular (helical) interpolation	6.3 / 6.7
G03	*		*	Counterclockwise circular (helical) interpolation	6.3 / 6.7
G04				Dwell/interruption of block preparation	7.1 / 7.2
G05	*	?	*	Round corner	7.3.2
G06			*	Circle center in absolute coordinates	6.4
G07	*	?		Square corner	7.3.1
G08			*	Arc tangent to previous path.	6.5
G09			*	Arc defined by three points	6.6
G10	*	*		Mirror image cancellation	7.5
G11	*		*	Mirror image on X axis	7.5
G12	*		*	Mirror image on Y axis	7.5
G13	*		*	Mirror image on Z axis	7.5
G14	*		*	Mirror image in the programmed directions	7.5
G15	*		*	Longitudinal axis selection	8.2
G16	*		*	Main plane selection by two addresses and longitudinal axis	3.2
G17	*	?	*	Main plane X-Y and longitudinal Z	3.2
G18	*	?	*	Main plane Z-X and longitudinal Y	3.2
G19	*		*	Main plane Y-Z and longitudinal X	3.2
G20				Definition of lower work zone limits	3.7.1
G21				Definition of upper work zone limits.	3.7.1
G22			*	Enable/disable work zones.	3.7.2
G32	*		*	Feedrate "F" as an inverted function of time.	6.15
G33	*		*	Electronic threading	6.12
G34				Variable-pitch threading	6.13
G36			*	Controlled corner rounding	6.10
G37			*	Tangential entry	6.8
G38			*	Tangential exit	6.9
G39			*	Chamfer	6.11
G40	*	*		Cancellation of tool radius compensation	8.1
G41	*		*	Left-hand tool radius compensation	8.1
G41 N	*		*	Collision detection	8.3
G42	*		*	Right-hand tool radius compensation	8.1
G42 N	*		*	Collision detection	8.3
G43	*	?	*	Tool length compensation	8.2
G44	*	?		Cancellation of tool length compensation	8.2
G50	*		*	Controlled corner rounding	7.3.3
G51	*		*	Look-Ahead	7.4
G52			*	Movement until making contact	6.14
G53			*	Programming with respect to machine zero	4.3
G54	*		*	Absolute zero offset 1	4.4.2
G55	*		*	Absolute zero offset 2	4.4.2
G56	*		*	Absolute zero offset 3	4.4.2
G57	*		*	Absolute zero offset 4	4.4.2
G58	*		*	Additive zero offset 1	4.4.2
G59	*		*	Additive zero offset 2	4.4.2
G60			*	Multiple machining in a straight line	10.1
G61			*	Multiple machining in a rectangular pattern	10.2
G62			*	Grid pattern canned cycle	10.3
G63			*	Multiple machining in a circular pattern	10.4
G64			*	Multiple machining in an arc	10.5
G65			*	Machining programmed with an arc-chord	10.6
G69	*		*	Drilling canned cycle with variable peck	9.6
G70	*	?	*	Programming in inches	3.3
G71	*	?	*	Programming in millimeters	3.3



ISO code programming



CNC 8035

·M· MODEL
(SOFT V15.3x)

A.

ISO code programming

Function	M	D	V	Meaning	Section
G72	*		*	General and specific scaling factor	7.6
G73	*		*	Pattern rotation	7.7
G74			*	Home search	4.2
G75			*	Probing move until touching	11.1
G76			*	Probing move while touching	11.1
G79				Canned cycle parameter modification	9.2.1
G80	*	*		Canned cycle cancellation	9.3
G81	*		*	Drilling canned cycle	9.7
G82	*		*	Drilling canned cycle with dwell	9.8
G83	*		*	Deep-hole drilling canned cycle with constant peck	9.9
G84	*		*	Tapping canned cycle	9.10
G85	*		*	Reaming canned cycle	9.11
G86	*		*	Boring canned cycle with withdrawal in G00	9.12
G87	*		*	Rectangular pocket canned cycle.	9.13
G88	*		*	Circular pocket canned cycle	9.14
G89	*		*	Boring canned cycle with withdrawal in G01	9.15
G90	*	?		Absolute programming:	3.4
G91	*	?	*	Incremental programming	3.4
G92				Coordinate preset / spindle speed limit	4.4.1
G93				Polar origin preset	4.5
G94	*	?		Feedrate in millimeters (inches) per minute	5.2.1
G95	*	?	*	Feedrate in millimeters (inches) per revolution.	5.2.2
G96	*		*	Constant cutting point speed	5.2.3
G97	*	*		Constant tool center speed	5.2.4
G98	*	*		Withdrawal to the starting plane at the end of the canned cycle	9.5
G99	*		*	Withdrawal to the reference plane at the end of the canned cycle	9.5

M means modal, i.e. the G function, once programmed, remains active while another incompatible G function is not programmed or until an M02, M30, EMERGENCY or RESET is executed or the CNC is turned off and back on.

D means BY DEFAULT, i.e. they will be assumed by the CNC when it is powered on, after executing M02, M30 or after EMERGENCY or RESET.

In those cases indicated by ? , it should be understood that the DEFAULT of these G functions depends on the setting of the general machine parameters of the CNC.

V means that the G code is displayed next to the current machining conditions in the execution and simulation modes.



CNC 8035

-M- MODEL
(SOFT V15.3x)

PROGRAM CONTROL INSTRUCTIONS

Display instructions.

(section 13.2)
(ERROR integer, "error text") Stops the execution of the program and displays the indicated error.
(MSG "message") Displays the indicated message.
(DGWZ expression 1, expression 6) Define the graphics area.

Enabling and disabling instructions.

(section 13.3)
(ESBLK and DSBLK) The CNC executes all the blocks between ESBLK and DSBLK as if it were a single block.
(ESTOP and DSTOP) Enabling (ESTOP) and disabling (DSTOP) of the Stop key and the external Stop signal (PLC).
(EFHOLD and DFHOLD) Enabling (EFHOLD) and disabling (DFHOLD) of the Feed-hold input (PLC).

Flow control instructions.

(section 13.4)
(GOTO N(expression)) It causes a jump within the same program, to the block defined by the label N(expression).
(RPT N(expression), N(expression), P(expression)) It repeats the execution of the portion of the program between the blocks defined by means of the labels N(expression).
(IF condition <action1> ELSE <action2>) It analyzes the given condition that must be a relational expression. If the condition is true (result equal to 1), <action1> will be executed, otherwise (result equal to 0) <action2> will be executed.

Subroutine instructions.

(section 13.5)
(SUB integer) Subroutine definition.
(RET) End of subroutine.
(CALL (expression)) Call to a subroutine.
(PCALL (expression), (assignment instruction), (assignment instruction),...) Call to a subroutine. In addition, using assignment instructions, it is possible to initialize up to a maximum of 26 local parameters of this subroutine.
(MCALL (expression), (assignment instruction), (assignment instruction),...) Same as the PCALL instruction, but making the indicated subroutine modal.
(MDOFF) Cancellation of modal subroutine.

B.

Program control instructions



CNC 8035

·M· MODEL
(SOFT V15.3x)

Interruption-subroutine instructions.

(section 13.6)
(REPOS X, Y, Z,) It must always be used inside an interruption subroutine and facilitates the repositioning of the machine axes to the point of interruption.

Program instructions.

(section 13.7)
(EXEC P(expression), (directory)) Starts program execution..
(MEXEC P(expression), (directory)) Starts program execution in modal mode.
(OPEN P(expression), (destination directory), A/D, "program comment") It begins editing a new program being possible to associate a comment with the program.
(WRITE <block text>) It adds, after the last block of the program which began to be edited by means of the mnemonic OPEN P, the information contained in <block text> as a new program block.

Screen customizing instructions.

(section 13.8)
(PAGE (expression)) The screen displays the indicated user page number (0-255) or system page (1000).
(SYMBOL (expression 1), (expression 2), (expression 3)) The screen displays the symbol (0-255) indicated by the expression 1. Its position on the screen is defined by expression 2 (row, 0-639) and by expression 3 (column 0-335).
(IB (expression) = INPUT "text", format) It displays the text indicated in the data input window and stores in the input variable (IBn) the data entered by the user.
(ODW (expression 1), (expression 2), (expression 3)) It defines and draws a white window on the screen (1 row and 14 columns). Its position on screen is defined by expression 2 (row) and by expression 3 (column).
(DW(expression 1) = (expression 2), DW (expression 3) = (expression 4), ...) It displays in the windows indicated by the value of the expression 1, 3,..., the numerical data indicated by the expression 2,4,..
(SK (expression 1) = "text1" (expression 2) = "text 2",) It defines and displays the new softkey menu indicated.
(WKEY) It stops the execution of the program until a key is pressed.
(WBUF "text", (expression)) It adds the text and value of the expression, once it has been evaluated, to the block that is being edited and within the data entry window.
(WBUF) Enters the block being edited into memory. It can only be used in the screen customizing program to be executed in the Editing mode.
(SYSTEM) It ends the execution of the user screen customizing program and returns to the corresponding standard menu of the CNC.

B.

Program control instructions



CNC 8035

-M- MODEL
(SOFT V15.3x)

SUMMARY OF INTERNAL CNC VARIABLES.

- The R symbol indicates that the variable can be read.
- The W symbol indicates that the variable can be modified.

Variables associated with tools.

Variable	CNC	PLC	DNC	(section 12.2.2)
TOOL	R	R	R	Number of the active tool.
TOD	R	R	R	Number of active tool offset.
NXTOOL	R	R	R	Number of the next requested tool waiting for M06.
NXTOD	R	R	R	Number of the next tool's offset.
TMZPn	R	R	-	(n) tool's position in the tool magazine.
TLFDn	R/W	R/W	-	(n) tool's offset number.
TLFFn	R/W	R/W	-	(n) tool's family code.
TLFNn	R/W	R/W	-	Nominal life assigned to tool (n).
TLFRn	R/W	R/W	-	Real life value of tool (n).
TMZTn	R/W	R/W	-	Contents of tool magazine position (n).
HTOR	R/W	R	R	Tool radius being used by the CNC to do the calculations.
TORn	R/W	R/W	-	Tool radius value of offset (n).
TOLn	R/W	R/W	-	Tool length value of offset (n).
TOIn	R/W	R/W	-	Tool radius wear of offset (n).
TOKn	R/W	R/W	-	Tool length wear of offset (n).

Variables associated with zero offsets.

Variable	CNC	PLC	DNC	(section 12.2.3)
ORG(X-C)	R	R	-	Active zero offset on the selected axis. The value of the additive offset indicated by the PLC is not included.
PORGF	R	-	R	Abscissa coordinate value of polar origin.
PORGS	R	-	R	Ordinate coordinate value of polar origin.
ORG(X-C)n	R/W	R/W	R	Zero offset (n) value of the selected axis.
PLCOF(X-C)	R/W	R/W	R	Value of the additive zero offset activated via PLC.
ADIOF(X-C)	R	R	R	Value for the selected axis of the zero offset with additive handwheel.

Variables associated with machine parameters.

Variable	CNC	PLC	DNC	(section 12.2.4)
MPGn	R	R	-	Value assigned to general machine parameter (n).
MP(X-C)n	R	R	-	Value assigned to (X-C) axis machine parameter (n).
MPSn	R	R	-	Value assigned to machine parameter (n) of the main spindle.
MPLCn	R	R	-	Value assigned to machine parameter (n) of the PLC.

Variables associated with work zones.

Variable	CNC	PLC	DNC	(section 12.2.5)
FZONE	R	R/W	R	Status of work zone 1.
FZLO(X-C)	R	R/W	R	Work zone 1. Lower limit along the selected axis (X/C).
FZUP(X-C)	R	R/W	R	Work zone 1. Upper limit along the selected axis (X-C).
SZONE	R	R/W	R	Status of work zone 2.
SZLO(X-C)	R	R/W	R	Work zone 2. Lower limit along the selected axis (X/C).
SZUP(X-C)	R	R/W	R	Work zone 2. Upper limit along the selected axis (X-C).
TZONE	R	R/W	R	Status of work zone 3.
TZLO(X-C)	R	R/W	R	Work zone 3. Lower limit along the selected axis (X/C).
TZUP(X-C)	R	R/W	R	Work zone 3. Upper limit along the selected axis (X-C).
FOZONE	R	R/W	R	Status of work zone 4.
FOZLO(X-C)	R	R/W	R	Work zone 4. Lower limit along the selected axis (X/C).
FOZUP(X-C)	R	R/W	R	Work zone 4. Upper limit along the selected axis (X-C).
FIZONE	R	R/W	R	Status of work zone 5.
FIZLO(X-C)	R	R/W	R	Work zone 5. Lower limit along the selected axis (X/C).
FIZUP(X-C)	R	R/W	R	Work zone 5. Upper limit along the selected axis (X-C).

Feedrate related variables.

Variable	CNC	PLC	DNC	(section 12.2.6)
FREAL	R	R	R	Real feedrate of the CNC in mm/min or inch/min.
FREAL(X-C)	R	R	R	Actual (real) CNC feedrate of the selected axis.
FTEO(X-C)	R	R	R	Theoretical CNC feedrate of the selected axis.

Variables associated with function G94.

FEED	R	R	R	Active feedrate at the CNC in mm/min or inch/min.
DNCF	R	R	R/W	Feedrate selected via DNC.
PLCF	R	R/W	R	Feedrate selected via PLC.
PRGF	R	R	R	Feedrate selected by program.

Variables associated with function G95.

FPREV	R	R	R	Active feedrate at CNC, in m/rev or inch/rev.
DNCFPR	R	R	R/W	Feedrate selected via DNC.
PLCFPR	R	R/W	R	Feedrate selected via PLC.
PRGFPR	R	R	R	Feedrate selected by program.

C.

Summary of internal CNC variables.

FAGOR 

CNC 8035

·M· MODEL
(SOFT V15.3x)

Variables associated with function G32.

PRGFIN	R	R	R	Feedrate selected by program, in 1/min.
--------	---	---	---	---

Variables associated with feedrate override (%)

FRO	R	R	R	Feedrate Override (%) active at the CNC.
PRGFRO	R/W	R	R	Override (%) selected by program.
DNCFRO	R	R	R/W	Override (%) selected via DNC.
PLCFRO	R	R/W	R	Override (%) selected via PLC.
CNCFRO	R	R	R	Override (%) selected from the front panel knob.
PLCCFR	R	R/W	R	Override (%) of the PLC execution channel.

Coordinate related variables.

Variable	CNC	PLC	DNC	(section 12.2.7)
PPOS(X-C)	R	-	-	Programmed theoretical position value (coordinate).
POS(X-C)	R	R	R	Machine coordinates. Real coordinates of the tool base.
TPOS(X-C)	R	R	R	Machine coordinates. Theoretical coordinates of the tool base.
APOS(X-C)	R	R	R	Part coordinates. Real coordinates of the tool base.
ATPOS(X-C)	R	R	R	Part coordinates. Theoretical coordinates of the tool base.
DPOS(X-C)	R	R	R	Theoretical position of the probe when the probe touched the part.
FLWE(X-C)	R	R	R	Following error of the indicated axis.
DIST(X-C)	R/W	R/W	R	Distance traveled by the indicated axis.
LIMPL(X-C)	R/W	R/W	R	Second upper travel limit.
LIMMI(X-C)	R/W	R/W	R	Second lower travel limit.
DPLY(X-C)	R	R	R	Coordinate of the selected axis displayed on the screen.
GPOS(X-C)n p	R	-	-	Coordinate of the selected axis, programmed in the (n) block of the program (p).

Variables associated with electronic handwheels.

Variable	CNC	PLC	DNC	(section 12.2.8)
HANPF	R	R	-	Pulses received from 1st handwheel since the CNC was turned on.
HANPS	R	R	-	Pulses received from 2nd handwheel since the CNC was turned on.
HANPT	R	R	-	Pulses received from 3rd handwheel since the CNC was turned on.
HANPFO	R	R	-	Pulses received from 4th handwheel since the CNC was turned on.
HANDSE	R	R	-	For handwheels with a selector button, it indicates whether that button has been pressed or not.
HANFCT	R	R/W	R	Multiplying factor different for each handwheel (when having several).
HBEVAR	R	R/W	R	HBE handwheel. Reading enabled, axis being jogged and multiplying factor (x1, x10, x100).
MASLAN	R/W	R/W	R/W	Linear path angle for "Path handwheel" or "Path Jog" mode.
MASCFI	R/W	R/W	R/W	Arc center coordinates for "Path handwheel mode" or "Path jog".
MASCSE	R/W	R/W	R/W	Arc center coordinates for "Path handwheel mode" or "Path jog".

Feedback related variables.

Variable	CNC	PLC	DNC	(section 12.2.9)
ASIN(X-C)	R	R	R	A signal of the CNC's sinusoidal feedback for the selected axis.
BSIN(X-C)	R	R	R	B signal of the CNC's sinusoidal feedback for the selected axis.
ASINS	R	R	R	"A" signal of the CNC's sinusoidal feedback for the spindle.
BSINS	R	R	R	"B" signal of the CNC's sinusoidal feedback for the spindle.

Variables associated with the main spindle.

Variable	CNC	PLC	DNC	(section 12.2.10)
SREAL	R	R	R	Real spindle speed
FTEOS	R	R	R	Theoretical spindle speed.

Variables associated with spindle speed.

SPEED	R	R	R	Active spindle speed at the CNC.
DNCS	R	R	R/W	Spindle speed selected via DNC.
PLCS	R	R/W	R	Spindle speed selected via PLC.
PRGS	R	R	R	Spindle speed selected by program.

Variables associated with the spindle override.

SSO	R	R	R	Spindle Speed Override (%) active at the CNC.
PRGSSO	R/W	R	R	Override (%) selected by program.
DNCSO	R	R	R/W	Override (%) selected via DNC.
PLCSSO	R	R/W	R	Override (%) selected via PLC.
CNCSO	R	R	R	Spindle Speed Override (%) selected from front panel.

Speed limit related variables.

SLIMIT	R	R	R	Spindle speed limit active at the CNC.
DNCSL	R	R	R/W	Spindle speed limit selected via DNC.
PLCSL	R	R/W	R	Spindle speed limit selected via PLC.
PRGSL	R	R	R	Spindle speed limit selected by program.
MDISL	R	R/W	R	Maximum machining spindle speed.



Summary of internal CNC variables.



CNC 8035

-M- MODEL
(SOFT V15.3x)

Position related variables.

POSS	R	R	R	Real Spindle position. Reading from the PLC in ten-thousandths of a degree (within ±999999999) and from the CNC in degrees (within ±99999.9999).
RPOSS	R	R	R	Real Spindle position. Reading from the PLC in ten-thousandths of a degree (between 0 and 3600000) and from the CNC in degrees (between 0 and 360).
TPOSS	R	R	R	Theoretical spindle position. Reading from the PLC in ten-thousandths of a degree (within ±999999999) and from the CNC in degrees (within ±99999.9999).
RTPOSS	R	R	R	Theoretical spindle position. Reading from the PLC in ten-thousandths of a degree (between 0 and 3600000) and from the CNC in degrees (between 0 and 360).
PRGSP	R	R	R	Position programmed in M19 via program for the main spindle.

Variables related to the following error.

FLWES	R	R	R	Spindle following error.
-------	---	---	---	--------------------------

Position related variables.

SPOSS	R	R	R	Real Spindle position. Reading from the PLC in ten-thousandths of a degree (within ±999999999) and from the CNC in degrees (within ±99999.9999).
SRPOSS	R	R	R	Real Spindle position. Reading from the PLC in ten-thousandths of a degree (between 0 and 3600000) and from the CNC in degrees (between 0 and 360).
STPOSS	R	R	R	Theoretical spindle position. Reading from the PLC in ten-thousandths of a degree (within ±999999999) and from the CNC in degrees (within ±99999.9999).
SRTPOS	R	R	R	Theoretical spindle position. Reading from the PLC in ten-thousandths of a degree (between 0 and 3600000) and from the CNC in degrees (between 0 and 360).
SDRPOS	R	R	R	Position indicated by the drive.

Variables related to the following error.

SFLWES	R	R	R	Spindle following error.
--------	---	---	---	--------------------------

PLC related variables.

Variable	CNC	PLC	DNC	(section 12.2.11)
PLCMMSG	R	-	R	Number of the active PLC message with the highest priority.
PLCIn	R/W	-	-	32 PLC inputs starting from (n).
PLCO _n	R/W	-	-	32 PLC outputs starting from (n).
PLCM _n	R/W	-	-	32 PLC marks starting from (n).
PLCR _n	R/W	-	-	(n) Register.
PLCT _n	R/W	-	-	Indicated (n) Timer's count.
PLCC _n	R/W	-	-	Indicated (n) Counter's count.
PLCMM _n	R/W	-	-	Modifies the (n) mark of the PLC.

Variables associated with local and global parameters.

Variable	CNC	PLC	DNC	(section 12.2.12)
GUP _n	-	R/W	-	Global parameter (P100-P299) (n).
LUP (a,b)	-	R/W	-	Indicated local (P0-P25) parameter (b) of the nesting level (a).
CALLP	R	-	-	Indicates which local parameters have been defined by means of a PCALL or MCALL instruction (calling a subroutine).

Operating-mode related variables.

Variable	CNC	PLC	DNC	(section 12.2.13)
OPMODE	R	R	R	Operating mode.



Summary of internal CNC variables.



CNC 8035

·M· MODEL
(SOFT V15.3x)

Other variables.

Variable	CNC	PLC	DNC	(section 12.2.14)
NBTOOL	R	-	R	Number of the tool being managed..
PRGN	R	R	R	Number of the program in execution.
BLKN	R	R	R	Label number of the last executed block.
GSn	R	-	-	Status of the indicated G function (n).
GGSA	-	R	R	Status of functions G00 thru G24.
GGSB	-	R	R	Status of functions G25 thru G49.
GGSC	-	R	R	Status of functions G50 thru G74.
GGSD	-	R	R	Status of functions G75 thru G99.
MSn	R	-	-	Status of the indicated M function (n)
GMS	-	-	R	Status of M functions: M (0..6, 8, 9, 19, 30, 41..44).
PLANE	R	R	R	Abscissa and ordinate axes of the active plane.
LONGAX	R	R	R	Axis affected by the tool length compensation (G15).
MIRROR	R	R	R	Active mirror images.
SCALE	R	R	R	General scaling factor applied. Reading from the PLC in ten-thousandths.
SCALE(X-C)	R	R	R	Scaling Factor applied only to the indicated axis. Reading from the PLC in ten-thousandths.
ORGTOT	R	R	R	Rotation angle (G73) of the coordinate system.
ROTPF	R	-	-	Abscissa of rotation center.
ROTPS	R	-	-	Ordinate of rotation center.
PRBST	R	R	R	Returns probe status.
CLOCK	R	R	R	System clock in seconds.
TIME	R	R	R/W	Time in Hours, minutes and seconds.
DATE	R	R	R/W	Date in Year-Month-Day format
TIMER	R/W	R/W	R/W	Clock activated by PLC, in seconds.
CYTIME	R	R	R	Time to execute a part in hundredths of a second.
PARTC	R/W	R/W	R/W	Parts counter of the CNC.
FIRST	R	R	R	First time a program is executed.
KEY	R/W	R/W	R/W	keystroke code.
KEYSRC	R/W	R/W	R/W	Source of the keys.
ANAI _n	R	R	R	Voltage (in volts) of the indicated analog input (n).
ANAO _n	R/W	R/W	R/W	Voltage (in volts) to apply to the indicated output (n).
CNCERR	-	R	R	Active CNC error number.
PLCERR	-	-	R	Active PLC error number.
DNCERR	-	R	-	Number of the error generated during DNC communications.
DNCSTA	-	R	-	DNC transmission status.
TIMEG	R	R	R	Remaining time to finish the dwell block (in hundredths of a second).
SELPRO	R/W	R/W	R	When having two probe inputs, it selects the active input.
DIAM	R/W	R/W	R	It changes the programming mode for X axis coordinates between radius and diameter.
PRBMOD	R/W	R/W	R	Indicates whether a probing error must be displayed or not.
RIP	R	R	R	Linear theoretical feedrate resulting from the next loop (in mm/min).



Summary of internal CNC variables.



The "KEY" variable can be "written" at the CNC only via the user channel.

The "NBTOOL" variable can only be used within the tool change subroutine.




CNC 8035


·M· MODEL
(SOFT V15.3x)

KEY CODES

Alphanumeric operator panel (M-T models)

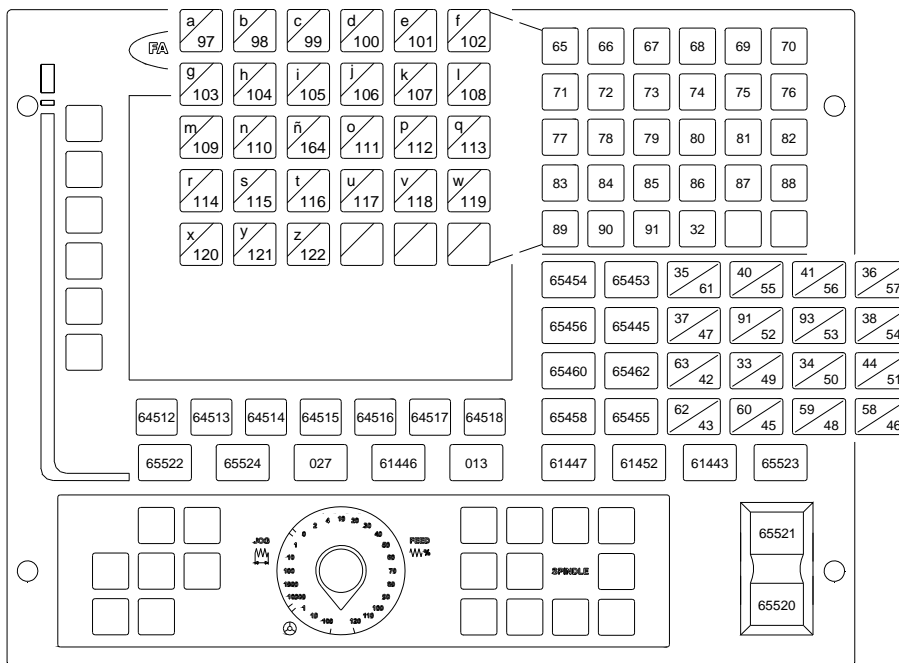

D.
Key codes

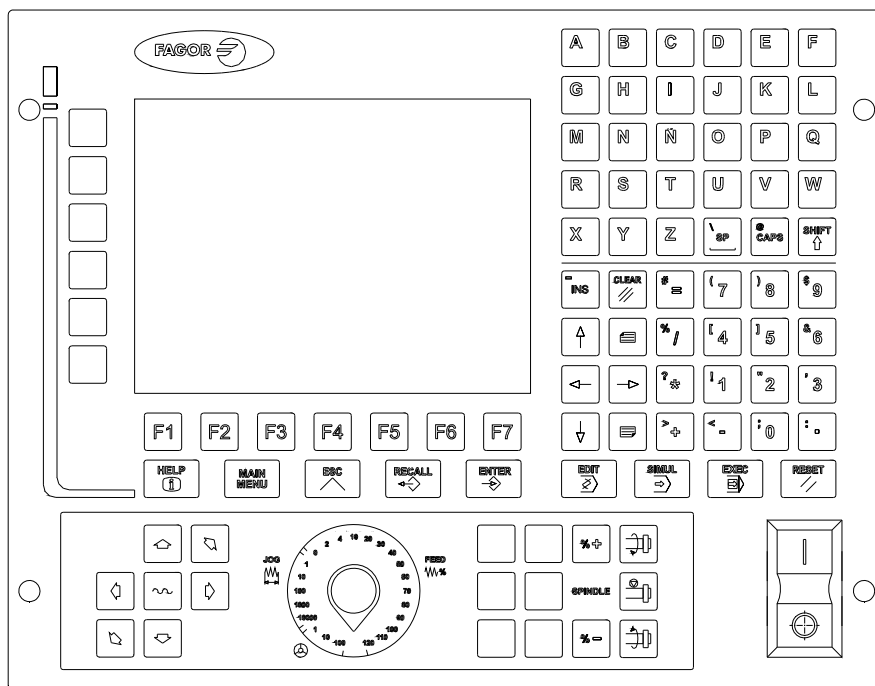

FAGOR

CNC 8035

M- MODEL
(SOFT V15.3x)

D.

Key codes



CNC 8035

·M· MODEL
(SOFT V15.3x)

MAINTENANCE

Cleaning

The accumulated dirt inside the unit may act as a screen preventing the proper dissipation of the heat generated by the internal circuitry which could result in a harmful overheating of the CNC and, consequently, possible malfunctions.

On the other hand, accumulated dirt can sometimes act as an electrical conductor and shortcircuit the internal circuitry, especially under high humidity conditions.

To clean the operator panel and the monitor, a smooth cloth should be used which has been dipped into de-ionized water and /or non abrasive dish-washer soap (liquid, never powder) or 75° alcohol.

Do not use highly compressed air to clean the unit because it could generate electrostatic discharges.

The plastics used on the front panel are resistant to :

- Grease and mineral oils.
- Bases and bleach.
- Dissolved detergents.
- Alcohol.



Fagor Automation shall not be held responsible for any material or physical damage derived from the violation of these basic safety requirements.

To check the fuses, first unplug the unit from mains. If the CNC does not turn on when flipping the power switch, check that the fuses are the right ones and they are in good condition.

Avoid solvents. The action of solvents such as chlorine hydrocarbons, benzole, esters and ether may damage the plastics used to make the front panel of the unit.

Do not get into the inside of the unit. Only personnel authorized by Fagor Automation may manipulate the inside of this unit.

Do not handle the connectors with the unit connected to main AC power. Before handling these connectors (I/O, feedback, etc.), make sure that the unit is not connected to main AC power.

Maintenance


FAGOR

CNC 8035

·M· MODEL
(SOFT V15.3x)

E.

APPENDIX

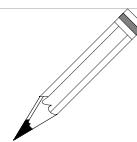

CNC 8035

-M- MODEL
(SOFT V15.3x)





E.



CNC 8035

·M· MODEL
(SOFT V15.3x)

E.

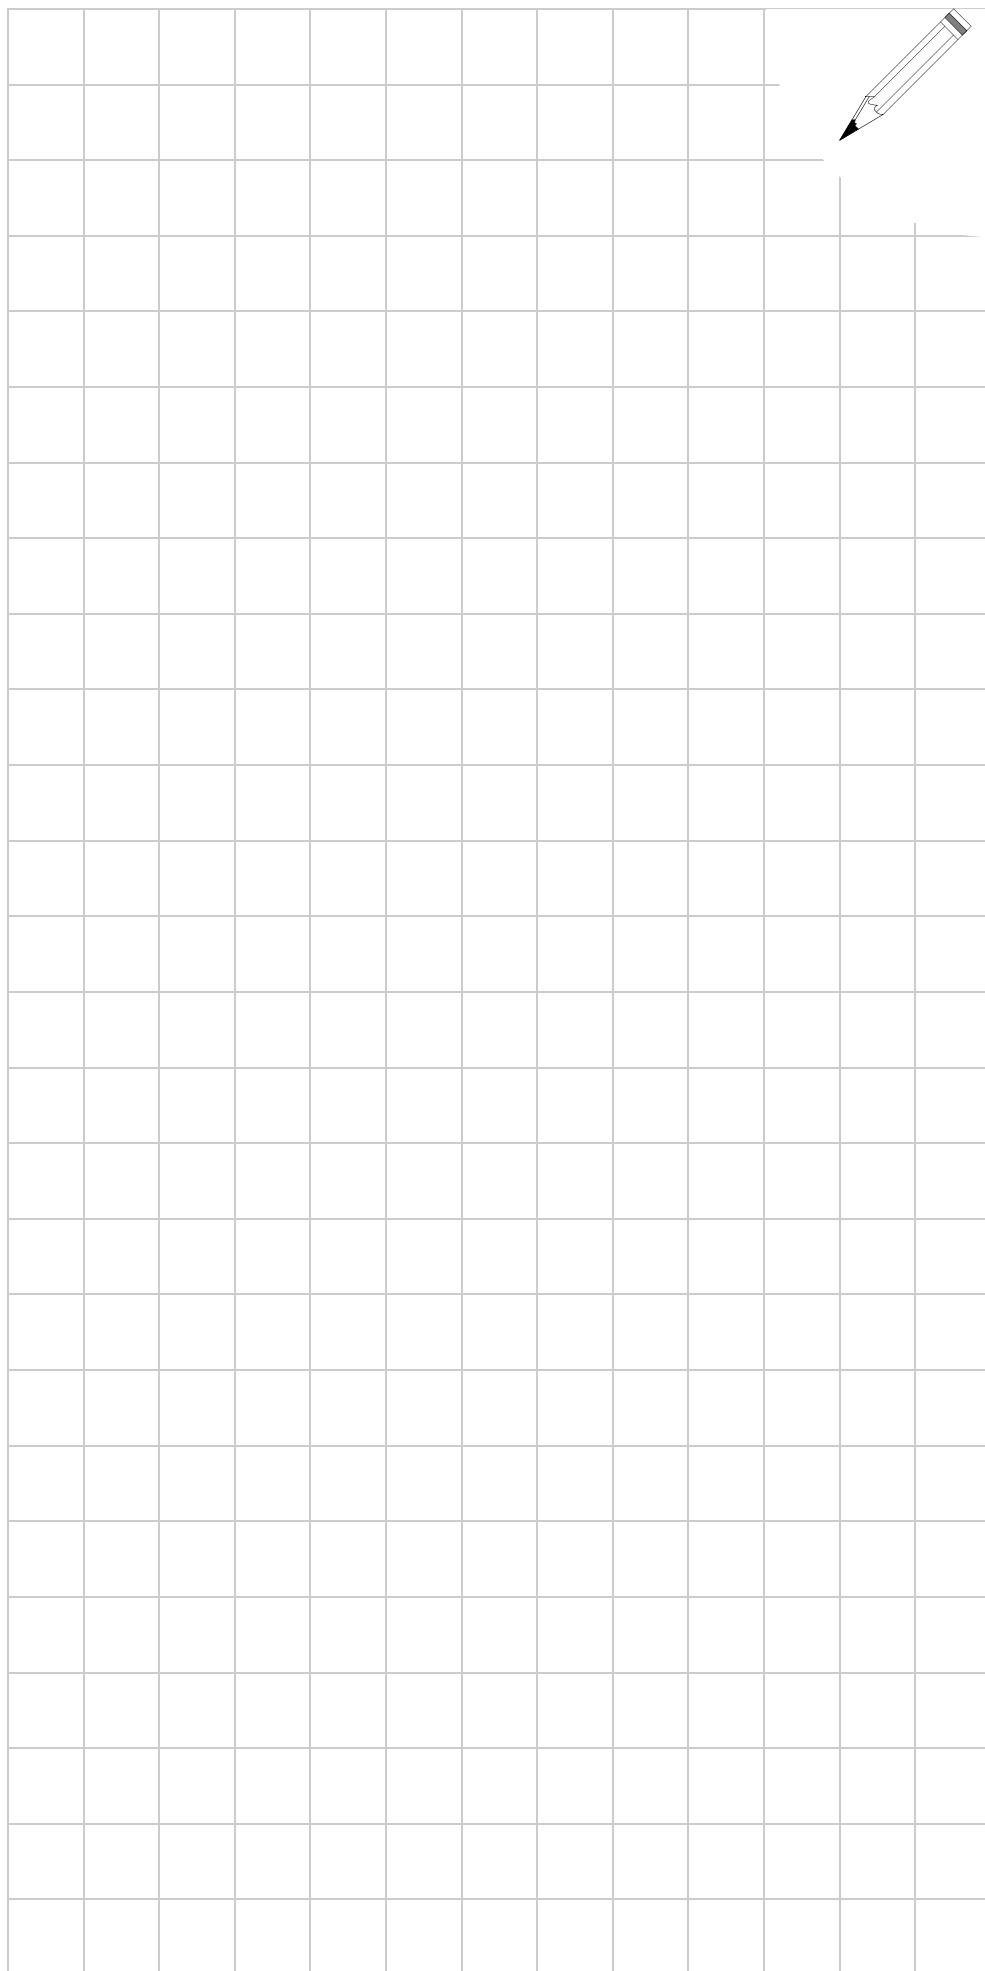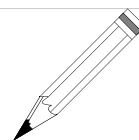

CNC 8035

-M- MODEL
(SOFT V15.3x)